

(22) Date de dépôt/Filing Date: 2016/11/24
(41) Mise à la disp. pub./Open to Public Insp.: 2017/01/25
(45) Date de délivrance/Issue Date: 2018/04/10
(30) Priorité/Priority: 2016/03/24 (JP2016-059848)


(51) Cl.Int./Int.Cl. *B29C 64/188* (2017.01),
B29C 64/153 (2017.01), *B29C 64/386* (2017.01)

(72) Inventeurs/Inventors:
AMAYA, KOUICHI, JP;
ISHIMOTO, KOUSUKE, JP

(73) Propriétaire/Owner:
MATSUURA MACHINERY CORPORATION, JP

(74) **Agent:** RIDOUT & MAYBEE LLP

(54) Titre : METHODE DE FACONNAGE TRIDIMENSIONNEL
(54) Title: THREE-DIMENSIONAL SHAPING METHOD

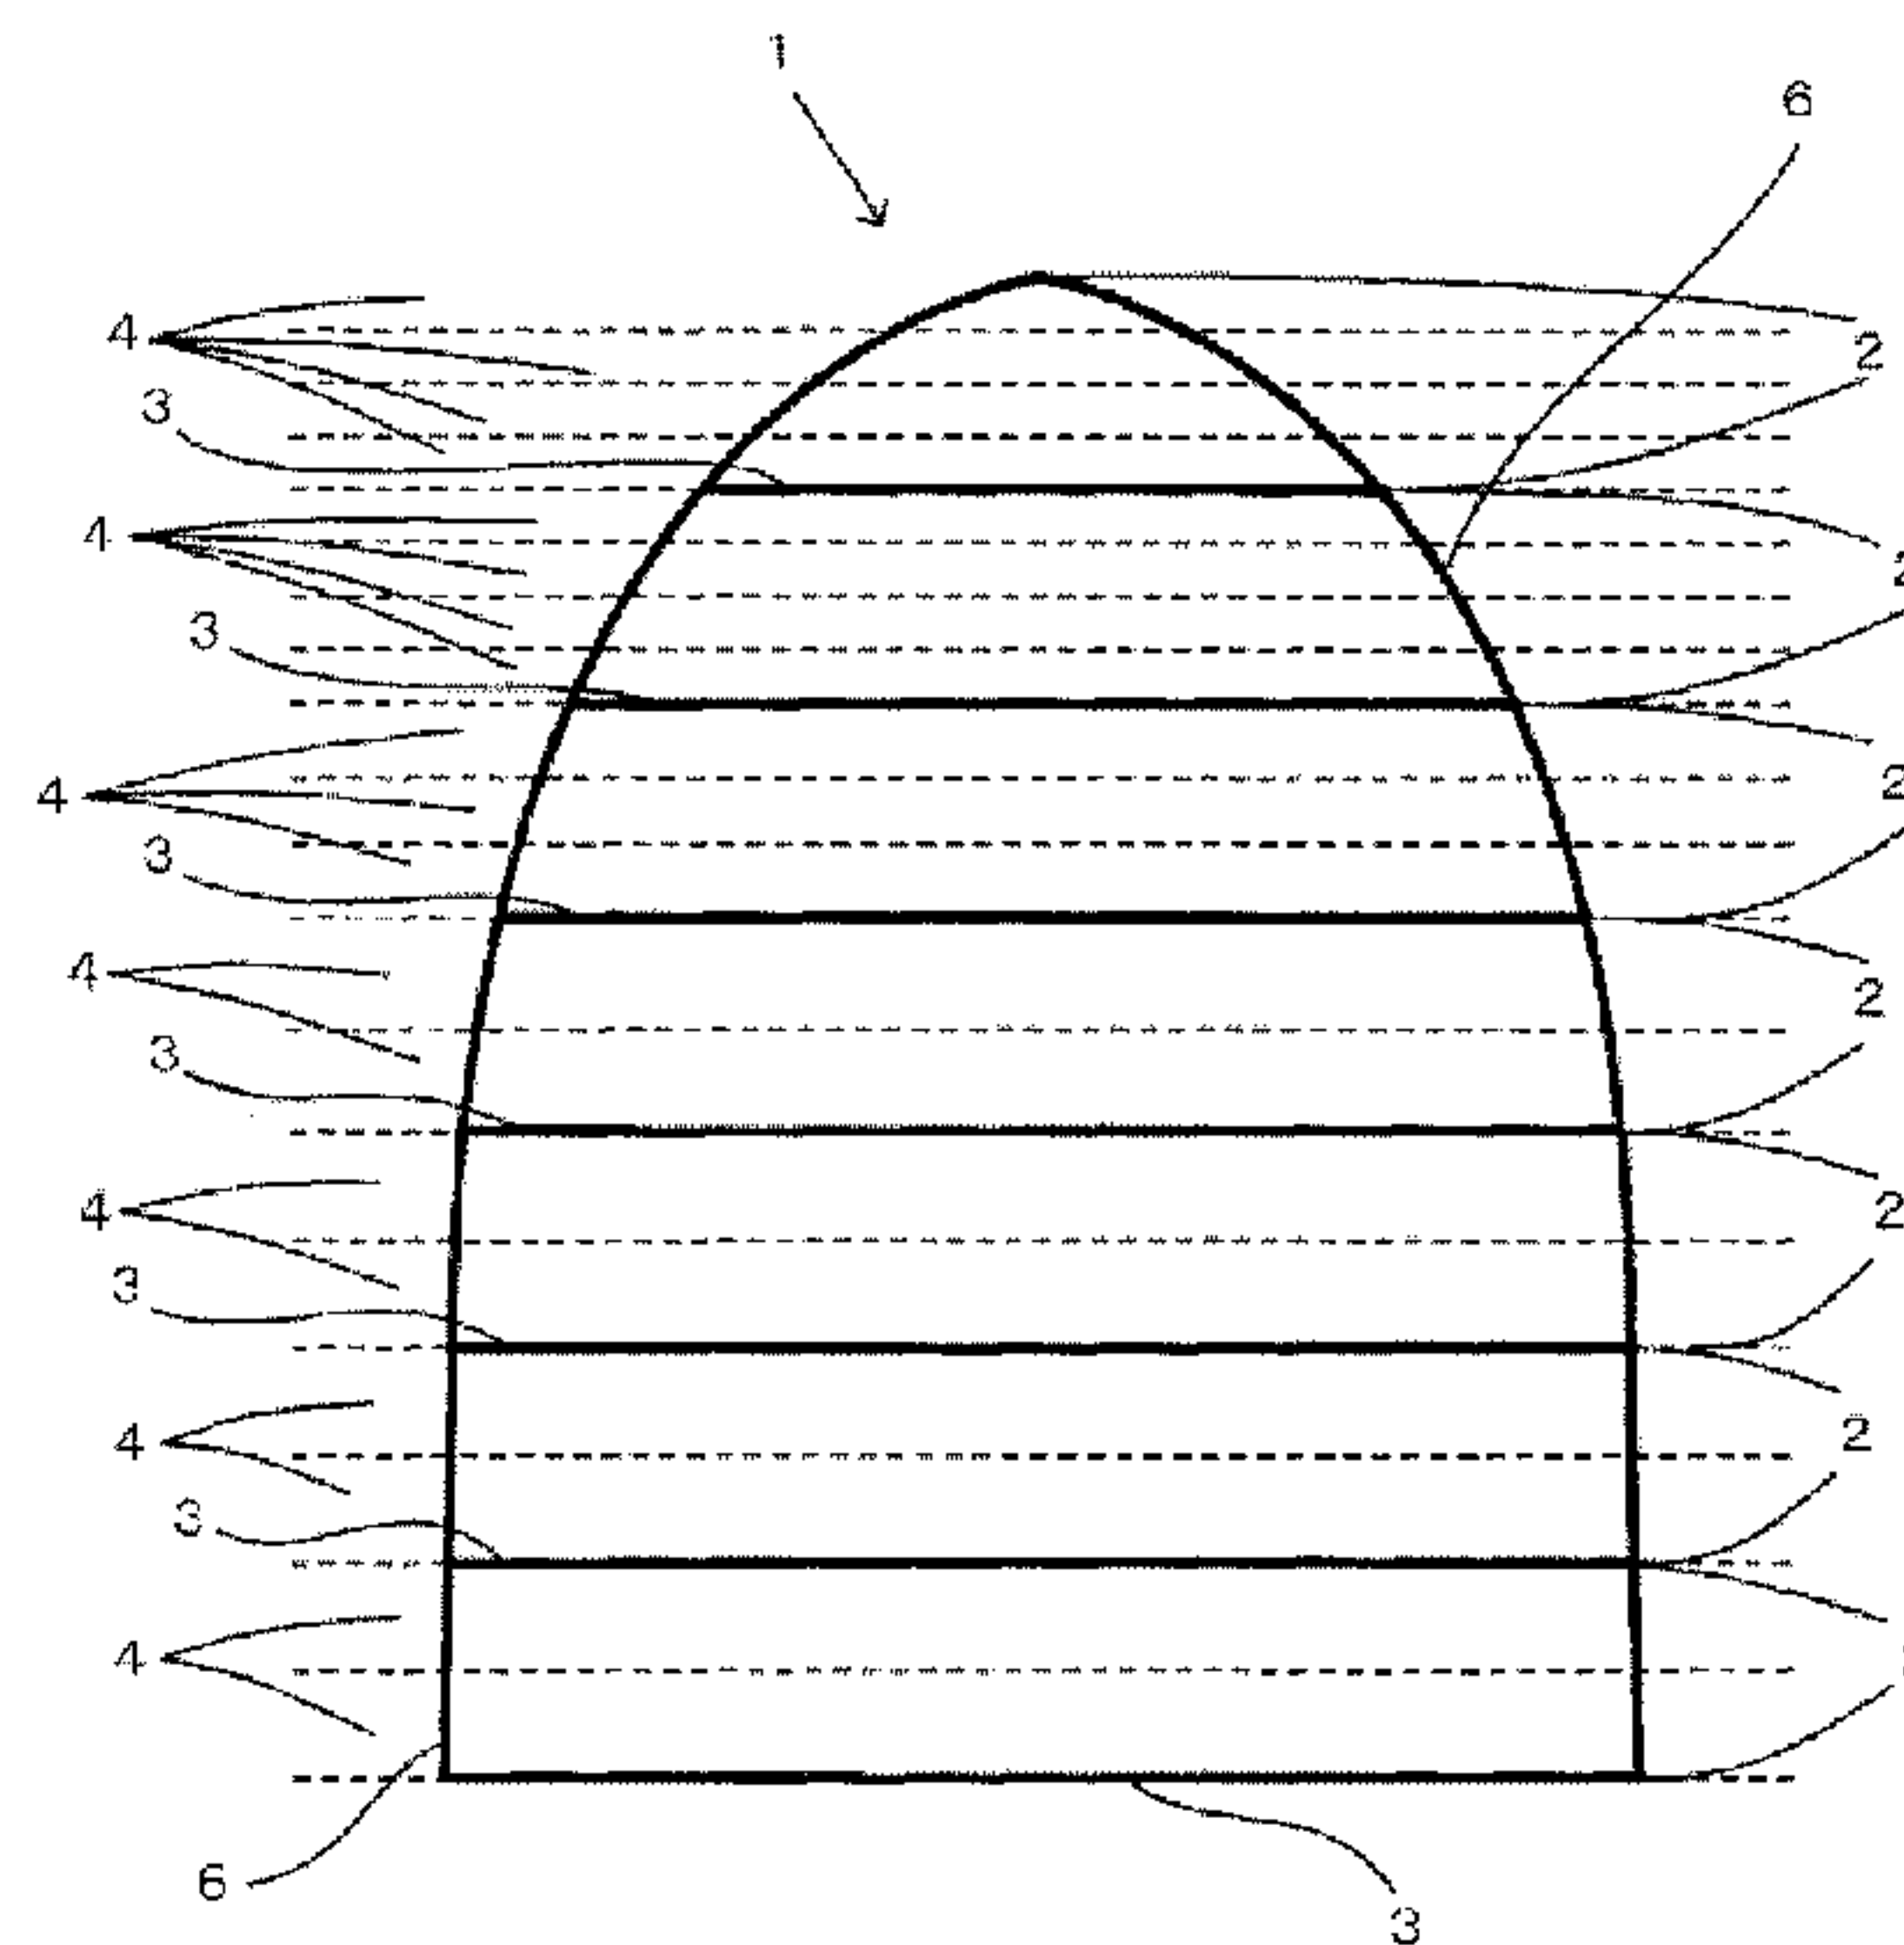

(57) **Abrégé/Abstract:**

[Problem] An object is to provide a configuration in which, in a three-dimensional shaping method, the thickness of each multilayer unit is appropriately set according to the degree of variation in the cross section of a shaped object in a horizontal direction along a height direction.

[Solution Means] In order to achieve the above object, a three-dimensional shaping method is provided in which a step of forming a powder layer and a step of sintering the powder layer by the application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container, where a plurality of equal-width divided regions 2 are set in a multilayer region 4 along a height direction, and then the number of multilayers N in each of equal-width divided regions 2 which can reflect the degree of variations, according to the degree of variations in the shape of the cross section 3 of a boundary on the upper side and the shape of the cross section 3 of a boundary on the lower side in each of the equal-width divided regions 2, and furthermore, the thickness of each multilayer unit in each of the equal-width divided regions 2 is selected, and moreover the coordinates of an outer periphery 6 in each of the cross sections 3 of the number N are set.

[TITLE OF DOCUMENT] ABSTRACT

[Abstract]

[Problem] An object is to provide a configuration in which, in a three-dimensional shaping method, the thickness of each multilayer unit is appropriately set according to the degree of variation in the cross section of a shaped object in a horizontal direction along a height direction.

[Solution Means] In order to achieve the above object, a three-dimensional shaping method is provided in which a step of forming a powder layer and a step of sintering the powder layer by the application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container, where a plurality of equal-width divided regions 2 are set in a multilayer region 4 along a height direction, and then the number of multilayers N in each of equal-width divided regions 2 which can reflect the degree of variations, according to the degree of variations in the shape of the cross section 3 of a boundary on the upper side and the shape of the cross section 3 of a boundary on the lower side in each of the equal-width divided regions 2, and furthermore, the thickness of each multilayer unit in each of the equal-width divided regions 2 is selected, and moreover the coordinates of an outer periphery 6 in each of the cross sections 3 of the number N are set.

[Selected Drawing] Fig. 4

[TITLE OF DOCUMENT] SPECIFICATION

[Title of Invention] THREE-DIMENSIONAL SHAPING METHOD

[Technical Field]

[0001]

The present invention relates to a method of manufacturing a three-dimensional shaped article in which when a step of forming a powder layer and a sintering step using a laser beam or an electron beam on the powder layer are repeated, the thickness of each multilayer unit can be selected.

[Background Art]

[0002]

In a three-dimensional shaping method, the thickness of each multilayer unit is constant in most cases.

[0003]

In actuality, in Patent Document 1, although consideration is given to the optimization of the thickness of the outermost surface layer in three-dimensional shaping, the thickness is not changed for each multilayer unit.

[0004]

However, Patent Document 2 discloses that, when in a multilayer operation in a predetermined stage, a convex portion exceeding the thickness of multilayers is detected, the thickness of multilayers in the subsequent stage is set to exceed the height of the convex portion.

[0005]

However, in the setting of the thickness as described above, the thickness is not selected based on unified criteria

corresponding to the overall shape of a shaped object.

[0006]

In actual three-dimensional shaping, a variation in the cross-sectional shape of a shaped object in a horizontal direction, that is, a direction perpendicular to a height direction in which a multilayer operation is performed and the thickness of each multilayer unit are closely connected with each other.

[0007]

Specifically, when the shape of each multilayer cross section is significantly varied along the height direction, the thickness of each multilayer unit is decreased such that the original shape of the shaped object can be accurately realized whereas when only a slight variation in the thickness along the up/down direction is produced, even if the thickness of each multilayer unit is set larger, the original shape of the shaped object does not necessarily become inaccurate.

[0008]

However, in a conventional technique, no consideration is given to the appropriate setting of the thickness of each multilayer unit according to the variation conditions of the cross section in the horizontal direction along the up/down direction.

[Prior Art Documents]

[Patent Documents]

[0009]

Patent Document 1: Japanese Published Unexamined Patent Application No. 2013-67036

Patent Document 2: Japanese Published Unexamined Patent
Application No. 2015-112752

[Summary of Invention]

[Technical Problem]

[0010]

An object of the present invention is to provide, in a three-dimensional shaping method, a configuration in which the thickness of each multilayer unit is appropriately set according to the degree of variation in the cross section of a shaped object in a horizontal direction along a height direction.

[Solution to Problem]

[0011]

In order to achieve the above object, the basic configurations of the present invention are as follows.

(1) A three-dimensional shaping method in which a step of forming a powder layer and a step of sintering the powder layer by application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container, where a plurality of equal-width divided regions are set in a multilayer region to along a height direction, and then according to following processes, a number of multilayers N in each of the equal-width divided regions is selected, for selecting a thickness of each multilayer unit in each of the equal-width divided regions:

1. a process with adopting Cartesian coordinates, that is, (x, y) coordinates and calculating as follows:

in respective cross sections forming boundaries of both upper and lower sides in the equal-width divided regions of a model which is to be shaped, from each coordinates position

$(x_1, y_1) \dots (x_i, y_i) \dots (x_h, y_h)$ forming an outer periphery of each cross section and recorded in a CAM or a computer controller, a center position (x_0, y_0) of each of the cross sections is calculated according to

[Formula 1]

$$x_0 = (x_1 + \dots + x_i + \dots + x_h) / h$$

[Formula 2]

$$y_0 = (y_1 + \dots + y_i + \dots + y_h) / h$$

and regarding an average distance r from the center position (x_0, y_0) to each coordinates position $(x_1, y_1) \dots (x_i, y_i) \dots (x_h, y_h)$ in the outer periphery, calculating and recording with a CAM or a computer controller

[Formula 3]

$$r_i = \sqrt{(x_i - x_0)^2 + (y_i - y_0)^2}$$

, and then calculating

[Formula 4]

$$r = (r_1 + \dots + r_i + \dots + r_h) / h$$

and

calculating, for each of the equal-width divided regions, an absolute value d of a difference between an average distance of the respective cross sections in the boundary on the upper side and an average distance of the respective cross sections in the boundary on the lower side;

2. a process for, when it is assumed that d is 0, setting a minimum number of multilayers N_1 , detecting a maximum value D of d and setting a maximum number of multilayers N_2 in the equal-width divided region where the maximum value D is formed;

3. a process for setting an increasing number n as d increases between the minimum value N_1 and the maximum value N_2 , and selecting a number of multilayers N when $N = [n]$,

where $[]$ is a Gauss symbol indicating a unit of an integer;

4. a process for setting, when in each of the equal-width divided regions in the above 1, equal-width division is further performed with the number of multilayers N in the above 3 along an up/down direction, coordinates of the outer periphery corresponding to the model in the above 1 in each of cross sections of the number N ; and

5. a process for controlling, in actual shaping, forming and sintering of the powder layer based on the number of multilayers N selected in the above 3 in each of the equal-width divided regions and movement of a cutting tool in which a position of the coordinates of the outer periphery set in the above 4 is a final cutting position.

(2) A three-dimensional shaping method in which a step of forming a powder layer and a step of sintering the powder layer by application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container, where a plurality of equal-width divided regions are set in a multilayer region along a height direction, and then according to following processes, a number of multilayers N in each of the equal-width divided regions is selected, for selecting a thickness of each multilayer unit in each of the equal-width divided regions:

1. a process with adopting Cartesian coordinates, that is, (x, y) coordinates and then calculating, in respective

cross sections forming boundaries of both upper and lower sides in the equal-width divided regions of a model which is to be shaped, a sum of maximum widths of the respective cross sections in a lateral direction and maximum widths thereof in a vertical direction with a CAM or a computer controller and

calculating, for each of the equal-width divided regions, an absolute value d of a difference between a sum of the respective cross sections in the boundary on the upper side and a sum of the respective cross sections in the boundary on the lower side;

2. a process for, when it is assumed that d is 0, setting a minimum number of multilayers N_1 , detecting a maximum value D of d and setting a maximum number of multilayers N_2 in the equal-width divided region where the maximum value D is formed;

3. a process for setting an increasing number n as d increases between the minimum value N_1 and the maximum value N_2 , and selecting a number of multilayers N when $N = [n]$,

where $[]$ is a Gauss symbol indicating a unit of an integer;

4. a process for setting, when in each of the equal-width divided regions in the above 1, equal-width division is further performed with the number of multilayers N in the above 3 along an up/down direction, coordinates of the outer periphery corresponding to the model in the above 1 in each of cross sections of the number N ; and

5. a process for controlling, in actual shaping, forming and sintering of the powder layer based on the number of multilayers N selected in the above 3 in each of the equal-width divided regions and movement of a cutting tool in which a

position of the coordinates of the outer periphery set in the above 4 is a final cutting position.

(3) A three-dimensional shaping method in which a step of forming a powder layer and a step of sintering the powder layer by application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container, where a plurality of equal-width divided regions are set in a multilayer region along a height direction, and then according to following processes, a number of multilayers N in each of the equal-width divided regions is selected, for selecting a thickness of each multilayer unit in each of the equal-width divided regions:

1. a process with adopting rotational coordinates, that is, (r, θ) coordinates and then calculating as follows:

in respective cross sections forming boundaries of both upper and lower sides in the equal-width divided regions of a model which is to be shaped from coordinates position $(r_1, \theta_1) \dots (r_i, \theta_i) \dots (r_h, \theta_h)$ forming an outer periphery, and recorded in a CAM or a computer controller, a center position (r_0, θ_0) of each of the cross sections is calculated by

[Formula 5]

$$r_0 = (r_1 + \dots + r_i + \dots + r_h) / h$$

[Formula 6]

$$\theta_0 = (\theta_1 + \dots + \theta_i + \dots + \theta_h) / h$$

and regarding each distance from the center position (r_0, θ_0) to each coordinates position $(r_1, \theta_1) \dots (r_i, \theta_i) \dots (r_h, \theta_h)$

forming the outer periphery, shifting already set center point $(0, 0)$ in (r, θ) coordinates to said position (r_0, θ_0) , and calculating $r_1' \dots r_i' \dots r_h'$ from new center position $(0, 0)$ grounding on the shift to each coordinates position of the outer periphery, and selecting a maximum distance from calculated each distance and

calculating, for each of the equal-width divided regions, an absolute value d of a difference between a maximum distance of the respective cross sections in the boundary on the upper side and a maximum distance of the respective cross sections in the boundary on the lower side;

2. a process for, when it is assumed that d is 0, setting a minimum number of multilayers N_1 , detecting a maximum value D of d and setting a maximum number of multilayers N_2 in the equal-width divided region where the maximum value D is formed;

3. a process for setting an increasing number n as d increases between the minimum value N_1 and the maximum value N_2 , and selecting a number of multilayers N when $N = [n]$,

where $[]$ is a Gauss symbol indicating a unit of an integer;

4. a process for setting, when in each of the equal-width divided regions in the above 1, equal-width division is further performed with the number of multilayers N in the above 3 along an up/down direction, coordinates of the outer periphery corresponding to the model in the above 1 in each of cross sections of the number N ; and

5. a process for controlling, in actual shaping, forming and sintering of the powder layer based on the number of multilayers N selected in the above 3 in each of the equal-width divided regions and movement of a cutting tool in which a position of the coordinates of the outer periphery set in the

above 4 is a final cutting position.

[Advantageous Effects of Invention]

[0012]

In the present invention based on the basic configurations (1), (2) and (3), the number of multilayers (N) in each of the equal-width divided regions is set according to a variation in the cross-sectional shape of each of the equal-width divided regions in the boundary in the horizontal direction, that is, the variation in the average distance from the center in the case of the basic configuration (1), the variation in the sum of the maximum widths in the lateral direction and the vertical direction in the Cartesian coordinates in the case of the basic configuration (2) and the variation in the maximum distance from the center position in the rotational coordinates in the case of the basic configuration (3), and the coordinates of the periphery of each of the cross sections based on the appropriate thickness and the number of multilayers (N) are set according to a variation in the surface in each multilayer unit in the horizontal direction, with the result that it is possible to realize the accurate shape of the shaped object.

[Brief Description of Drawings]

[0013]

Fig. 1(a) is a cross-sectional view, when in a basic configuration (1), a center position and an average distance from the center position to an outer periphery and the absolute value d of a difference between the average distance in the cross sections of the boundaries on upper side and the average

distance in the cross sections of the boundaries on lower side are calculated, in the boundary of each of equal-width divided regions which is a target of the calculation;

Fig. 1(b) is a flow chart showing, when in the basic configuration (1), the center position and the average distance from the center position to the outer periphery and the absolute value d of a difference between the average distance in the cross sections of the boundaries on the upper side and the average distance in the cross sections of the boundaries on the lower side are calculated, the order of the calculation;

Fig. 2(a) is a cross-sectional view, when in a basic configuration (2), a sum of the maximum width in a lateral direction and the maximum width in a vertical direction and the absolute value d of a difference between the sum in the cross sections of the boundaries on upper side and the sum in the cross sections of the boundaries on lower side are calculated, in the boundary of each of equal-width divided regions which is a target of the calculation;

Fig. 2(b) is a flow chart showing, when in a basic configuration (2), the sum of the maximum width in the lateral direction and the maximum width in the vertical direction and the absolute value d of a difference between the sum in the cross sections of the boundaries on the upper side and the sum in the cross sections of the boundaries on the lower side are calculated, the order of the calculation;

Fig. 3(a) is a cross-sectional view, when in a basic configuration (3), a center position and the maximum distance from the center position and the absolute value d of a

difference between the maximum distance in the cross sections of the boundaries on upper side and the maximum distance in the cross sections of the boundaries on lower side are calculated, in the boundary of each of equal-width divided regions which is a target of the calculation;

Fig. 3(b) is a flow chart showing, when in a basic configuration (3), a center position and the maximum distance from the center position and the absolute value d of a difference between the maximum distance in the cross sections of the boundaries on the upper side and the maximum distance in the cross sections of the boundaries on the lower side are calculated, the order of the calculation;

Fig. 4 is a cross-sectional view showing a state where, in a model which is to be shaped, the equal-width divided regions are set;

Fig. 5 shows a flow chart for detecting the maximum value D of d in the process of the 2 in each of the basic configurations (1), (2) and (3);

Fig. 6 shows a flow chart of the processes of the 2 and the subsequent numbers among the processes of the 1 to 4 in each of the basic configurations (1), (2) and (3); and

Fig. 7 shows a flow chart for detecting the order of the size of d in K pieces of equal-width divided regions.

[Description of Embodiments]

[0014]

As shown in Fig. 4, the basic configurations (1), (2) and (3) are common in that a plurality of equal-width divided regions 2 are set in the multilayer region 4 along the height

region of the shaping.

[0015]

By the setting of the equal-width divided regions 2 described above, it is possible to select the number of multilayers N in each of the regions and hence select the thickness of the multilayer unit in each of the equal-width

divided regions 2.

[0016]

On both the upper and lower sides of each of the equal-width divided regions 2, the boundaries are always present, however, in each of the equal-width divided regions 2, as a larger variation is produced between the shape of the cross section 3 of the boundary on the upper side and the shape of the cross section 3 of the boundary on the lower side, a large state of variation conditions is produced in the outer periphery 6 along the length direction.

[0017]

Attention is focused on such a state, and in the basic configurations (1), (2) and (3), the number of multilayers N is selected according to the variation conditions described above.

[0018]

Specifically, in the case of the basic configuration (1), as described in the process 1, the average distance of the cross section 3 is selected as a parameter, in the case of the basic configuration (2), the sum of the maximum width of the cross section 3 in the lateral direction and the maximum width thereof in the vertical direction is selected as a parameter and in the case of the basic configuration (3), the maximum distance from the center position 5 is selected as a parameter.

[0019]

These parameters are selected based on the fact that, in each of the equal-width divided regions 2, a larger difference of the each parameters is produced between the cross section 3 on the upper side and the cross section 3 on the lower side, a larger variation condition is produced among respective parameters in the multilayer cross sections 3 along the height direction.

[0020]

Consequently, in the basic configuration (1), as the process 1, in the respective cross sections 3 forming the boundaries of both the upper and lower sides in the equal-width divided regions 2 of a model which is to be shaped, with a CAM or a computer controller and adopting Cartesian coordinates, that is, the (x, y) coordinates, as shown in Figs. 1(a) and 1(b), from each coordinates position $(x_1, y_1) \dots (x_i, y_i) \dots (x_h, y_h)$ of an outer periphery 6, the coordinates position (x_0, y_0) of the center position 5 of each of the cross sections 3 is calculated by

[Formula 7]

$$x_0 = (x_1 + \dots + x_i + \dots + x_h) / h$$

[Formula 8]

$$y_0 = (y_1 + \dots + y_i + \dots + y_h) / h$$

and regarding the average distance r from the center position 5 to each coordinates position $(x_1, y_1) \dots (x_i, y_i) \dots (x_h, y_h)$ of the outer periphery 6,

[Formula 9]

$$r_i = \sqrt{(x_i - x_0)^2 + (y_i - y_0)^2}$$

is calculated and

[Formula 10]

$$r = (r_1 + \dots + r_i + \dots + r_h) / h$$

is calculated, and

for each of the equal-width divided regions 2, the absolute value d of a difference between the average distance of the respective cross sections 3 in the boundary on the upper side and the average distance of the respective cross sections 3 in the boundary on the lower side is calculated, and

in the basic configuration (2), the Cartesian coordinates, that is, the (x, y) coordinates are adopted, and then in the respective cross sections 3 forming boundaries of both the upper and lower sides in the equal-width divided regions 2 of a model which is to be shaped, with a CAM or a computer controller, as shown in Figs. 2(a) and 2(b), the sum of the maximum widths of the respective cross sections 3 in the lateral direction and the maximum widths thereof in the vertical direction are calculated and,

for each of the equal-width divided regions 2, the absolute value d of a difference between the sum of the respective cross sections 3 in the boundary on the upper side and the sum of the respective cross sections 3 in the boundary on the lower side is calculated, and

in the basic configuration (3), the rotational coordinates, that is, the (r, θ) coordinates are adopted, and then in the respective cross sections 3 forming the boundaries of both the upper and lower sides in the equal-width divided regions 2 of a model which is to be shaped, with a CAM or a computer controller, as shown in Figs. 3(a) and 3(b), from coordinates position $(r_1, \theta_1) \dots (r_i, \theta_i) \dots (r_h, \theta_h)$, the center position 5 (r_0, θ_0) of each of the cross sections 3 is calculated by

[Formula 11]

$$r_0 = (r_1 + \dots + r_i + \dots + r_h) / h$$

[Formula 12]

$$\theta_0 = (\theta_1 + \dots + \theta_i + \dots + \theta_h) / h$$

and

regarding each distance from the center position 5 to each coordinates position $(r_1, \theta_1) \dots (r_i, \theta_i) \dots (r_h, \theta_h)$ of the outer periphery 5, shifting center point $(0, 0)$ already set in coordinates position (r, θ) to the position of said (r_0, θ_0) , and each distance $r_1' \dots r_i' \dots r_h'$ of distance from new center position $(0, 0)$ grounding on the shift to each coordinates position of the outer periphery 6 are calculated, and the maximum distance is selected from calculated distance and,

for each of the equal-width divided regions 2, the absolute value d of a difference between the maximum distance of the respective cross sections 3 in the boundary on the upper side and the maximum distance of the respective cross sections 3 in the boundary on the lower side is calculated.

[0021]

Although the calculations of the parameters in the respective cross section 3 are realized with a CAM or a computer controller, when as in the basic configuration (1), the average distance from the center position 5 is selected as the parameter, the parameter can reflect the shape of the cross section 3 extremely accurately, whereas when as in the basic configuration (2), the maximum width in the lateral direction and the maximum width in the vertical direction are selected as the parameters and when as in the basic configuration (3), the maximum distance from the center position 5 is selected

as the parameter, it is impossible to deny the fact that the basic configurations (2) and (3) are inferior to the basic configuration (1) in the accurate reflection of the shape of the cross section 3.

[0022]

However, in order to calculate the average distance from the center position 5, it is necessary to calculate the center position 5 on all the point coordinates formed on the outer periphery 6 based on a digital design in the respective cross sections 3 and then to further calculate the distance from the center position 5, whereas since in a normal three-dimensional shaping method, the Cartesian coordinates, that is, the (x, y) coordinates are adopted, it is inevitably necessary to calculate the average distance based on the Pythagorean theorem.

[0023]

Even if the rotational coordinates, that is, the (r, θ) coordinates are adopted, and thus it is not necessary to perform the above calculation using the Pythagorean theorem, it is very complicated to calculate the average distance.

[0024]

Hence, as compared with a case where the actual shaping is immediately realized, the process 1 in the basic configuration (1) is suitable for a case where the shaping is previously realized according to the model of each shaped object 1.

[0025]

By contrast, since it does not take much time to calculate the sum in the basic configuration (2) and to calculate the maximum distance in the basic configuration (3), in the actual shaping, the calculation of d can be immediately realized according to each shaped object.

[0026]

The calculations of the process 1 of the basic configurations (1), (2) and (3) are as shown in the flow charts of Figs. 1, 2 and 3, respectively.

In the flow chart of Fig. 3(b), a size relationship between

r_i

and r_m is based on a criterion in which the cross section in the boundary on the upper side is common to the cross section in the boundary on the lower side, and this is because it is naturally assumed that the number h of coordinates in the cross section in the boundary on the upper side and the cross section in the boundary on the lower side in each of the equal-width divided regions is set such that the division which is so fine as not to reverse the size relationship between

r_i

and r_m in the cross section in the boundary on the upper side and the cross section in the boundary on the lower side can be performed.

[0027]

After each process 1 is performed, the processes 2, 3

and 4 of each of the basic configurations (1), (2) and (3) are identical one another.

[0028]

Specifically, in the process 2, the minimum number of multilayers N_1 with the assumption that d is 0 is set, the maximum number D of d is detected in the flow chart shown in Fig. 5 and the maximum number of multilayers N_2 in the equal-width divided region 2 where the maximum value D is formed is set;

in the process 3, as d increases between the minimum value N_1 and the maximum value N_2 , an increasing number n is set, and then the number of multilayers N is selected by a general formula of $N = [n]$; and

in the process 4, in the actual shaping, the formation and sintering of the powder layer based on the number of multilayers N selected in the process 3 are performed in the each of the equal-width divided regions 2.

[0029]

Although in the process 2, with the assumption that d is 0, the minimum number of multilayers N_1 is set, this is because in some shaped objects 1, a region is present in which at a predetermined height and a predetermined width, the shape of the cross section 3 is not varied according to the height direction.

[0030]

By contrast, in d of each of the equal-width divided regions 2, the maximum value D is always present, and in this

case, since the largest variation in the shape of the cross section 3 within the equal-width divided region 2 is produced, the maximum number of multilayers N_2 is set.

[0031]

Although in the process 3, the number of multilayers N reflecting the size relationship between the minimum value N_1 and the maximum value N_2 is selected, this selection is not particularly limited, and the order of the variations of the shape of the cross section 3 needs to reflect the order of the number of multilayers.

[0032]

After the selection of the number of multilayers N which is a positive integer as described above, in the basic configurations (1), (2) and (3), as in the process 4, each of the equal-width divided regions 2 according to the process 1 is further equally divided along the up/down direction into N regions, and then in the process 1 of the equally divided N cross sections 3, the coordinates of the outer periphery 6 corresponding to a model which is to be shaped are set.

[0033]

The setting of the coordinates of the outer periphery 6 can be realized by recording the shape of the model described above in the memory of the CAM and then the respective coordinates of the outer periphery regions 6 corresponding to the model described above in the cross section 3 by the further equal-width division of each of the equal-width divided regions 2 into the N regions can be calculated with the CAM.

[0034]

As a result of the process 4 described above, as in the process 5, it is possible to control the performance of the forming and sintering of the powder layer based on the number of multilayers N, and the movement of the cutting tool such that the coordinates position of the outer periphery 6 set in the process 4 is the final cutting position.

[0035]

It is also possible either to previously prepare the processes 1, 2 and 3 and thereafter perform the actual shaping or to perform the actual shaping from the stage of the process 1, and in particular, the basic configurations (2) and (3) can be extremely suitable for such a method as described above.

[0036]

The conditions of the processes 2, 3, 4 and 5 are individually as shown in the flow chart of Fig. 6.

[0037]

As the selection of the positive integer N in the process 3, the most typical method is to adopt, as the number of multilayers N, the arithmetic mean between the minimum value N_1 and the maximum value N_2 indicated below.

[Formula 1]

$$N = \left[\left(1 - \frac{d}{D} \right) N_1 + \left(\frac{d}{D} \right) N_2 \right]$$

[0038]

As the selection of the number of multilayers N described above, in addition to the arithmetic mean, the geometric mean between the minimum value N_1 and the maximum value N_2 indicated below can also be adopted.

[Formula 2]

$$N = \left[N_1 \left(1 + \frac{d}{D} \right) \cdot N_2 \left(\frac{d}{D} \right) \right]$$

[0039]

Even in the case of the geometric mean described above, as in the case of the arithmetic mean, the variation in the shape of the cross section 3 in each of the equal-width divided regions 2 can be accurately reflected.

[0040]

As the selection of the number of multilayers N, a medium value of the arithmetic mean and the geometric mean can also be adopted.

[0041]

Specifically, preferably, a and b are positive numbers, and moreover $a + b = 1$ is selected, and then the calculation of $N = a \cdot (N \text{ produced by arithmetic mean}) + b \cdot (N \text{ produced by geometric mean})$ or the calculation of $N = (N \text{ produced by arithmetic mean})^a \cdot (N \text{ produced by geometric mean})^b$ may be performed.

[0042]

Besides the arithmetic mean or the geometric mean described above and a combination thereof, for d in each of the K pieces of equal-width divided regions 2, the order of $d_1 \leq d_2 \leq \dots \leq d_i \leq \dots \leq d_K$ is detected in the flow chart of Fig. 7, and then, a state reflecting the order of size of d indicated below can also be adopted.

[Formula 3]

$$N_i = \left[N_1 + \frac{l}{K} (N_2 - N_1) \right]$$

[0043]

A description will be given below according to Examples.

[Example 1]

[0044]

Example 1 is characterized in that the amount of laser beam or electron beam applied per unit area is adjusted according to the thickness of each of the multilayers.

[0045]

In the shaped object 1, the degree of sintering is adjusted according to the function of each region as a matter of course.

[0046]

Hence, when the number of multilayers N in each of the equal-width divided regions 2 is varied, and consequently, the thickness of each multilayer unit is varied, in the case where the degree of the application of each beam is the same, as the thickness of the multilayer unit in the multilayer unit is decreased, the degree of sintering is increased, with the result that disadvantageously, the requirement for the function described above is inevitably not satisfied.

[0047]

In Example 1, in order to avoid such a disadvantage, the degree of sintering is adjusted according to the variation in the thickness, it is made possible to satisfy the requirement for the function in each region.

[Example 2]

[0048]

Example 2 is characterized in that when the cross sections 3 of the respective multilayer units are located in the same position in a direction perpendicular to the height direction, as the thickness of each multilayer unit is increased, the amount of radiation applied per unit area is set larger.

[0049]

In the case of the actual three-dimensional shaped object 1, some regions where the degree of sintering is the same are present.

[0050]

In such a case, when in the basic configurations (1), (2) and (3), the number of multilayers N in each of the equal-width divided regions 2 and furthermore the thickness of each multilayer unit are varied, the same degree of sintering is adopted, with the result that on the contrary, it is inevitably impossible to obtain a uniform degree of sintering.

[0051]

In Example 2, consideration is given to such a condition, and as the thickness of each multilayer unit is increased, the amount of radiation applied per unit area is increased, with the result that it is made possible to realize a uniform degree of sintering.

[Industrial Applicability]

[0052]

As is clear from the above description, in the present invention, it is made possible to set the appropriate thickness of each multilayer unit according to the variation in the

cross-sectional shape of the shaped object in the up/down direction, and the present invention can be utilized for all three-dimensional shaping.

[Reference Signs List]

[0053]

- 1: Object which is to be shaped
- 2: Equal-width divided region
- 3: Cross section in boundary of equal-width divided regions
- 4: Each multilayer region
- 5: Center position
- 6: Outer periphery

CLAIMS

[Claim 1]

A three-dimensional shaping method in which a step of forming a powder layer and a step of sintering the powder layer by application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container,

wherein a plurality of equal-width divided regions are set in a multilayer region along a height direction, and then according to following processes, a number of multilayers N in each of the equal-width divided regions is selected, for selecting a thickness of each multilayer unit in each of the equal-width divided regions:

1. a process with adopting Cartesian coordinates, that is, (x, y) coordinates and calculating as follows:

in respective cross sections forming boundaries of both upper and lower sides in the equal-width divided regions of a model which is to be shaped, from each coordinates position (x₁, y₁) ... (x_i, y_i) ... (x_h, y_h) forming an outer periphery of each cross section and recorded in a CAM or a computer controller, a center position (x₀, y₀) of each of the cross sections is calculated according to

[Formula 1]

$$x_0 = (x_1 + \dots + x_i + \dots + x_h) / h$$

[Formula 2]

$$y_0 = (y_1 + \dots + y_i + \dots + y_h) / h$$

and regarding an average distance r from the center position (x₀, y₀) to each coordinates position (x₁, y₁) ... (x_i, y_i) ... (x_h, y_h) in the outer periphery, calculating and recording with the CAM or the computer controller

[Formula 3]

$$r_i = \sqrt{(x_i - x_0)^2 + (y_i - y_0)^2}$$

, and then calculating

[Formula 4]

$$r = (r_1 + \dots + r_i + \dots + r_h) / h$$

and

calculating, for each of the equal-width divided regions, an absolute value d of a difference between an average distance of the respective cross sections in the boundary on the upper side and an average distance of the respective cross sections in the boundary on the lower side;

2. a process for, when it is assumed that d is 0, setting a minimum number of multilayers N_1 , detecting a maximum value D of d and setting a maximum number of multilayers N_2 in the equal-width divided region where the maximum value D is formed;

3. a process for setting an increasing number n as d increases between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 , and selecting a number of multilayers N when $N = [n]$,

Gauss symbol indicating that N is an integer with a relation of $N-1 < n \leq N$;

4. a process for setting, when in each of the equal-width divided regions in the above 1, equal-width division is further performed with the number of multilayers N in the above 3 along an up/down direction, coordinates of the outer periphery corresponding to the model in the above 1 in each of cross sections of the number N; and

5. a process for controlling, in actual shaping, forming and sintering of the powder layer based on the number of multilayers N selected in the above 3 in each of the equal-width divided regions and movement of a cutting tool in which a position of the coordinates of the outer periphery set in the above 4

is a final cutting position.

[Claim 2]

The three-dimensional shaping method according to Claim 1, wherein as the number of multilayers is N, an arithmetic mean between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 indicated below is adopted:

[Formula 5]

$$N = \left[\left(1 - \frac{d}{D} \right) N_1 + \left(\frac{d}{D} \right) N_2 \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[\left(1 - \frac{d}{D} \right) N_1 + \left(\frac{d}{D} \right) N_2 \right] \leq N$$

[Claim 3]

The three-dimensional shaping method according to Claim 1, wherein as the number of multilayers is N, a geometric mean between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 indicated below is adopted:

[Formula 6]

$$N = \left[N_1^{\left(1 - \frac{d}{D} \right)} \cdot N_2^{\left(\frac{d}{D} \right)} \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[N_1^{\left(1 - \frac{d}{D} \right)} \cdot N_2^{\left(\frac{d}{D} \right)} \right] \leq N$$

[Claim 4]

The three-dimensional shaping method according to Claim 1, wherein as the number of multilayers is N, a medium value of the arithmetic mean of Claim 2 and the geometric mean of Claim 3 is adopted.

[Claim 5]

The three-dimensional shaping method according to Claim 1, wherein for d in each of K pieces of equal-width divided regions, an order of $d_1 \leq d_2 \leq \dots \leq d_i \leq \dots \leq d_K$ is detected, and then, a state reflecting an order of size of d indicated below is adopted:

[Formula 7]

$$N_i = \left[N_1 + \frac{i}{K} (N_2 - N_1) \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[N_1 + \frac{i}{K} (N_1 - N_2) \right] \leq N$$

[Claim 6]

A three-dimensional shaping method in which a step of forming a powder layer and a step of sintering the powder layer by application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container,

wherein a plurality of equal-width divided regions are set in a multilayer region along a height direction, and then according to following processes, a number of multilayers N in each of the equal-width divided regions is selected, for selecting a thickness of each multilayer unit in each of the equal-width divided regions:

1. a process with adopting Cartesian coordinates, that is, (x, y) coordinates and then calculating, in respective cross sections forming boundaries of both upper and lower sides in the equal-width divided regions of a model which is to be shaped, a sum of maximum widths of the respective cross sections in a lateral direction and maximum widths thereof in a vertical direction with a CAM or a computer controller and

calculating, for each of the equal-width divided regions,

an absolute value d of a difference between a sum of the respective cross sections in the boundary on the upper side and a sum of the respective cross sections in the boundary on the lower side;

2. a process for, when it is assumed that d is 0, setting a minimum number of multilayers N_1 , detecting a maximum value D of d and setting a maximum number of multilayers N_2 in the equal-width divided region where the maximum value D is formed;

3. a process for setting an increasing number n as d increases between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 , and selecting a number of multilayers N when $N = [n]$,

Gauss symbol indicating that N is an integer with a relation of $N-1 < n \leq N$;

4. a process for setting, when in each of the equal-width divided regions in the above 1, equal-width division is further performed with the number of multilayers N in the above 3 along an up/down direction, coordinates of the outer periphery corresponding to the model in the above 1 in each of cross sections of the number N ; and

5. a process for controlling, in actual shaping, forming and sintering of the powder layer based on the number of multilayers N selected in the above 3 in each of the equal-width divided regions and movement of a cutting tool in which a position of the coordinates of the outer periphery set in the above 4 is a final cutting position.

[Claim 7]

The three-dimensional shaping method according to Claim 6, wherein as the number of multilayers is N , an arithmetic mean between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 indicated below is adopted:

[Formula 8]

$$N = \left[\left(1 - \frac{d}{D} \right) N_1 + \left(\frac{d}{D} \right) N_2 \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[\left(1 - \frac{d}{D} \right) N_1 + \left(\frac{d}{D} \right) N_2 \right] \leq N$$

[Claim 8]

The three-dimensional shaping method according to Claim 6, wherein as the number of multilayers is N, a geometric mean between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 indicated below is adopted:

[Formula 9]

$$N = \left[N_1^{\left(1 - \frac{d}{D} \right)} \cdot N_2^{\left(\frac{d}{D} \right)} \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[N_1^{\left(1 - \frac{d}{D} \right)} \cdot N_2^{\left(\frac{d}{D} \right)} \right] \leq N$$

[Claim 9]

The three-dimensional shaping method according to Claim 6, wherein as the number of multilayers is N, a medium value of the arithmetic mean of Claim 7 and the geometric mean of Claim 8 is adopted.

[Claim 10]

The three-dimensional shaping method according to Claim 6, wherein for d in each of K pieces of equal-width divided regions, an order of $d_1 \leq d_2 \leq \dots \leq d_1 \leq \dots \leq d_K$ is detected, and

then, a state reflecting an order of size of d indicated below is adopted:

[Formula 10]

$$N_i = \left[N_1 + \frac{i}{K} (N_2 - N_1) \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[N_1 + \frac{i}{K} (N_1 - N_2) \right] \leq N$$

[Claim 11]

A three-dimensional shaping method in which a step of forming a powder layer and a step of sintering the powder layer by application of a moving laser beam or a moving electron beam are alternately repeated to perform a multilayer operation within a container,

wherein a plurality of equal-width divided regions are set in a multilayer region along a height direction, and then according to following processes, a number of multilayers N in each of the equal-width divided regions is selected, for selecting a thickness of each multilayer unit in each of the equal-width divided regions:

1. a process with adopting rotational coordinates, that is, (r, θ) coordinates and then calculating as follows:

in respective cross sections forming boundaries of both upper and lower sides in the equal-width divided regions of a model which is to be shaped from coordinates position (r₁, θ_1) ... (r_i, θ_i) ... (r_h, θ_h) forming an outer periphery, and recorded in a CAM or a computer controller, a center position (r₀, θ_0) of each of the cross sections is calculated by

[Formula 11]

$$r_0 = (r_1 + \dots + r_i + \dots + r_h) / h$$

[Formula 12]

$$\theta_0 = (\theta_1 + \dots + \theta_i + \dots + \theta_h) / h$$

and regarding each distance from the center position (r₀,

θ_0) to each coordinates position $(r_1, \theta_1) \dots (r_i, \theta_i) \dots (r_h, \theta_h)$ forming the outer periphery, shifting already set center point $(0, 0)$ in (r, θ) coordinates to said position (r_0, θ_0) , and calculating $r_1' \dots r_i' \dots r_h'$ from new center position $(0, 0)$ grounding on the shift to each coordinates position of the outer periphery, and selecting a maximum distance from calculated each distance and

calculating, for each of the equal-width divided regions, an absolute value d of a difference between a maximum distance of the respective cross sections in the boundary on the upper side and a maximum distance of the respective cross sections in the boundary on the lower side;

2. a process for, when it is assumed that d is 0, setting a minimum number of multilayers N_1 , detecting a maximum value D of d and setting a maximum number of multilayers N_2 in the equal-width divided region where the maximum value D is formed;

3. a process for setting an increasing number n as d increases between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 , and selecting a number of multilayers N when $N = [n]$,

Gauss symbol indicating that N is an integer with a relation of $N-1 < n \leq N$;

4. a process for setting, when in each of the equal-width divided regions in the above 1, equal-width division is further performed with the number of multilayers N in the above 3 along an up/down direction, coordinates of the outer periphery corresponding to the model in the above 1 in each of cross sections of the number N ; and

5. a process for controlling, in actual shaping, forming and sintering of the powder layer based on the number of multilayers N selected in the above 3 in each of the equal-width divided regions and movement of a cutting tool in which a position of the coordinates of the outer periphery set in the above 4

is a final cutting position.

[Claim 12]

The three-dimensional shaping method according to Claim 11, wherein as the number of multilayers is N, an arithmetic mean between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 indicated below is adopted:

[Formula 13]

$$N = \left[\left(1 - \frac{d}{D} \right) N_1 + \left(\frac{d}{D} \right) N_2 \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[\left(1 - \frac{d}{D} \right) N_1 + \left(\frac{d}{D} \right) N_2 \right] \leq N$$

[Claim 13]

The three-dimensional shaping method according to Claim 11, wherein as the number of multilayers is N, a geometric mean between the minimum number of multilayers N_1 and the maximum number of multilayers N_2 indicated below is adopted:

[Formula 14]

$$N = \left[N_1^{\left(1 - \frac{d}{D} \right)} \cdot N_2^{\left(\frac{d}{D} \right)} \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[N_1^{\left(1 - \frac{d}{D} \right)} \cdot N_2^{\left(\frac{d}{D} \right)} \right] \leq N$$

[Claim 14]

The three-dimensional shaping method according to Claim 11, wherein as the number of multilayers is N, a medium value of the arithmetic mean of Claim 12 and the geometric mean of Claim 13 is adopted.

[Claim 15]

The three-dimensional shaping method according to Claim 11,
wherein for d in each of K pieces of equal-width divided
regions, an order of $d_1 \leq d_2 \leq \dots \leq d_i \leq \dots \leq d_K$ is detected, and
then, a state reflecting an order of size of d indicated below
is adopted:

[Formula 15]

$$N_i = \left[N_1 + \frac{i}{K} (N_2 - N_1) \right]$$

wherein N indicates the integer with the relation of

$$N - 1 < \left[N_1 + \frac{i}{K} (N_1 - N_2) \right] \leq N$$

[Claim 16]

The three-dimensional shaping method according to any one of
Claims 1, 6 and 11,


wherein an amount of the laser beam or the electron beam
applied per unit area is adjusted according to the thickness
of each of the multilayers.

[Claim 17]


The three-dimensional shaping method according to Claim 16,
wherein when the cross sections of the respective multilayer
units are located in a same position in a direction perpendicular
to the height direction, as the thickness of each of the
multilayer units is increased, the amount of radiation applied
per unit area is set larger.

【Document】
【Fig.1(a)】


Fig

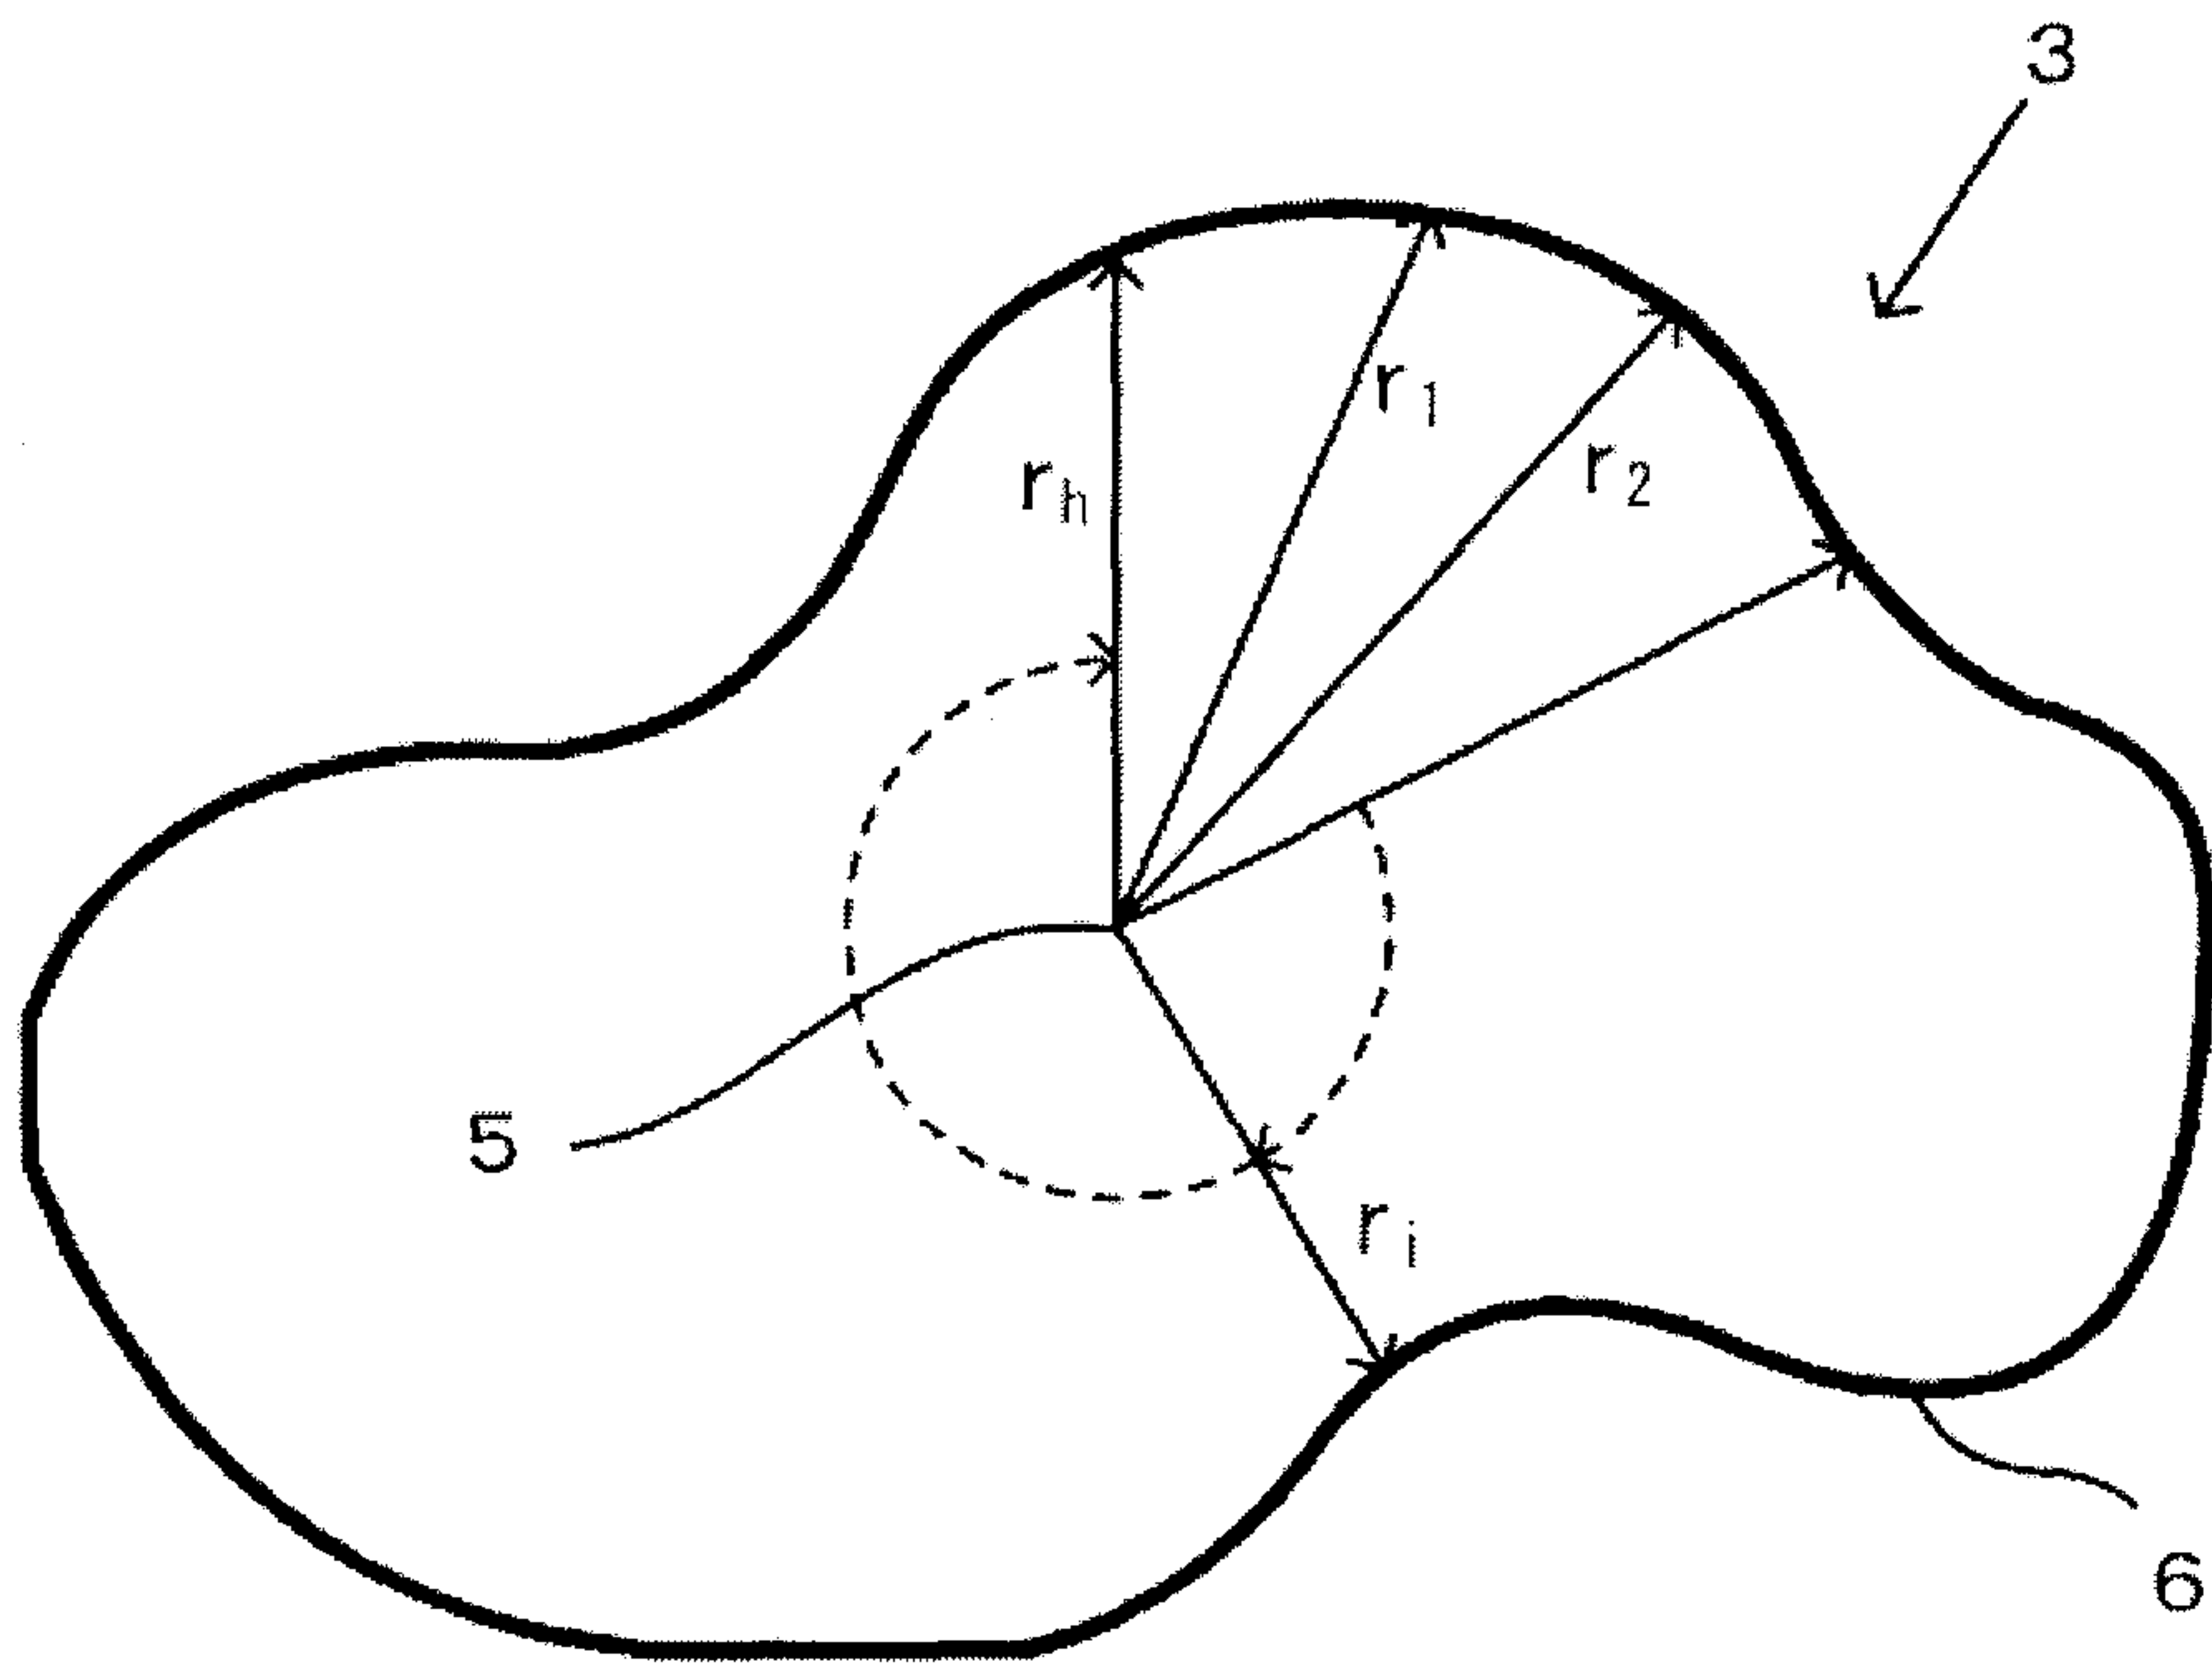


【Fig.1(b)】

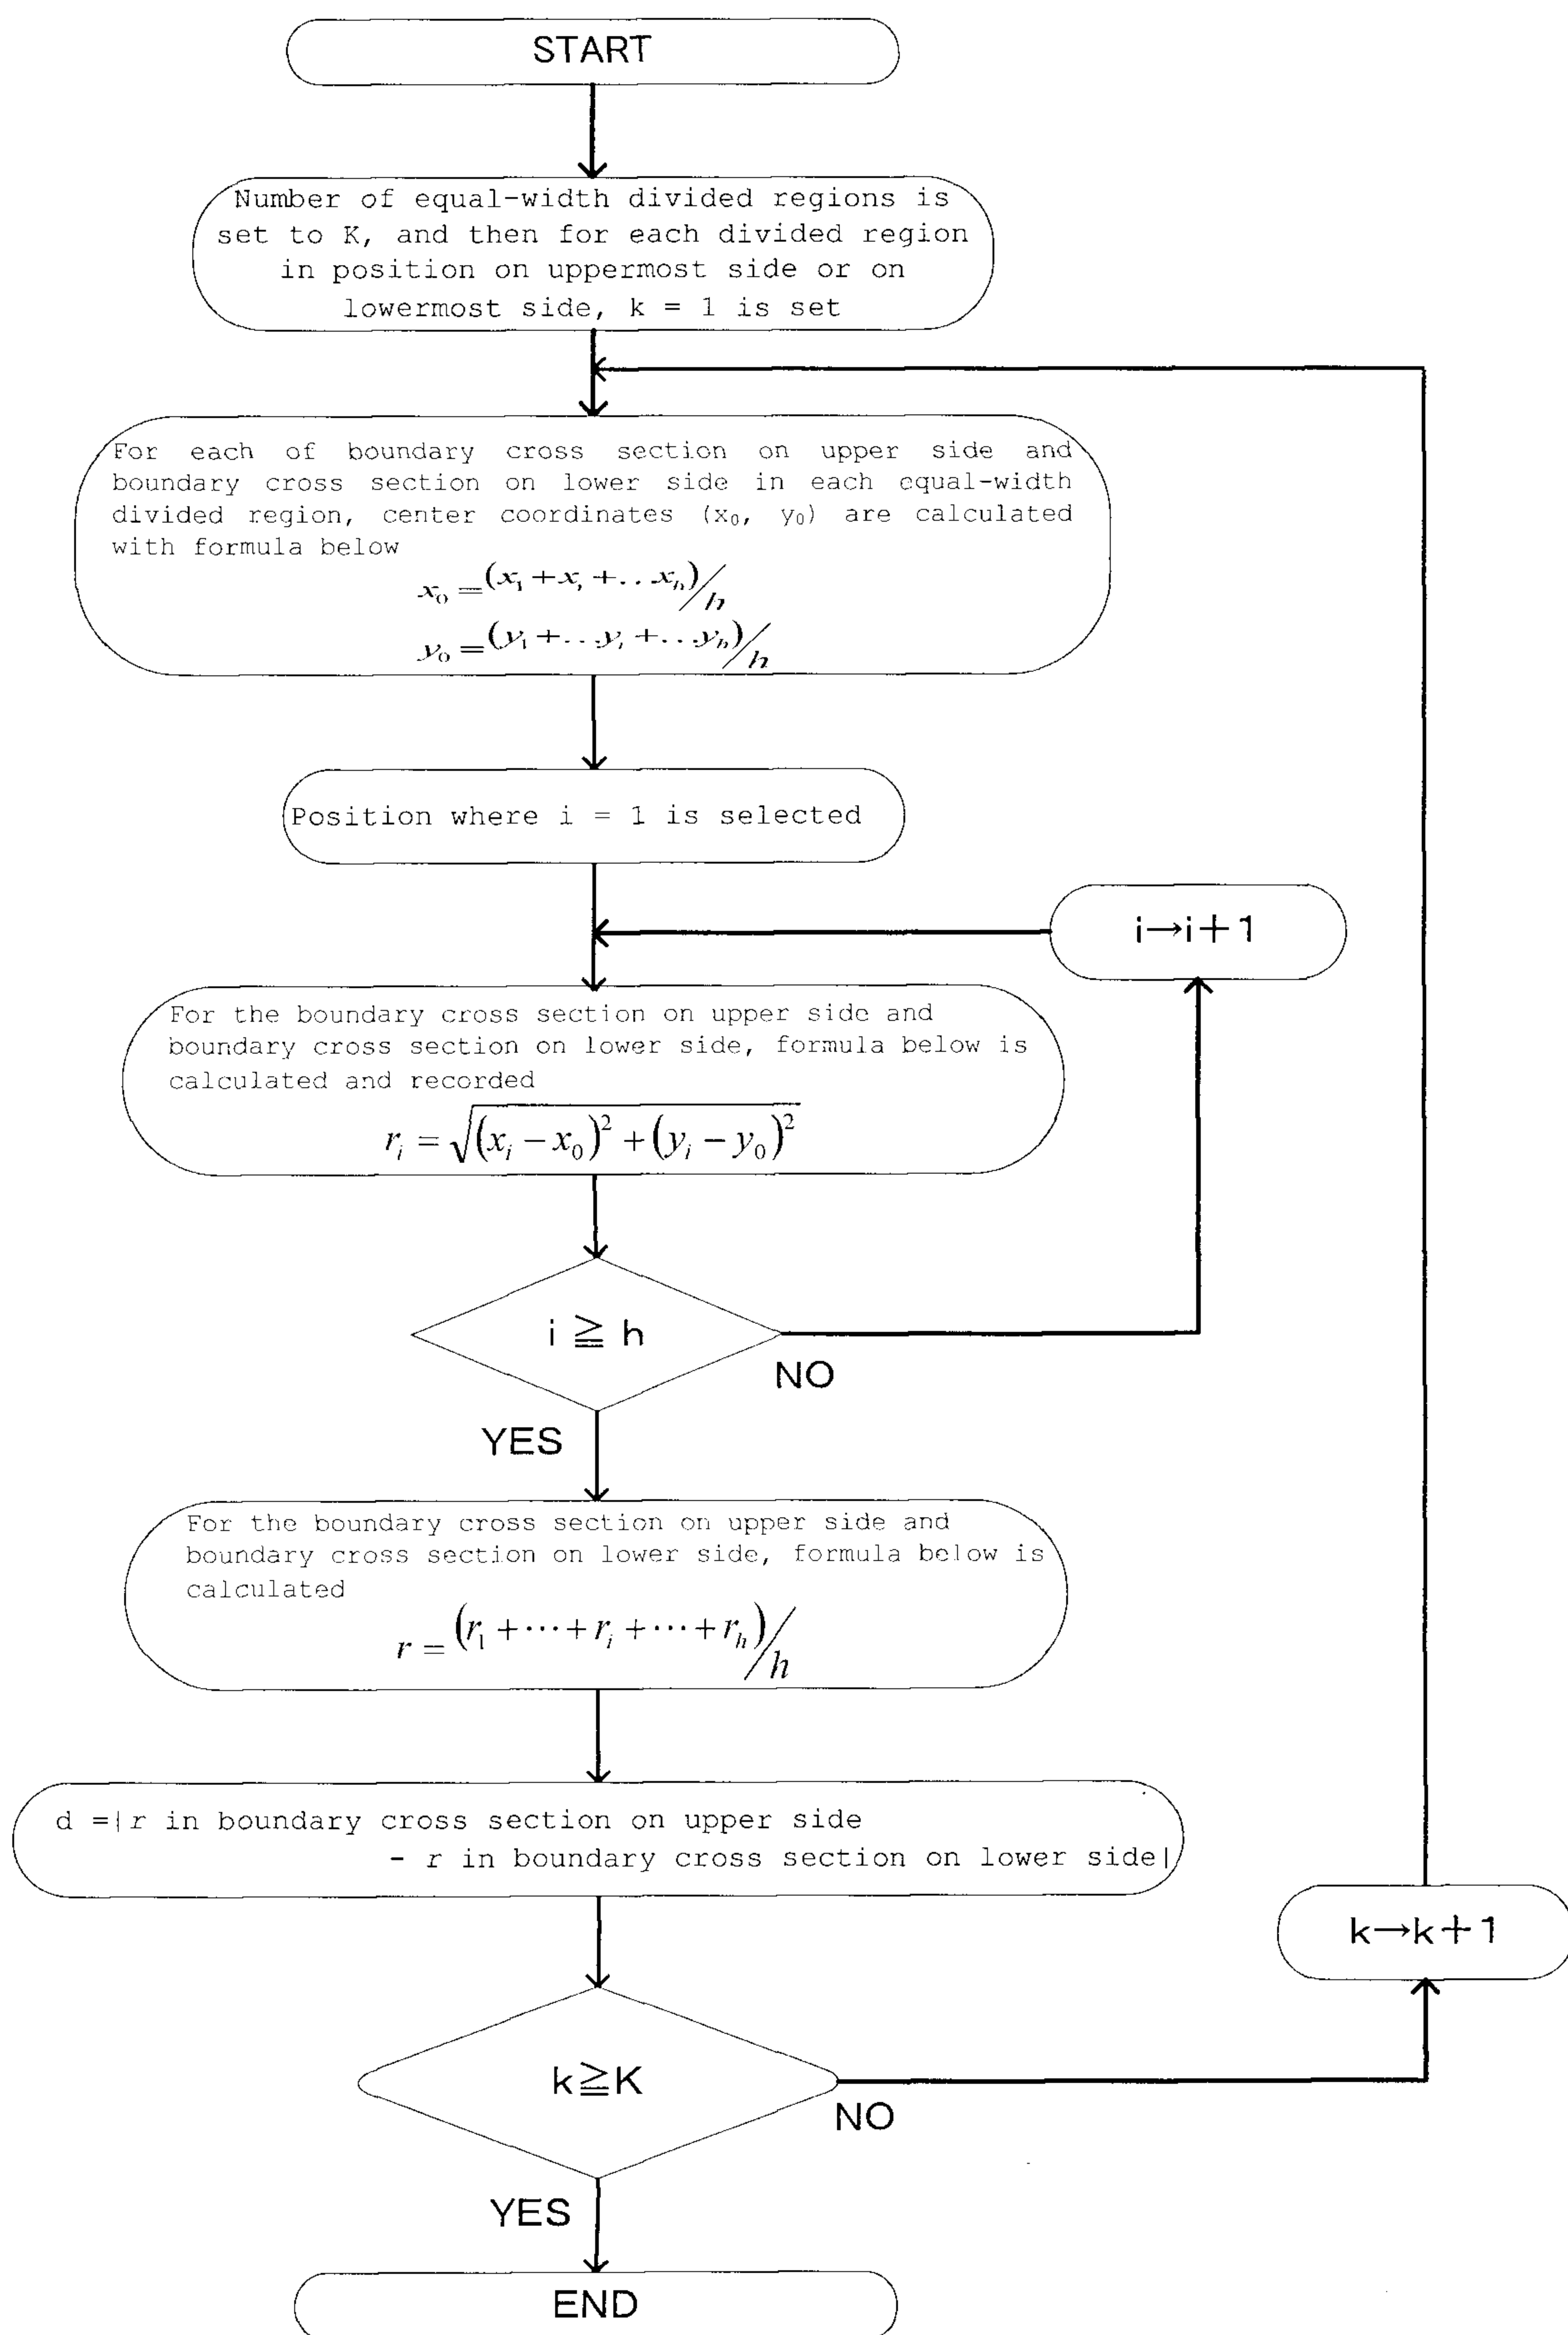


【Fig.2(a)】

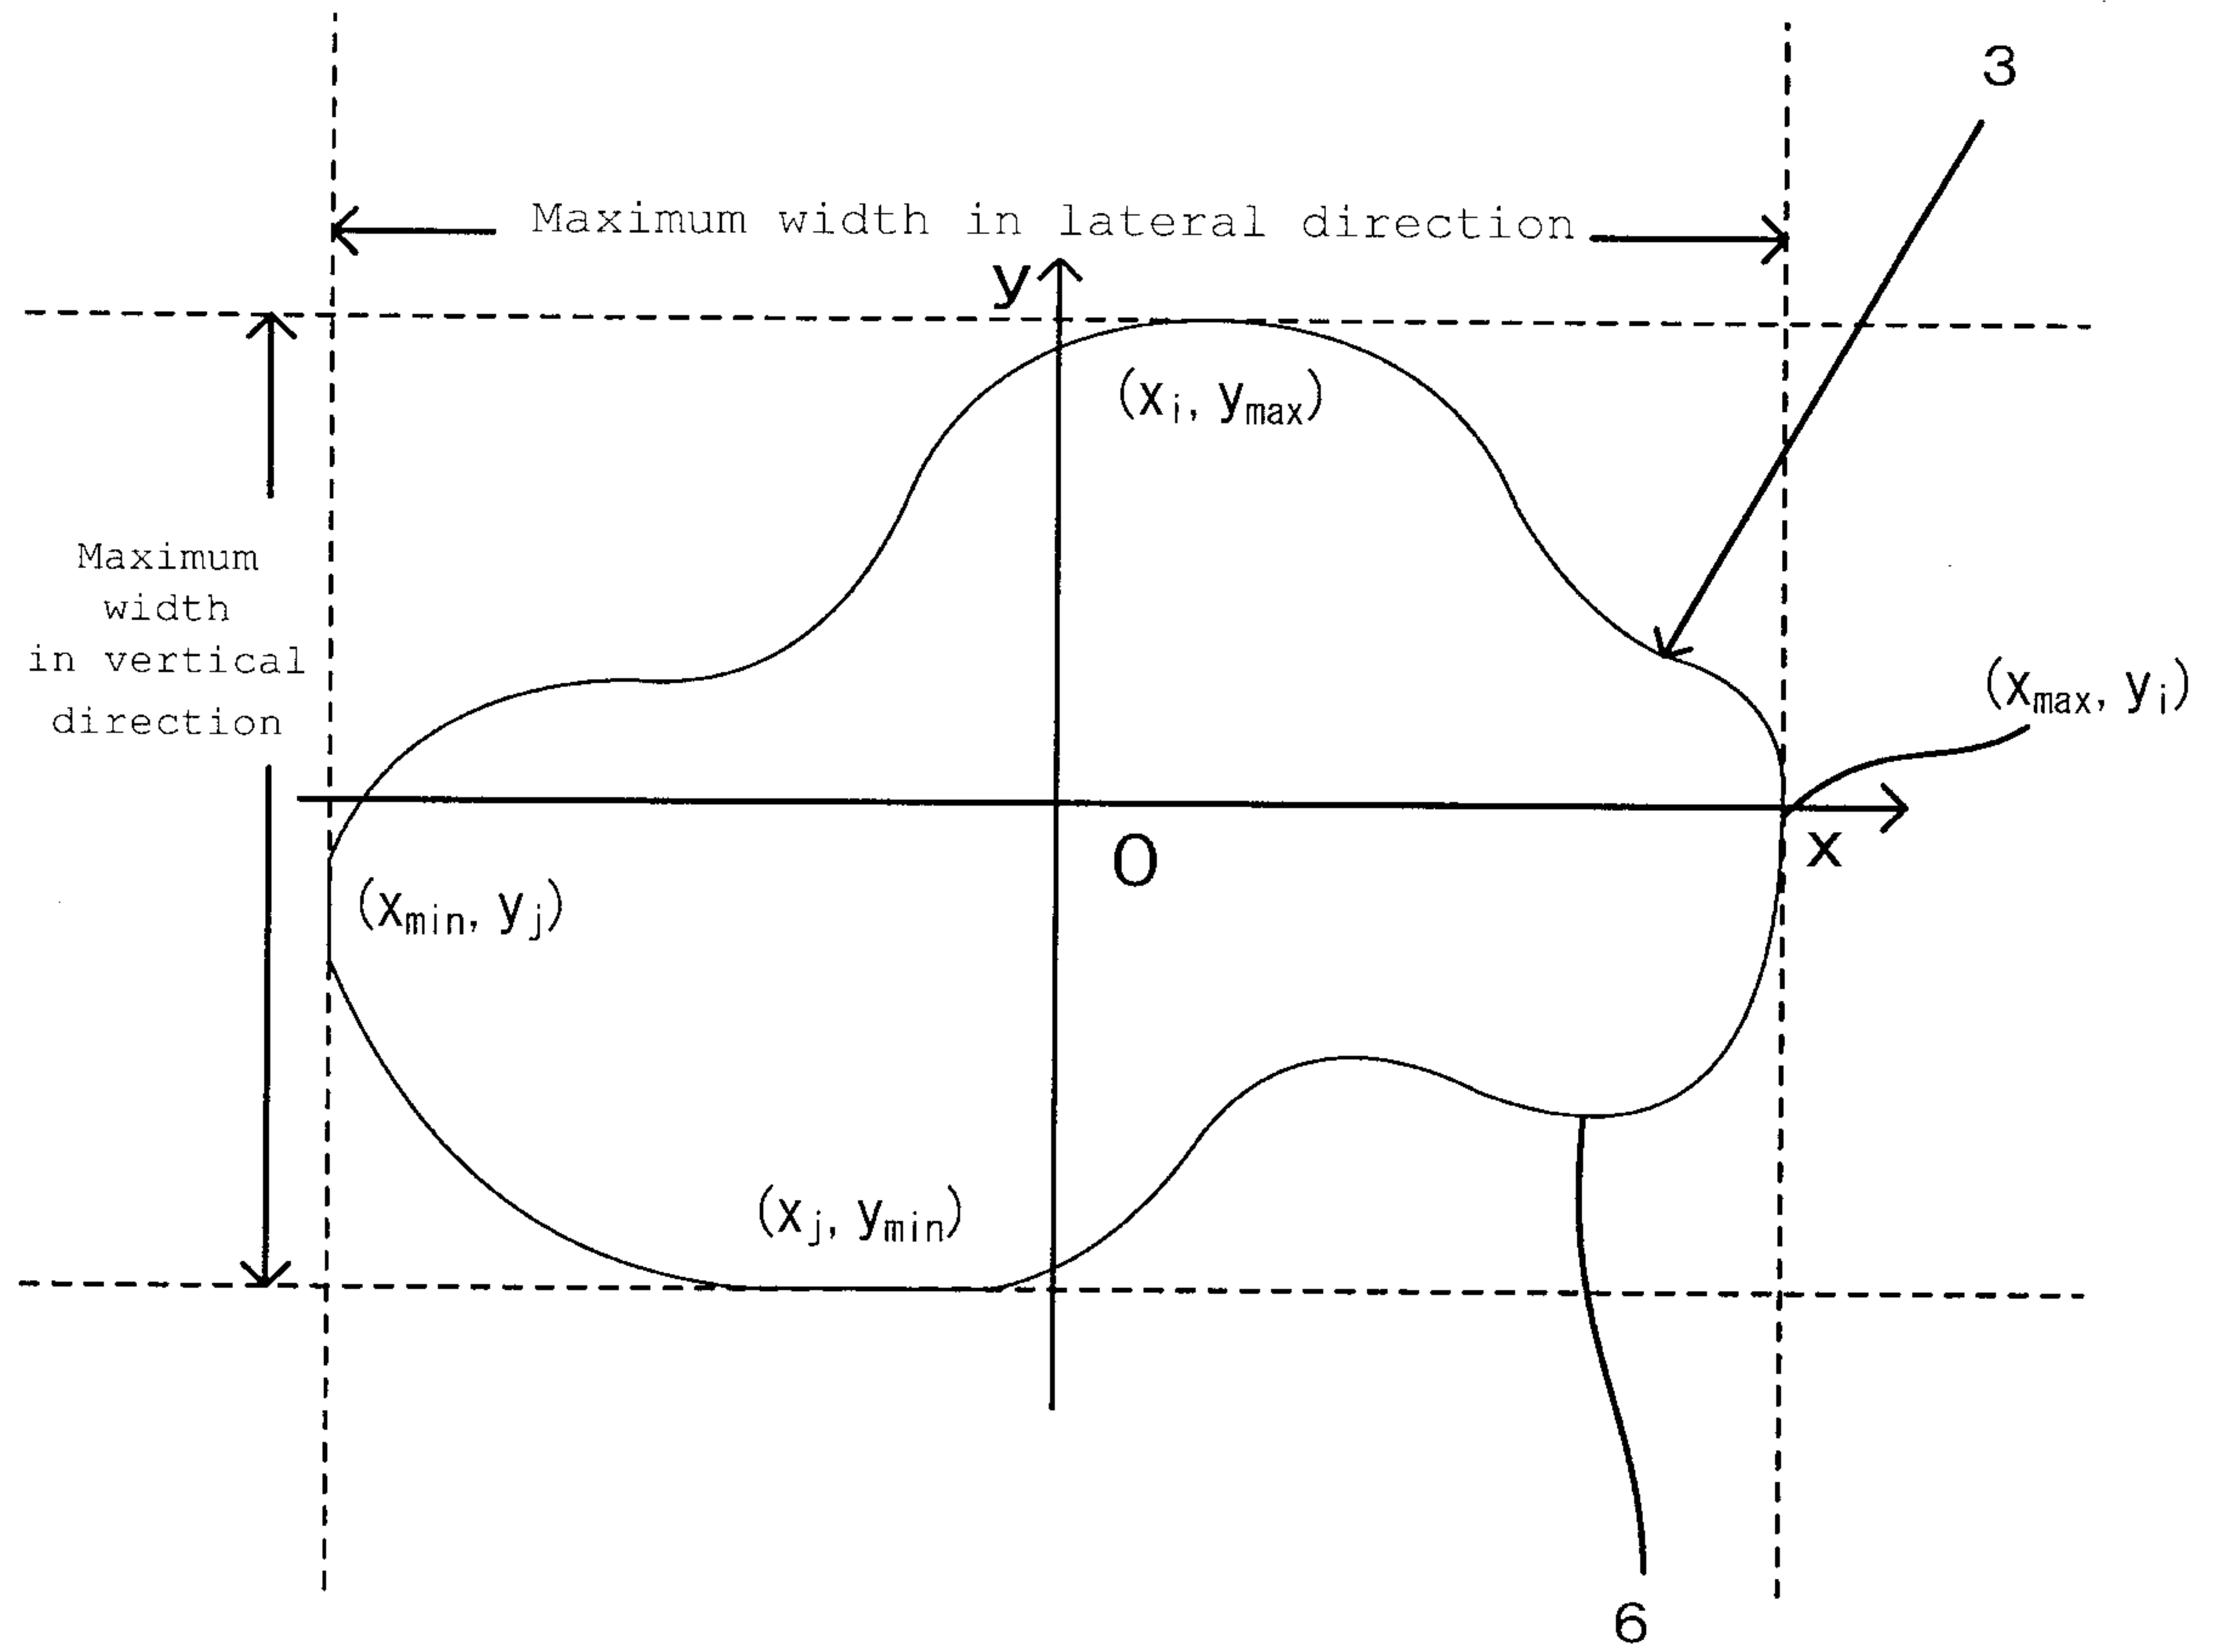


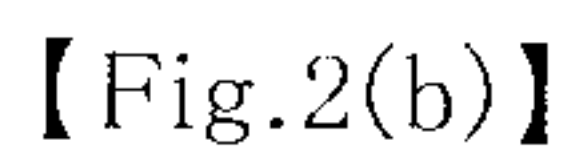


【Fig.3(a)】

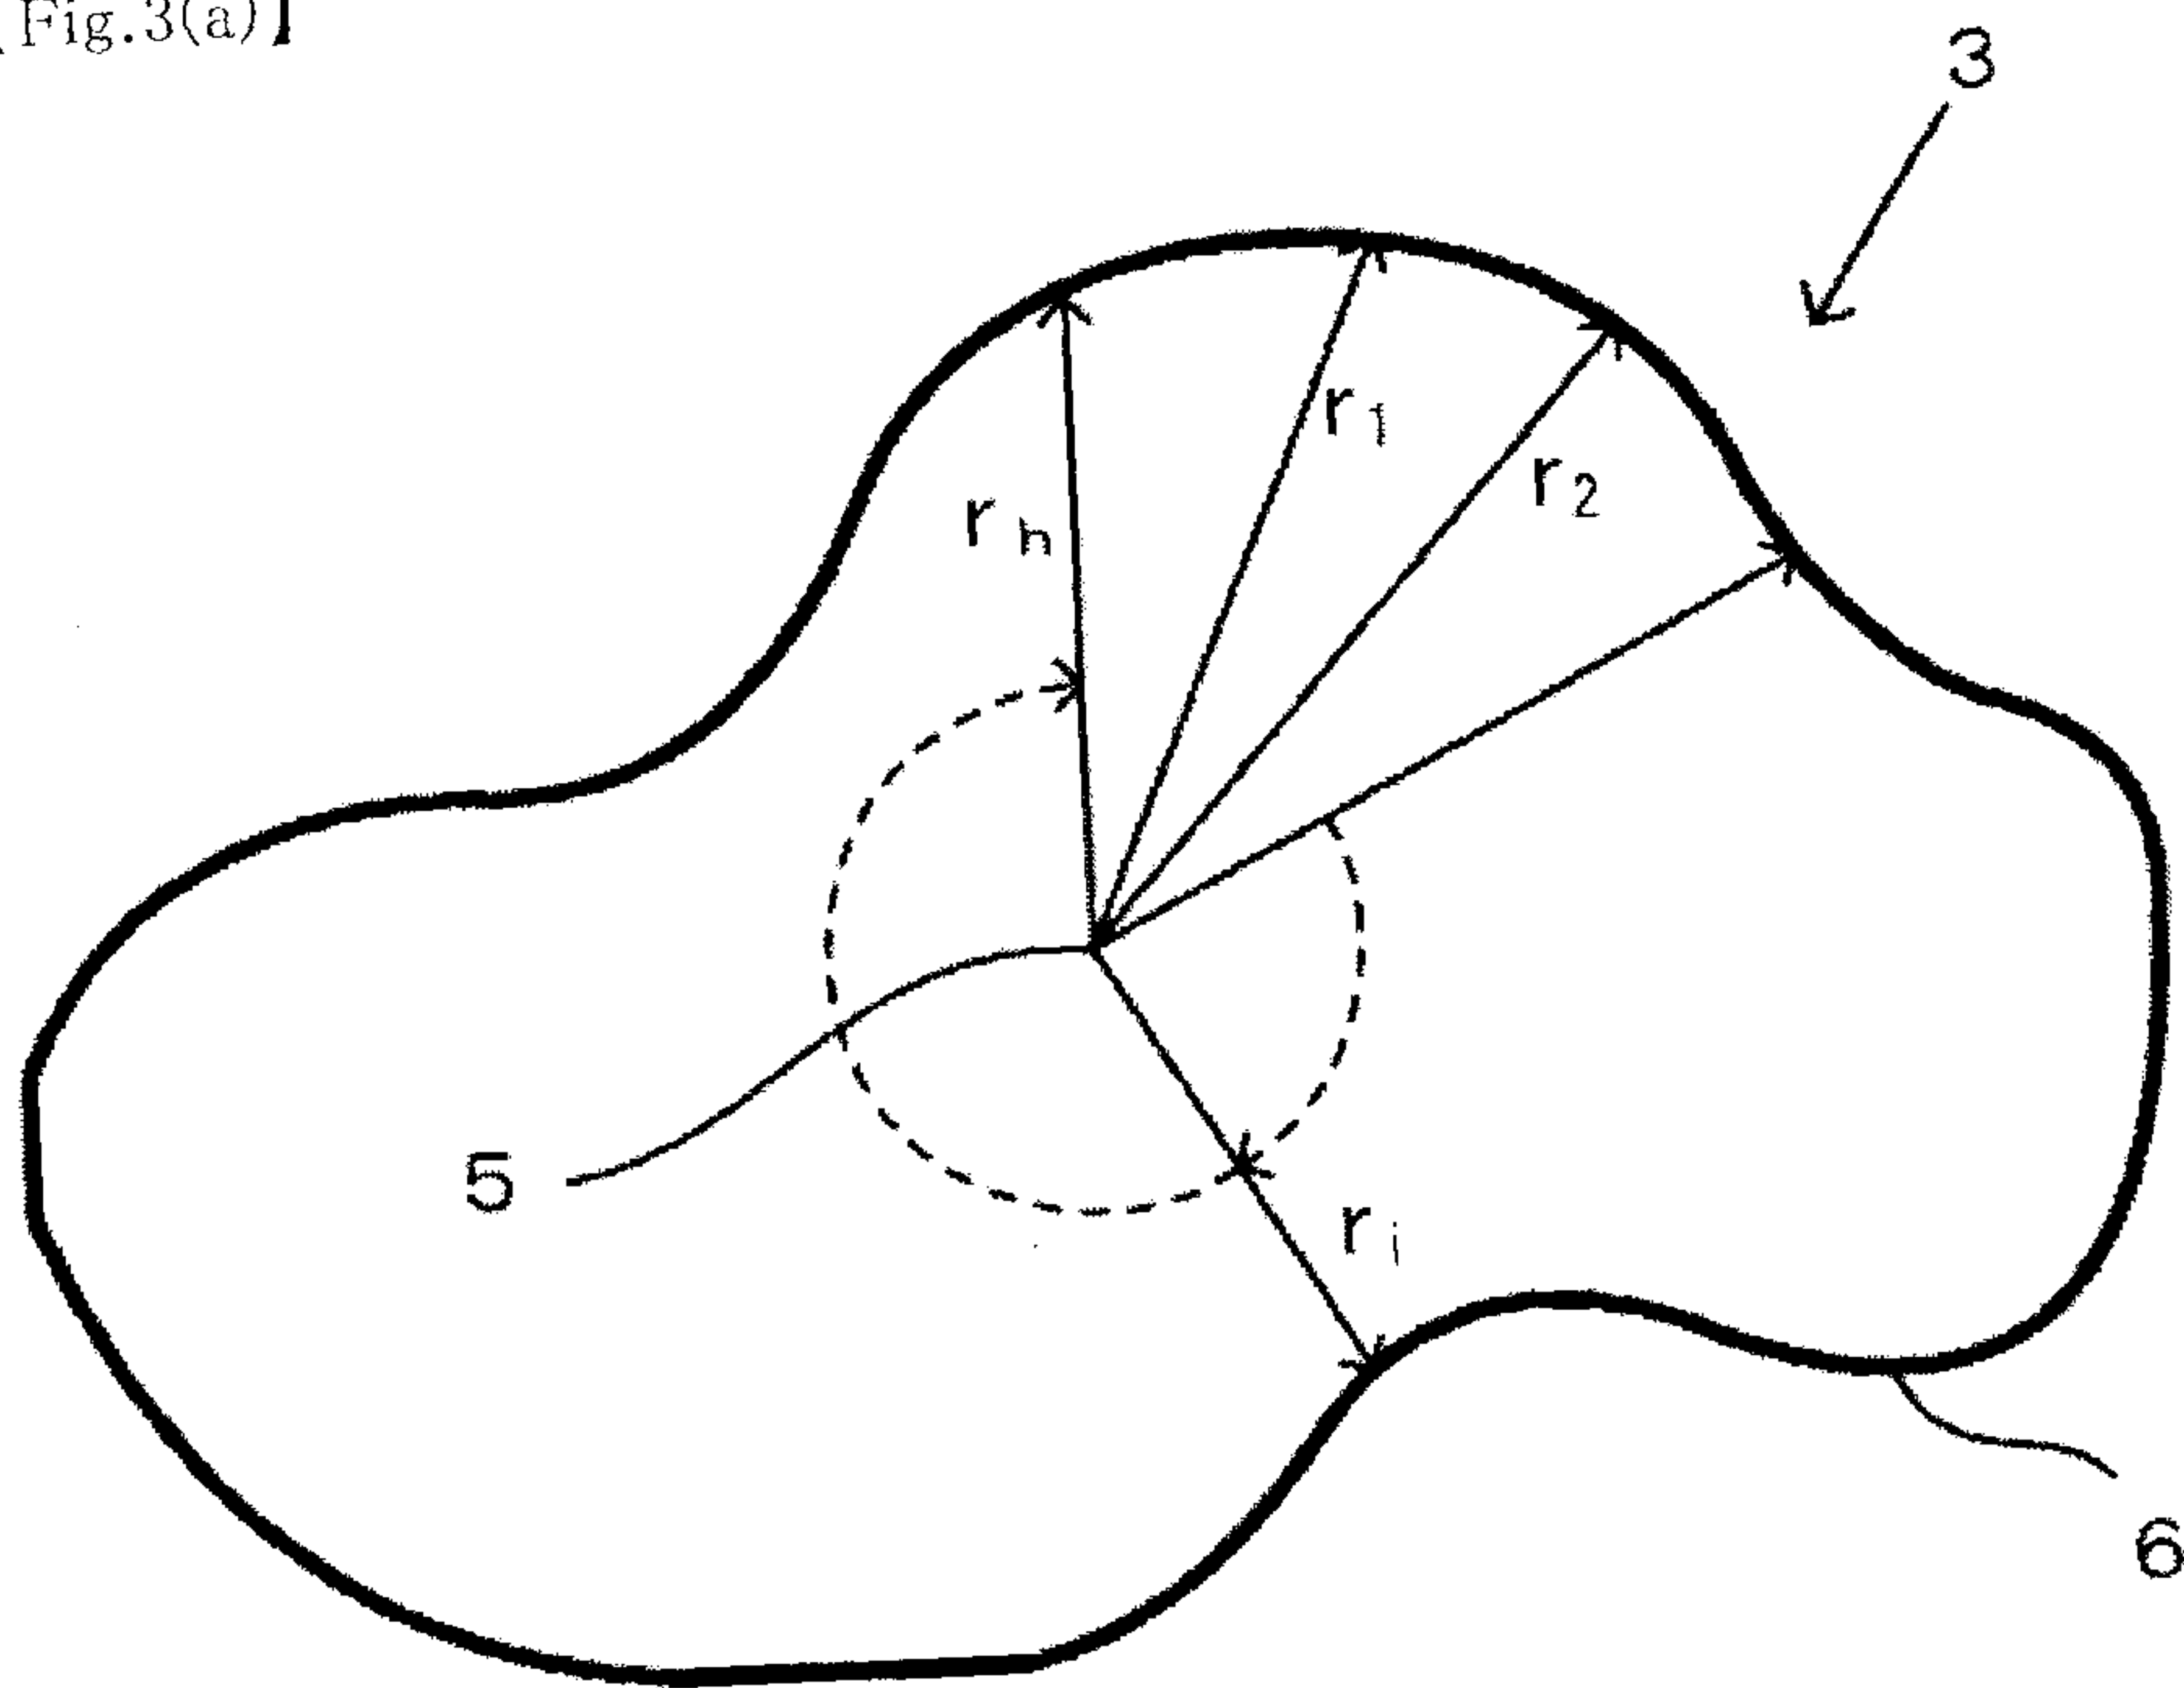


【Fig. 3(b)】

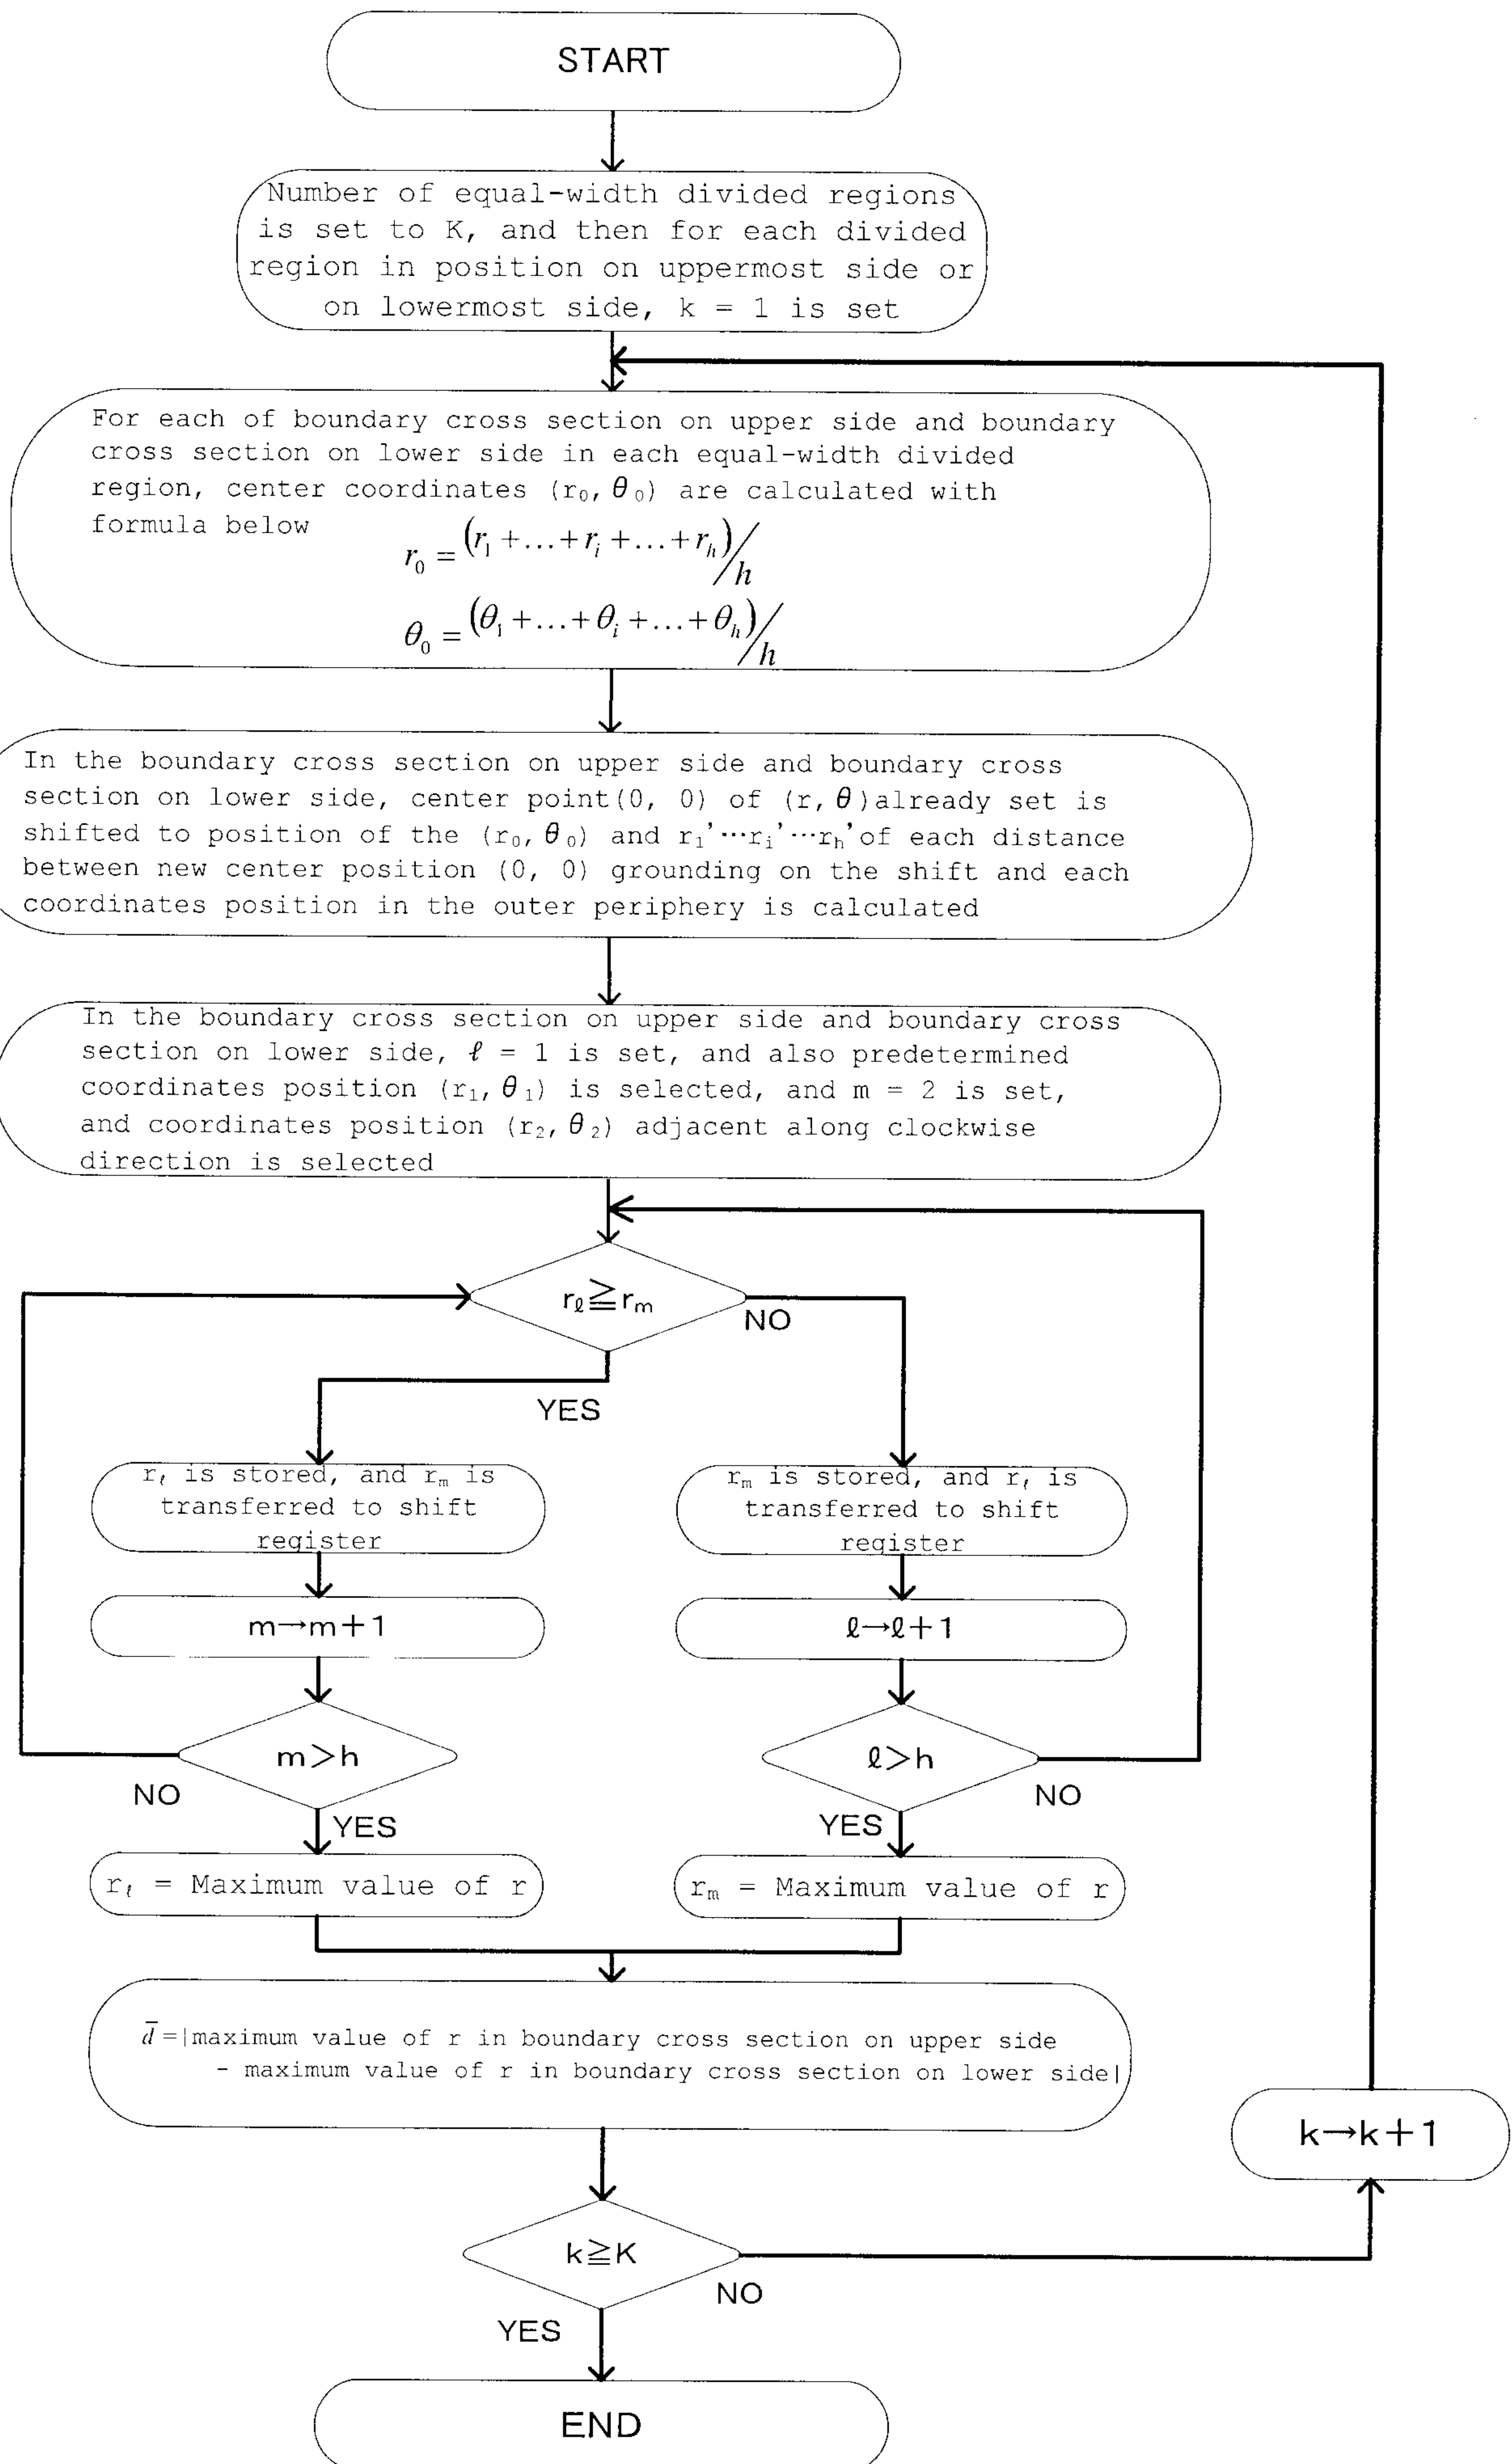


【Fig.4】

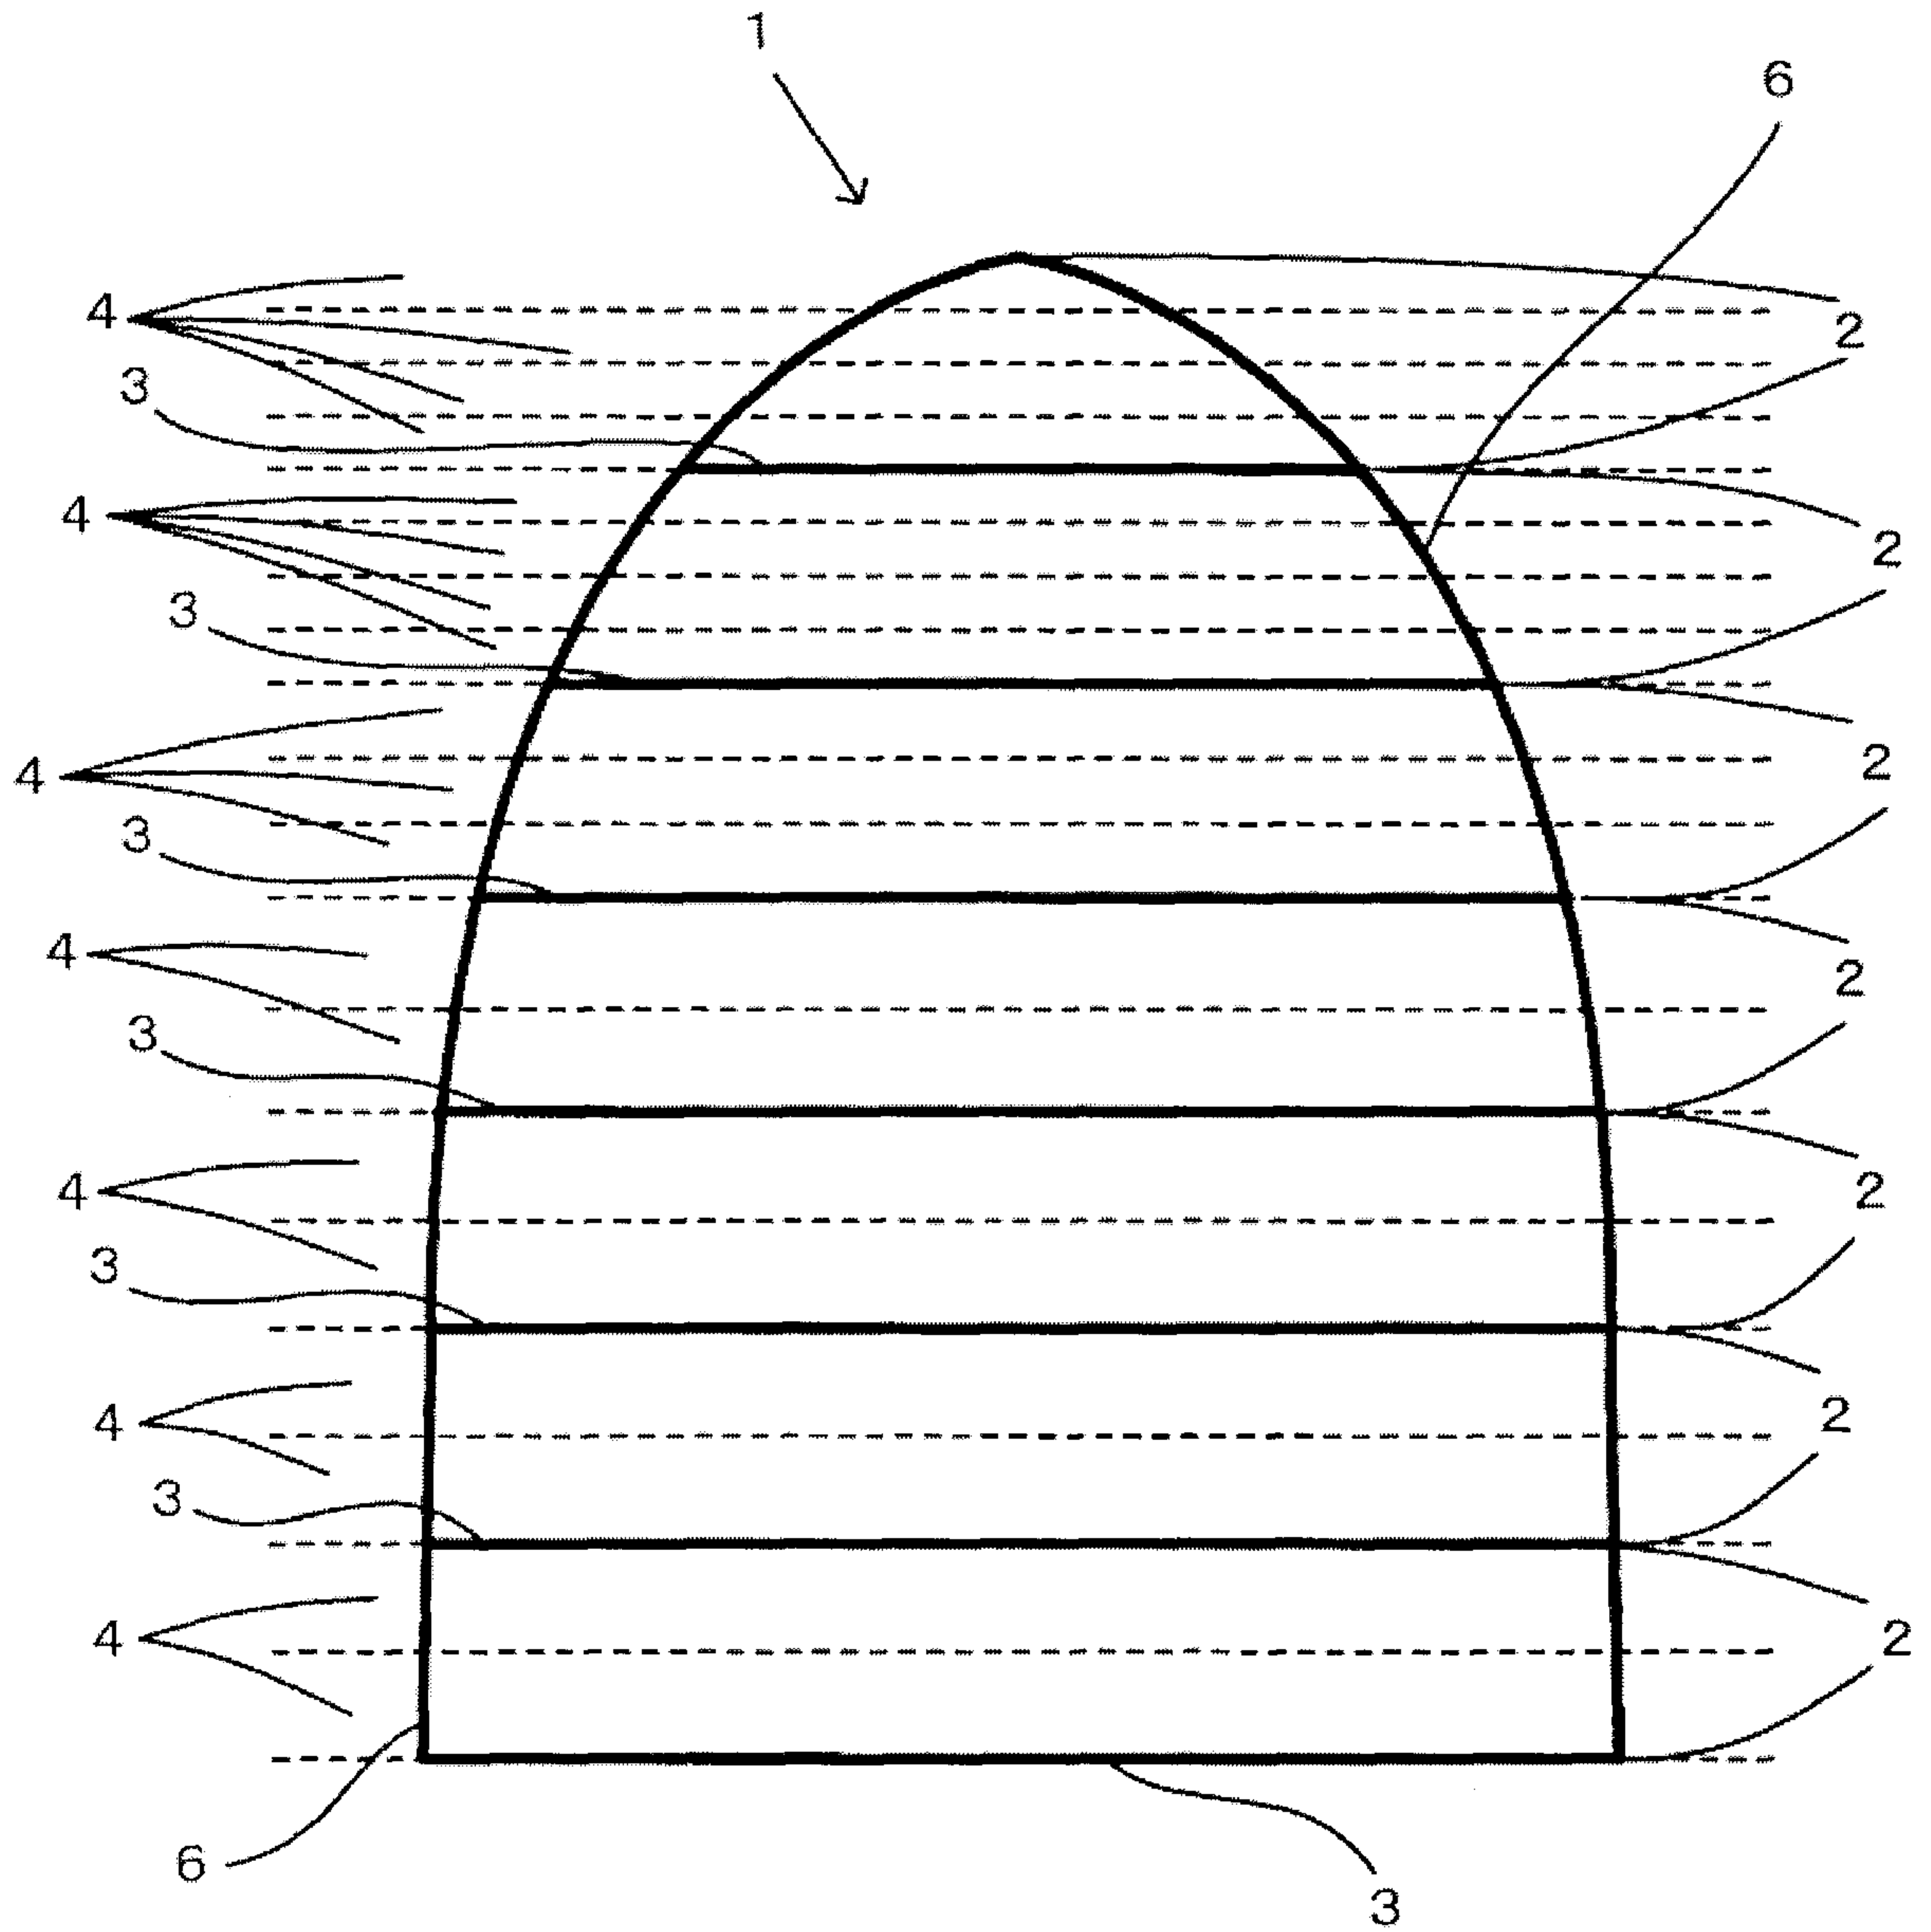

【Fig.5】

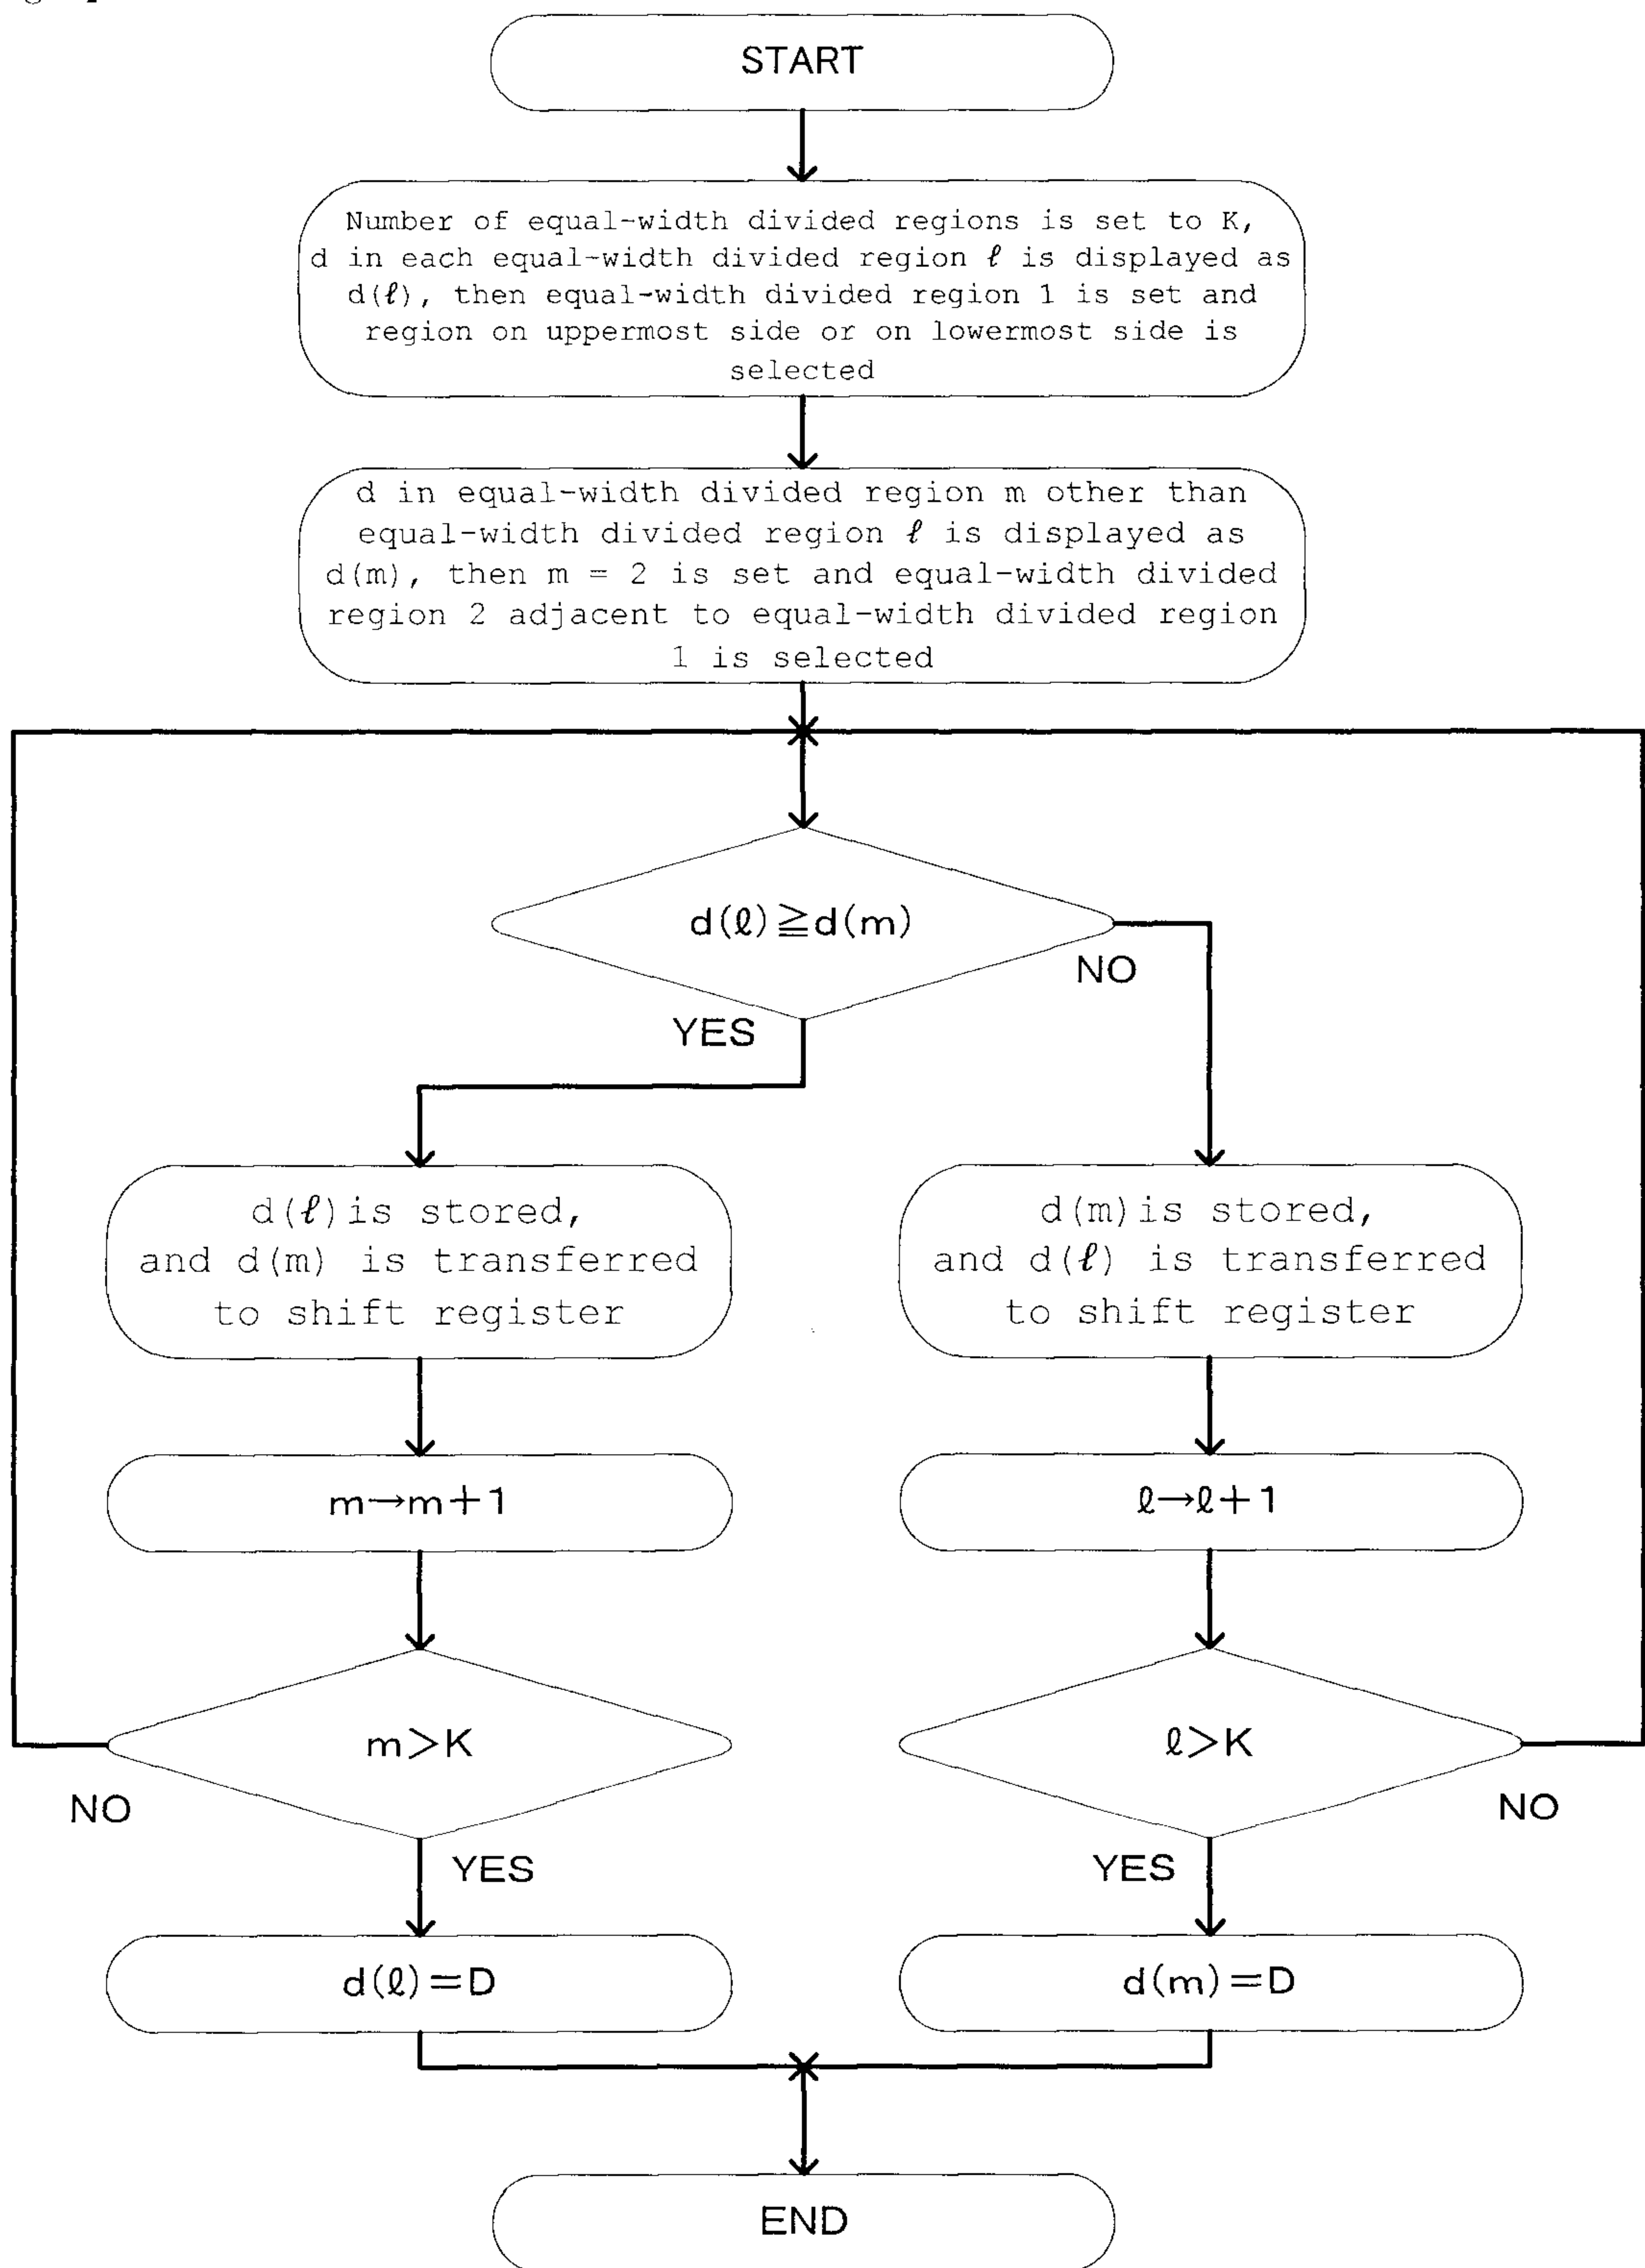

【Fig.6】

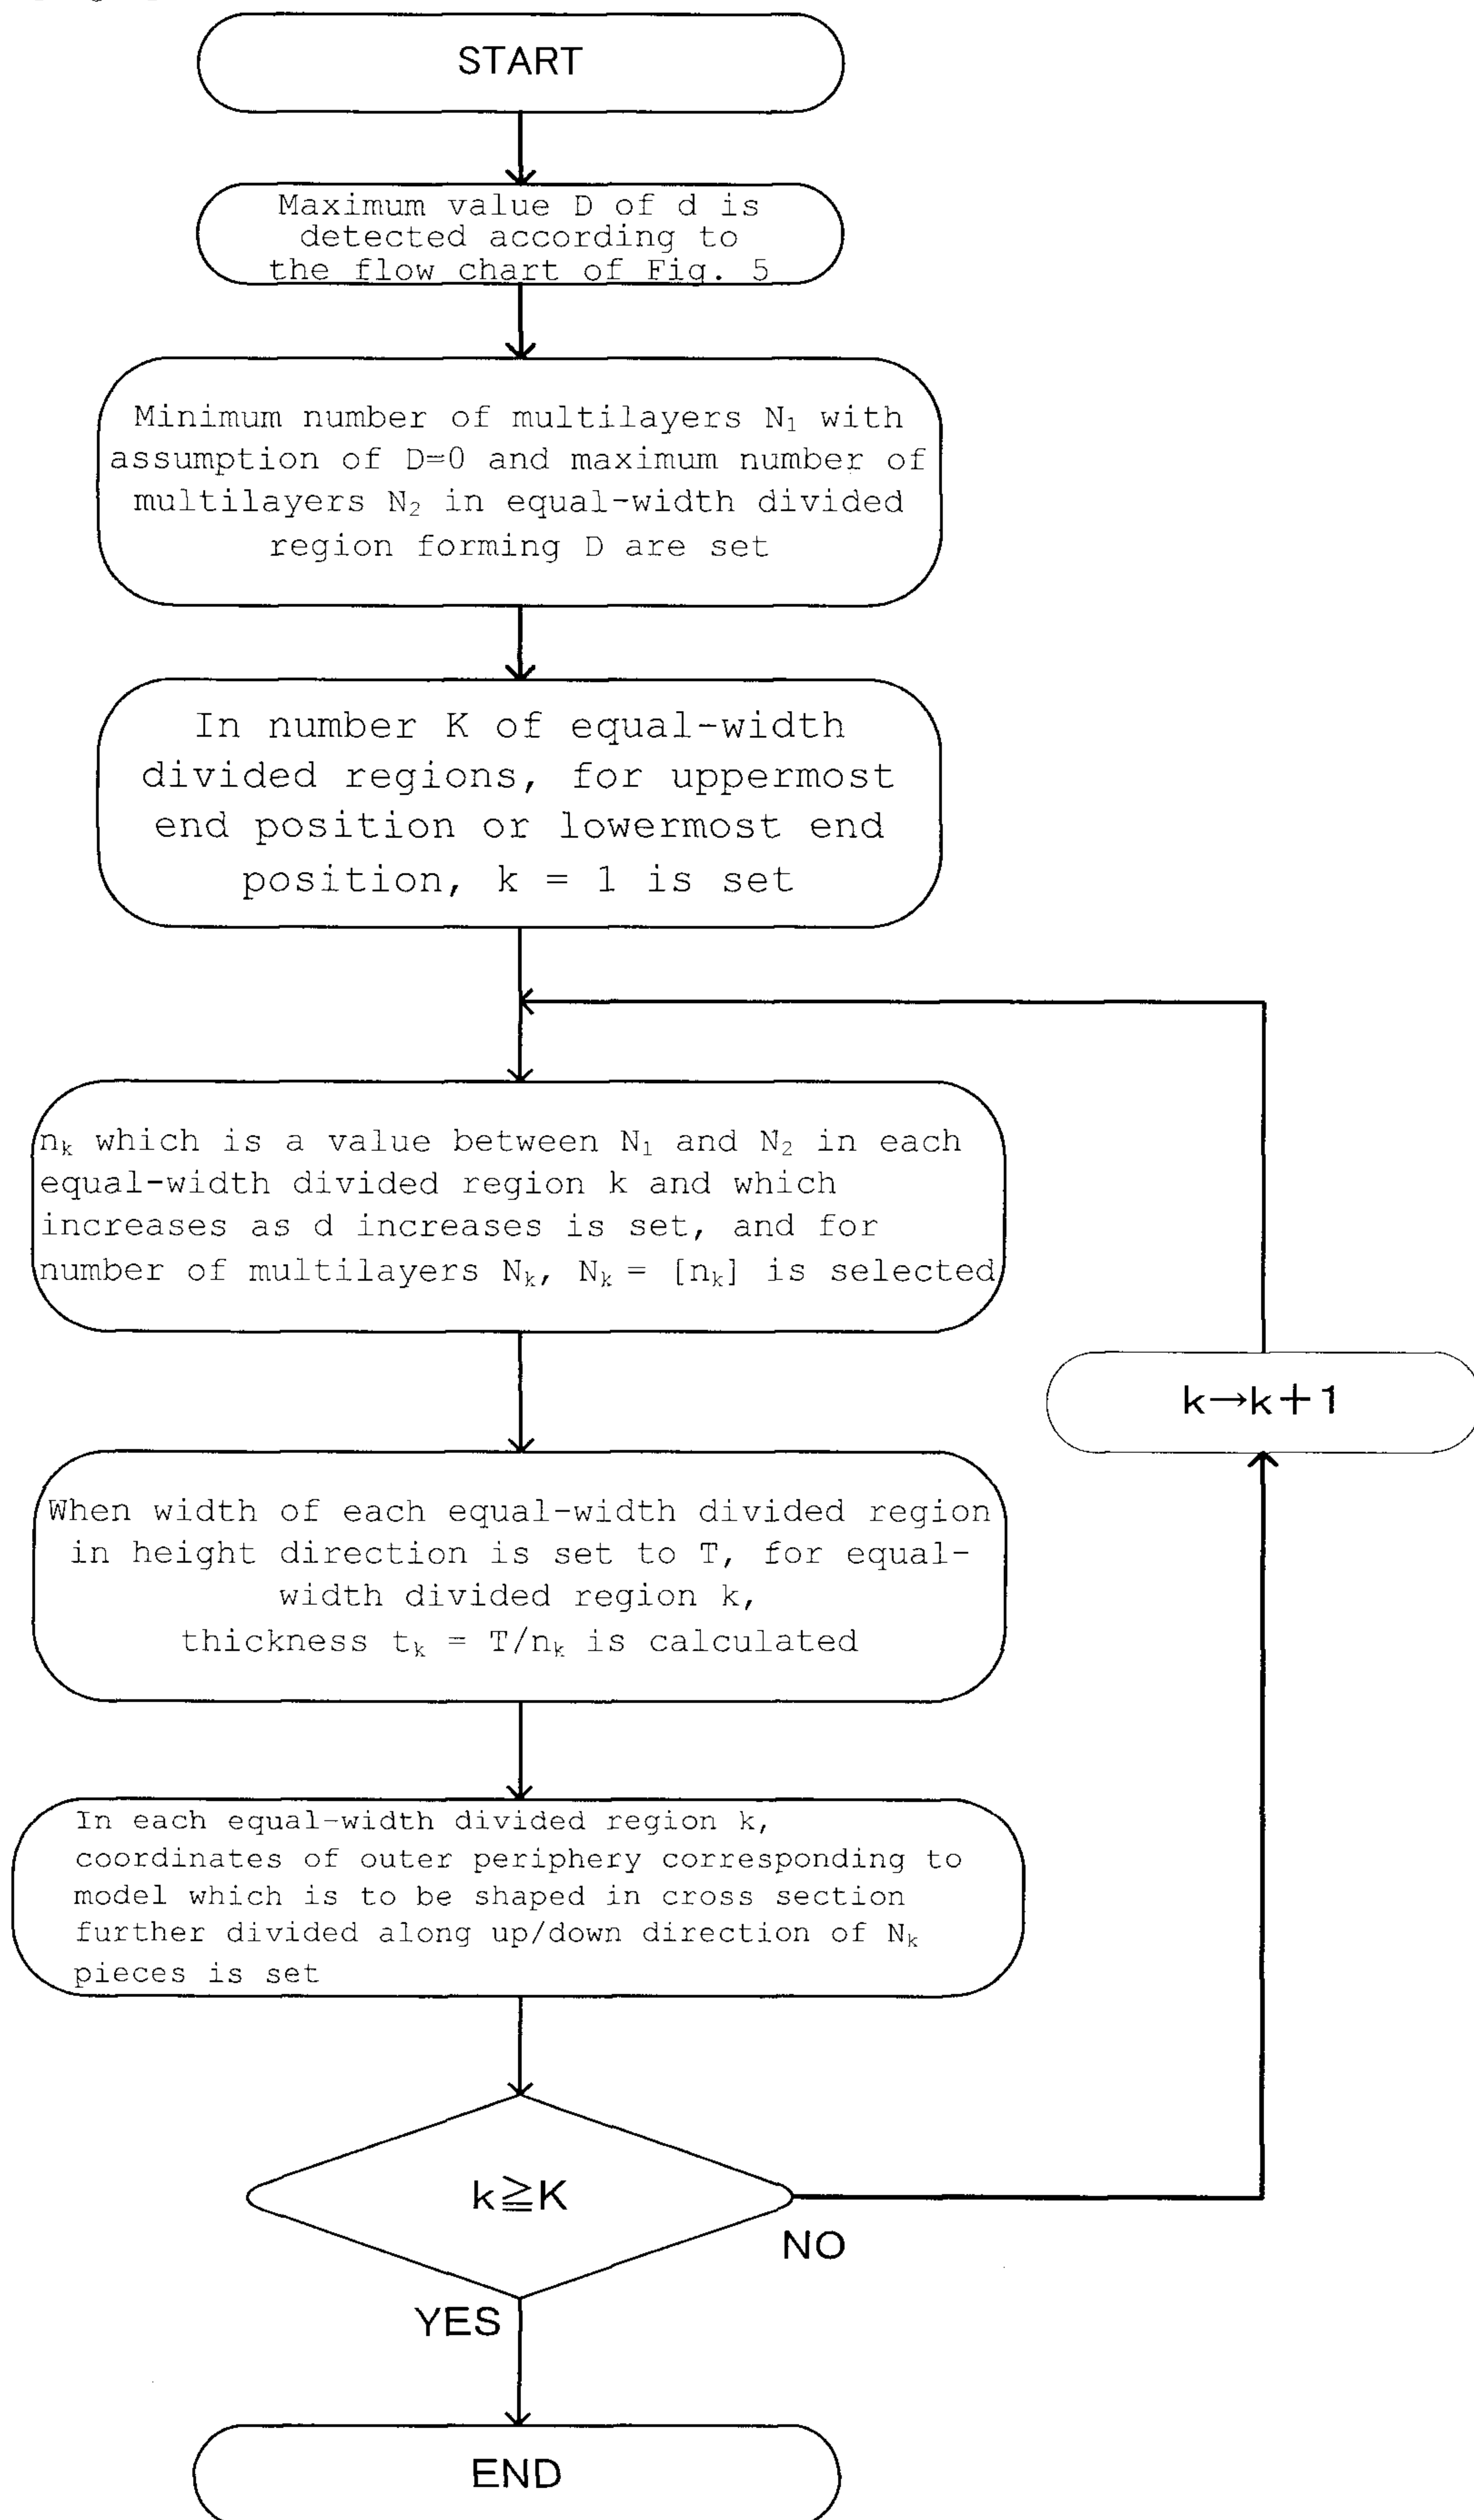

【Fig.7】

