




(86) Date de dépôt PCT/PCT Filing Date: 2003/03/13
 (87) Date publication PCT/PCT Publication Date: 2003/10/02
 (45) Date de délivrance/Issue Date: 2014/10/07
 (85) Entrée phase nationale/National Entry: 2004/09/24
 (86) N° demande PCT/PCT Application No.: AT 2003/000073
 (87) N° publication PCT/PCT Publication No.: 2003/079896
 (30) Priorité/Priority: 2002/03/25 (AT15 A 459/2002-2,3)

(51) Cl.Int./Int.Cl. *A61B 5/04* (2006.01),
A61B 5/00 (2006.01), *A61B 5/0424* (2006.01),
A61B 5/053 (2006.01)
 (72) Inventeur/Inventor:
 STOCKINGER, CHRISTIAN, US
 (73) Propriétaire/Owner:
 STOCKINGER, CHRISTIAN, US
 (74) Agent: BLAKE, CASSELS & GRAYDON LLP

(54) Titre : DISPOSITIF DE MESURE ET METHODE POUR REDUIRE LES ERREURS DE MESURE
 (54) Title: MEASURING DEVICE AND METHOD FOR REDUCING MEASURING ERRORS

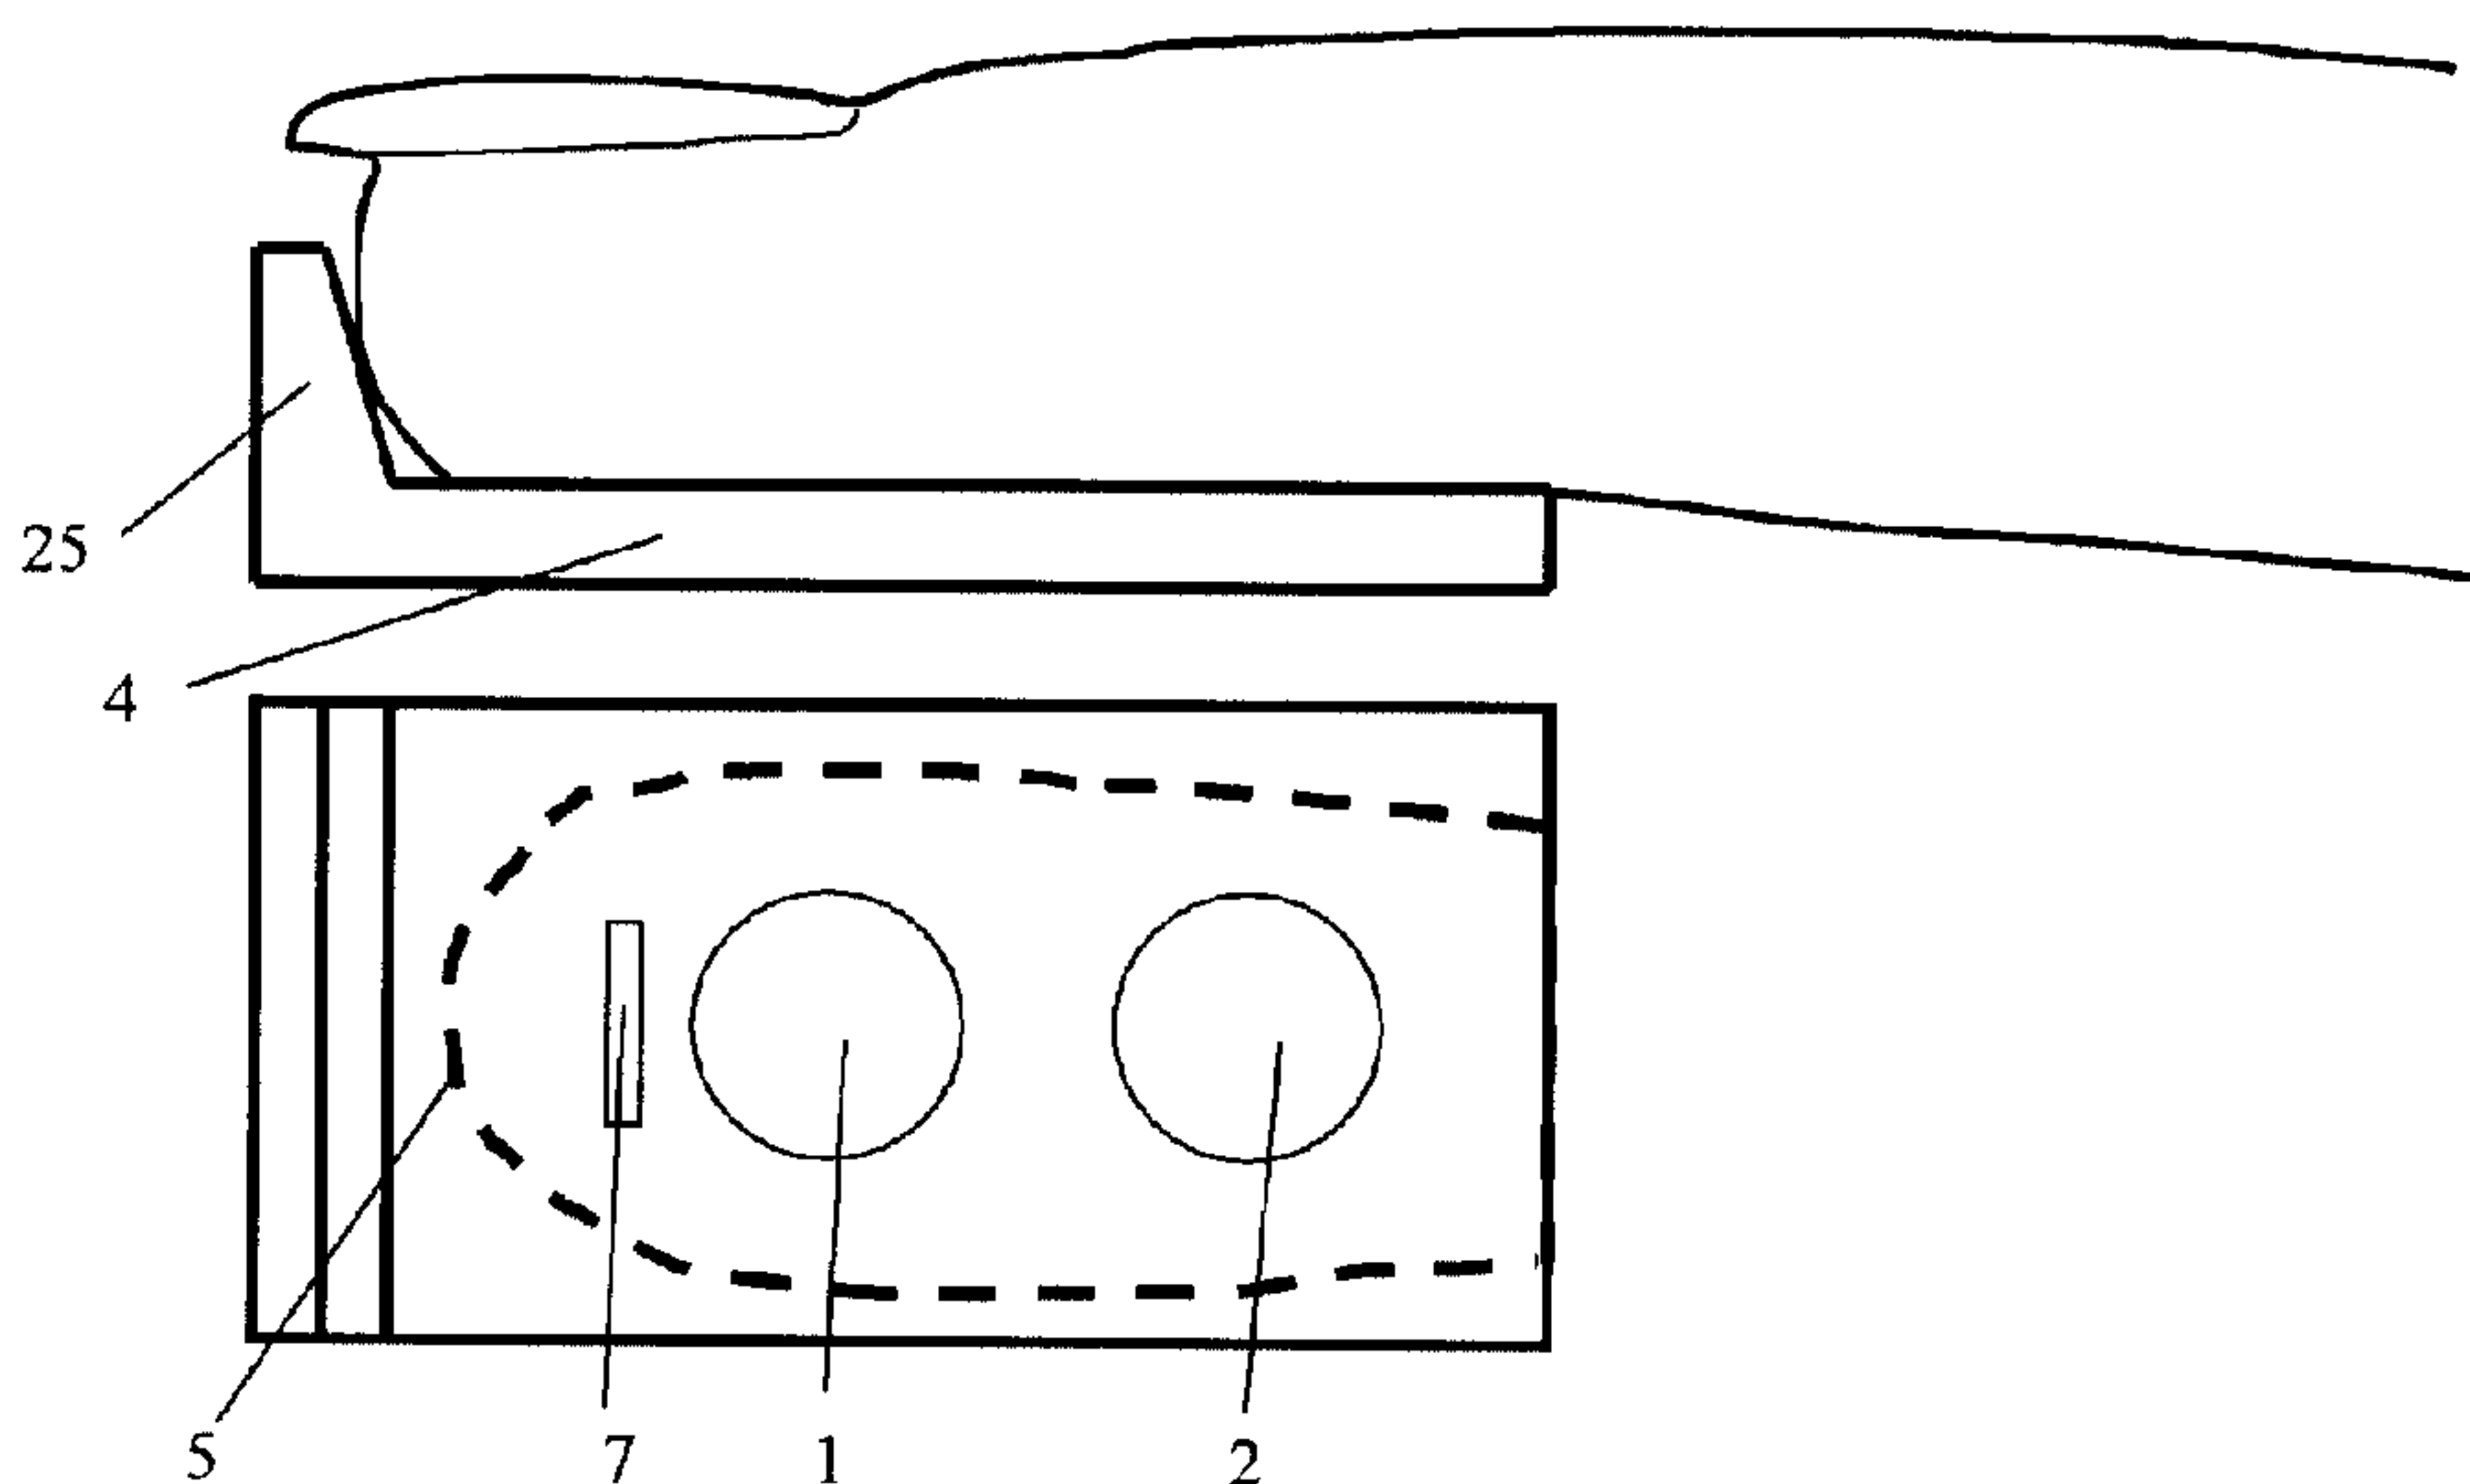

(57) **Abrégé/Abstract:**

The invention relates to a device for determining the non precise placement of measuring sites on measuring sensors and for reducing measuring errors, which result from the movement between the measuring sites and the measuring sensors when measuring the most diverse quantities to be measured, with the aim of creating robust measuring systems for recording measured values under real or challenging conditions. The invention is characterized by: detecting whether and which sensor elements are covered and thus in contact with the site to be measured; tracking and/or adapting the sensor elements so that the contact is not interrupted even during movements, and; the resilient arrangement of the contacts for constantly maintaining the mechanical bearing pressure when measuring the electrical skin resistance. The measurement data are processed further by software that determines the area of contact from the signals from the device and from the knowledge of the arrangement of the measuring elements, and uses the completely covered sensor elements determined thereby in order to conduct measurements with the fewest possible number of errors.



Abstract:

The invention relates to a device for determining the non precise placement of measuring
5 sites on measuring sensors and for reducing measuring errors, which result from the
movement between the measuring sites and the measuring sensors when measuring the most
diverse quantities to be measured, with the aim of creating robust measuring systems for
recording measured values under real or challenging conditions. The invention is
10 characterized by: detecting whether and which sensor elements are covered and thus in
contact with the site to be measured; tracking and/or adapting the sensor elements so that the
contact is not interrupted even during movements, and; the resilient arrangement of the
contacts for constantly maintaining the mechanical bearing pressure when measuring the
electrical skin resistance. The measurement data are processed further by software that
15 determines the area of contact from the signals from the device and from the knowledge of
the arrangement of the measuring elements, and uses the completely covered sensor elements
determined thereby in order to conduct measurements with the fewest possible number of
errors.

MEASURING DEVICE AND METHOD FOR REDUCING MEASURING ERRORS**FIELD OF THE INVENTION:**

[0001] The present invention applies to acquiring measuring values as accurately as possible
5 from a testing site of interest.

[0002] Physiological values from the human or animal body (e.g. skin resistance, temperature, circulation, etc.) may be given as examples. The sensors for these values can be mounted on items like a steering device or control device, a data input device, a mobile data processing unit or a mobile telephone, which the user uses while the measurement is taken.

10 **[0003]** This has diverse applications, such as monitoring certain conditions, stress monitoring, relaxation training, fitness training, games, performance improvement, diagnostics and training of bodily functions to heal and alleviate discomfort and sicknesses, work ergonomic applications etc.

[0004] Skin resistance and temperature are the values exemplarily used to illustrate the
15 descriptions.

[0005] As a matter of principle, other values such as circulation, oxygen saturation, surface hardness, electrical activity, heat dissipation etc. as well as values from other surfaces than the human or animal body surfaces can be measured with this invention, with a reduction of measuring errors.

20 **[0006]** The resulting measured values and the auxiliary values are measured and further processed in data processing devices.

DESCRIPTION OF THE PRIOR ART

[0007] As shown in patent JP11118636A (Tokai Rika Denki KK), April 30th 1999
25 (30.04.99) a multitude of sensor elements is used in one sensor device, the sensor elements of which are used together. Here sensors of the same type are used which are correlated with each

other and whose signals are processed concertedly. From this output values are calculated, which otherwise could not be obtained from one sensor alone. The invention describes a method, to produce a well-protected and miniaturized sensor array.

[0008] The patent JP9215667A (Nippon Kodan Corp.), August 19th 1997 (19.08.97)
5 describes a multitude of sensors in a measuring device, which together deliver a summary result. For the described EKG-sensor, three kinds of sensors work together (inverting contact, not inverting contact and reference contact of an instrumentation amplifier), to measure a value from the skin as accurately as possible. The joint structure in one device allows easy manageability and reduces measuring errors. The spring-mounted arrangement of the contacts allows an
10 adaptation to the skin surface.

[0009] The novelty of the present invention when compared to the two anticipations is, that two kinds of sensors or two kinds of data, which can be derived from sensors, are used in a shared sensor element. In doing so one sensor's information and the known geometrical position of the sensors relative to each other are used to evaluate the correctness of the other sensor's
15 information (if and which sensor elements have contact, if and which sensor elements are completely covered).

[0010] To further reduce measurement errors, the sensor elements are also movable and/or pliable and therefore can follow the test site during movements. Additionally, for the measurement of the skin resistance to obtain an as advantageously steady as possible bearing
20 pressure, the contact areas or the complete sensor are spring-mounted.

Other publications:

[0011] The measurement of physiological values under difficult circumstances is described in DE 199 59 576 A1. It does not, however, include the special contact, coverage and complete coverage, and prevention of interrupted contact assuring mechanisms and, in the case of the skin
25 resistance, the steady bearing pressure in the framework of such a device.

[0012] In the example of a physiological measurement on the skin in EP1 109 382 A2, assuring mechanisms are described that ensure contact through two different sensor systems. However none are described for coverage and complete coverage, prevention of interrupted

contact, and in the case of skin resistance, the steady contact pressure in the framework of such a device.

[0013] As shown in US 6067 468, the application of the sensors is taken for granted. The users usually are advised to be sure to have a correct and steady application of sensor elements
5 and to make as little as possible or no movements at all during the measurement.

SUMMARY OF THE INVENTION

[0014] Basically, all measurement values are measured with corresponding measurement sensors. Sensors do have a geometric dimension and have to be in one way or other in contact or
10 interaction with the testing site (corresponding to the kind of sensor element used).

[0015] While taking measurement values from a testing site which does not accurately fit the sensor elements, and/or is moving, as in the case with a user who uses a device with one or more mounted sensors, the following main problems make a simple and reliable measurement inaccurate or even impossible: Problem of detecting the contact of the sensor element:

15 **[0016]** To obtain useful measured values, one has to determine whether a testing site is contacting the sensor elements at all. If the sensor has multiple sensor elements, it needs to be determined which of these sensor elements are in contact with the testing site. Therefore what needs to be detected is, whether and which sensor elements are in contact with the testing site.

[0017] Problem of the complete coverage of sensors:
20 Sensor elements have a geometric dimension, a size. This implies, that under some circumstances, especially when the testing site is not perfectly fitting the sensors or during movements, sensors will not be completely covered or not completely covered at all times by the testing site, although a contact of the testing site with the sensor elements as such is given. This leads to large measuring errors.

25 **[0018]** Further problems, preventing a simple and reliable measurement or making it impossible:

[0019] Problem of loosing contact during movements:

If sensor elements are completely covered and if a movement between them and the testing site occurs during the measurement, be it a movement of the sensor or be it a movement of the testing site, measuring errors can happen due to lost contact. This is the case when sensor
5 elements are stationary on a testing site as well as when they are moved on a testing site.

[0020] Problem of the contact bearing pressure for skin resistance:

In the case of the physiological measuring value skin resistance, changes of the value of the skin resistance measurement signal are also possible through a change of the bearing pressure of the sensors on the skin. This happens for example through having more or less pressure of the skin
10 onto the sensors. This leads to measuring errors in the skin resistance measurement.

[0021] The invention solves the problems described above.

[0022] Solving the problems of detecting sensor element contact and the complete coverage of the sensor elements

[0023] By means of main sensor elements and auxiliary sensor elements

15 **[0024]** The invention is comprised of the following: The mounted sensor elements are divided into main sensor elements and auxiliary sensor elements. There are a number of main and auxiliary sensor elements on the sensor surface, which touches the testing site. The geometrical position of the main and the auxiliary sensor elements in relation to each other is known to the measuring system. If necessary, one or more common reference sensors can be
20 used.

[0025] Once it has detected which auxiliary sensors the testing site touches, the measuring system can deduce the contact area. All main sensors that lie in that ascertained contact area are completely covered and their signals are used for the actual measurement. For this, and this is very favorable, the auxiliary sensor elements do not need complete coverage. This means they
25 only need to give rough values, such as being in contact or not being in contact.

[0026] Differentiation between the signals of the main sensor elements and the signals of the auxiliary sensor elements for the data processing system has to be ensured. This can be solved

for example by using direct current for the auxiliary sensors and alternating current for the main sensors. Although the electrical signals superimpose each other on the testing site they can be distinguished into signals from the auxiliary sensors and signals from the main sensors and thereby the contact area can be determined.

5 [0027] Alternatively, the measurements that detect the contact of the sensor elements and those accomplishing the main measurement can be done with the same measurement value and also with the same sensor elements but in consecutive measurements. In that case it is assumed that during the main measurements (between the detection measurements) the contact of the sensors with the testing site does not change.

10 [0028] Example: Thumb Sensor for a computer mouse

[0029] A thumb sensor for a computer mouse is given as an example. See Fig. 1 “schematic view of the detection of the complete coverage for the thumb sensor of a computer mouse“.

[0030] To ensure that all the main sensor elements, (1) and (2) for the skin resistance and (3) for the temperature, are firstly covered and secondly covered completely, and are therefore able to fulfill their function as accurately as possible, this sensor is comprised as follows: Several
15 auxiliary sensor elements are arranged geometrically around the main sensor elements, e.g. three (7) (8) (9). The auxiliary sensors define the contact area (5), within which the main sensor elements are located. Once it has been detected that all the auxiliary sensors are contacted, the main sensor elements (1) (2) (3), which are arranged geometrically within the contact area, are
20 ensured to be covered and covered completely by the contacting skin surface. For this effect, the auxiliary sensors need not to be completely covered. They only need to deliver rough measurement values, like contact or no contact.

[0031] The areas created by the auxiliary sensors and the main sensor elements need not be completely overlapping. It needs only to be ensured through the design, that by covering the
25 auxiliary sensors, the contact area for the main sensors is so large that the main sensors are lying within it and therefore are completely covered. For example, at the thumb creating a triangular area by the auxiliary sensors necessarily ensures that the main sensor elements, which extend somewhat beyond that triangular area, are correctly covered. This is because the pattern of a

thumb on a sensor, which is mounted at the side of a computer mouse, is oval. If all 3 auxiliary sensors are covered, one can deduce that the main sensors, which extend somewhat beyond the triangular area, are also completely covered.

[0032] The differentiation between the signals of the main sensor elements and the signals of the auxiliary sensor elements needs to be ensured, see Fig. 2 "example of a signal flow from auxiliary sensor elements and main sensor elements for a thumb sensor of a computer mouse". In the case of this example for the measurement of the skin resistance at the thumb sensor (13) according to Fig. 1 this could be realized by utilizing a detection with alternating current (10) for the auxiliary sensor elements (7), (8), (9) and a detection with direct current (11) for the main sensor elements (1) (2). These signals are relatively easy to distinguish from each other. Auxiliary sensor elements and main sensor elements both have a measurement module whose output signals are delivered for analysis to the data processing system (12). This analysis includes the coverage detection and the measurement with completely covered main sensors.

[0033] Alternatively the measurements with the auxiliary sensors to detect the contact of the sensor elements and those accomplishing the main measurement can be done with the same measurement value in consecutive measurements. Thereby it is assumed that during the main measurements (between the detection measurements) the contact of the sensors with the testing site is not changing.

[0034] Example Finger Sensor

[0035] As a further example a finger sensor for a physiological measuring system according to Fig. 3 "schematic side view and upper view of a finger sensor with common reference electrode for main and auxiliary sensors" is given to explain, that the main and auxiliary sensors can have an electrode in common and that through the geometrical arrangement the complete coverage for the main measurement can be granted nevertheless.

[0036] The sensor (4) with a finger stop (25) is applied to the skin of a fingertip with its contact surface (5), the contact pattern of the contact area is oblong.

[0037] When contact is detected between the auxiliary sensor element (7) and the contact area (2) by means of a measurement, it is assured, that the main sensor element (1) is completely

covered. By virtue of the knowledge of the position and the constructive size of the sensor which through the resting obstacle can only be applied to a finger tip it is assured, that the sensor element (2) is completely covered, in this case used as main sensor element as well as auxiliary sensor element, and thus a correct measurement between the sensor elements (1) and (2) can be performed.

[0038] The differentiation between the signals of the main sensor elements and the signals of the auxiliary sensor elements again can occur e.g. through the use of alternating current for the auxiliary sensor elements and through direct current for the main sensor elements.

[0039] Alternatively the measurements with the auxiliary sensor to detect the contact of the sensor elements and those accomplishing the main measurement can be done with the same measurement value (e.g. direct current) in consecutive measurements. Thereby it is assumed that during the main measurements (between the detection measurements) the contact of the sensors with the testing site is not changing.

[0040] Example Steering Wheel

[0041] As a further example for a sensor a steering wheel with a mounted multitude of sensor elements for the measurement of skin resistance is given. In Fig. 4 "schematic view of the sensors to detect the contact area on a steering wheel" the area to touch from the steering wheel is schematically shown unrolled as rectangle. To detect which main sensor elements (15, white) are covered through the testing site skin (of the touching hand) and thus are able to fulfill their function as accurately as possible, the main sensor elements are placed between the auxiliary sensor elements (16, dotted). When it is detected which auxiliary sensors are touched by the skin, this results for the measuring system in the contact area (14). All main sensors within this contact area are completely covered and are used for the actual measurement. For this the auxiliary sensors do not need to be completely covered, they have to give only rough data such as contact or no contact.

[0042] The differentiation between the signals of the main sensor elements and the signals of the auxiliary sensor elements again can occur through e.g. the use of alternating current for the auxiliary sensor elements and through direct current for the main sensor elements. Or the

measurements can be performed with the same measurement value (e.g. direct current) in consecutive measurements. Thereby it is assumed that during the main measurements (between the detection measurements) the contact of the sensors with the testing site is not changing.

[0043] By means of correlation of the sensor elements with each other

5 **[0044]** Here the sensor elements are not divided into main sensors and auxiliary sensors. The invention comprises a multitude of sensors, which are mounted on the sensor surface, which shall be touched. The geometric position of the sensor elements to each other is known to the measuring system.

10 **[0045]** To detect, which sensor elements are covered and can fulfill their function as accurately as possible this measuring device comprises, that every sensor element is sampled in the form of a matrix to detect with an auxiliary medium like current, light or the like or an other characteristic like temperature if and where a contact with the testing site takes place.

15 **[0046]** Through this procedure results the contact area of the covered sensor elements. All sensor elements within this contact area are completely covered and are used for the actual measurement. Attention needs to be applied to sensor elements at the fringe of the contact area, their measuring values are either to be rejected or, if possible, to be corrected.

[0047] The information of the position of the contact area itself can also be used for further processing.

20 **[0048]** As an example again a steering wheel is given and referred to Fig. 5 a “schematic view of the device to detect the contact area through measurements with the sensor elements to each other”. Here a small part of the area to be touched is shown unrolled from the steering wheel as a rectangle, the contact area (15) touched by the skin shall be detected. The sensor elements are arranged in a matrix, e.g. 100 sensors for each row, in the figure the number of the sensor element is given in the inside of the respective sensor element. Now, with one sensor
25 element after the other, here e.g. Nr. 216 with its geometrically surrounding elements 115, 116, 117, 215, 217, 315, 316 and 317, measurements are performed, sampled. In the example the processing of the measured values results in contact across the testing site with the elements 117, 217, 316 and 317.

[0049] With this information the system can detect, that the geometrical borderline of the testing site runs through the elements 117, 216, 316 and (after a measurement with element 316 and its surrounding elements) 416.

5 [0050] The detected contact area (17, dotted colored sensor elements) in Fig. 5 b “schematic view of the contact area after the coverage detection with measurements of the elements to each other” with completely covered sensors is therefore detected to be to the right from the dotted sensors 118, 217, 218, 317, 318, 417, 418. After the performance of all measurements of all sensor elements with their respective surrounding sensor elements the complete contact area can be detected. With this information the actual main measurement is performed as accurately as
10 possible during which it is assumed that the contact area is not changing. In addition, if necessary, the information about the position of the contact area is processed.

[0051] As a variation the sampling for each sensor element can be performed as a measurement with one or more common reference electrodes. Any covered sensor element can be used as reference electrode. These reference electrodes could even be designated during a
15 measurement, when in a first measurement sequence one or more covered sensor elements are detected which are used as reference electrodes for the next measurement sequence.

[0052] Solution of the problem of losing contact during movements through tracking or molding of the sensor elements

20 [0053] The sensor elements need to make good contact with the testing site, the contact needs to be warranted (sensor stationary on one testing site or moving on a testing site). In the case of the first contact and movement during the measurement this is solved by the invention by tracking and/or a molding of the sensor elements.

[0054] Therefore the invention comprises tracking the sensor elements as far as possible according to the movements to be expected in order to not lose contact with the testing site and
25 thus to avoid measuring errors.

[0055] In addition or alternatively the invention comprises that sensor elements themselves can be formed to the form of the testing site to warrant a correct contact. Thereby the sensor elements are pliable and/or track-able and thus fit to the testing site, even during movements.

[0056] This can be done with and without using a fixed matrix of auxiliary sensors. Here the auxiliary sensors are designed as being not moveable and serve as counter bearing to bear the mechanical forces of the testing site.

[0057] Example rocker for a thumb sensor of a computer mouse

5 **[0058]** In Fig. 6 “view of a moving device with sensor elements for tracking” the sensor elements (1), (2) for the skin resistance and (3) for the temperature are built into the vertical surface of a moving device (4) (a teeter). This teeter is inserted into the PC-mouse (6) in the region of the thumb and follows the thumb in his movements during work with the PC-mouse. Through this tracking the contact between sensor elements and skin is granted within a wide
10 range.

[0059] Alternatively or additionally the sensor elements (1), (2), (3) can be adjusted to the surface form of the skin to grant a correct contact to the skin, see Fig. 7 “view onto moveable sensor elements for adjusting to the testing site”. Here the sensor elements are moving and equipped with springs (18) and adjust themselves to the skin (26), even during movements.

15 **[0060]** Alternatively or additionally the sensor elements (1), (2), (3) themselves can be adjusted to the surface form of the skin to assure a fitting contact to the skin. Here the sensor elements themselves are pliable. With a light pressure they take on the form of the skin site and adjust themselves to the skin even during movements. For this the material of the sensor elements has to be pliable.

20 **[0061]** Examples of application at joysticks, game consoles, mobile data processing units and mobile telephones

[0062] A joystick is a computer input device operated like a control stick of an airplane, a game console is usually used to control electronic games with input buttons.

[0063] According to Fig. 8 “view onto a moving, spring-mounted device with sensor
25 elements for tracking and in the case of the skin resistance for keeping the pressure constant”, in this example sensor elements are inserted in a moving device. This is here a teeter (22), which can be pressed inwards along a vertical guide, which is spring-mounted by the spring (20). This

sensor is for example inserted into the joystick (22), the mobile data processing unit or the mobile phone in the area of the heel of the hand and follows the skin during movements as it is used.

5 **[0064]** Alternatively or additionally the sensor elements (1), (2), (3) themselves can be adjusted to the surface form of the skin to grant a correct contact to the skin, similar as in Fig. 7 for the computer mouse. Here the sensor elements are pliable and/or spring-mounted moveable and thus adjust to the skin, even during movements.

10 **[0065]** For not so strict demands on the precision of the measurement the tracking can be omitted, the sensor elements then are integrated in a not moveable manner (e.g. in the region of the device which reaches the palm of the hand).

[0066] Solution of the bearing pressure problem through keeping the pressure constant for the skin resistance measurement

15 **[0067]** A factor in measuring the electric resistance of the skin is the pressure the contact areas bear onto the skin. If this pressure changes during the measurement by a more or less firm grip of the user, changes in the data of the electrical auxiliary physical value to register the skin resistance can occur, which are not caused by a change of the skin resistance (measuring error). Therefore the invention comprises spring-mounted contact areas for the skin resistance. Changes of pressure of the skin site are transferred to the material surrounding the spring-mounted contact areas. Therefore the bearing pressure of the contact areas onto the skin depends in a wide range
20 only on the spring, which produces a constant bearing pressure.

[0068] In Fig. 9 “spring-mounted contact areas for the skin resistance measurement” the spring-mounted sensor elements (1) or (2) are assembled in the sensor (4) onto which the skin (5) presses. Through the spring (23) the constant bearing pressure of the main sensors is created, hereby enabling the main sensor to measure as accurately as possible. Pressure changes are
25 transferred only to the surrounding sensor material (4).

[0069] In the example according to Fig. 10 “spring-mounted contact areas for the measurement in a fixed matrix of auxiliary sensors to keep the bearing pressure constant during measurement of the skin resistance” this can be performed with a fixed matrix of auxiliary

sensors. Here the skin (5) is positioned through the fixed auxiliary sensors (26, narrowly dotted), onto which the changes in pressure are transferred. For the measuring signals of the auxiliary sensors the constant bearing pressure is not so important as long as they are contacted at all. The (dotted) main sensors (27) are pressed against the skin with the springs (24). Through the
 5 positioning of the skin (5) through contacting the auxiliary sensors a constant bearing pressure results for the main sensors which now can measure with a constant bearing pressure as accurately as possible.

[0070] Alternatively the invention comprises a spring-mounting of the complete sensor element to keep the bearing pressure constant. If the skin site can only be in a defined area it is
 10 possible by tracking the complete sensor element to keep the bearing pressure constant within certain limits and thus to keep the measuring errors small.

[0071] An example would be a joystick whose spring-mounted element according to Fig. 8 reaches the skin with a somewhat constant bearing pressure as long as the hand encloses the joystick.

15 **[0072]** Structure of the analyzing software

[0073] This describes the structure of software in a data processing unit, which processes the measuring data of the error reducing measuring sensors.

[0074] Detection of coverage with auxiliary sensor elements

[0075] The analyzing software for the measuring error reducing sensors comprises, that the
 20 contact area can be determined through the coverage detection according to chapter 1.4.1.1. Along with the positioning of the sensor elements known to the system the states “no main and auxiliary sensor element covered”, “certain main and auxiliary sensors covered but not completely” and “certain main and auxiliary sensor elements completely covered ” can be distinguished.

25 **[0076]** In the states “no main and auxiliary sensor element covered” and “certain main and auxiliary sensors covered but not completely” the measuring data is rejected or, if possible, corrected, and thus measuring errors eliminated, furthermore a warning can be given to the user

and/or an action to correct the sensors can be demanded, and the geometric position of the contact area can be processed further.

5 **[0077]** In the state “certain main and auxiliary sensor elements completely covered” the detected covered sensor elements can be used for measurements, which are as accurate as possible, and the geometric position of the contact area can be processed further.

[0078] Coverage detection of the sensor elements to each other

10 **[0079]** The analyzing software for the sensors with measurement error reducing through the coverage detection to each other comprises that the contact area can be determined through the coverage detection according to chapter 1.4.1.2. With the positioning of the sensor elements, which is known to the system it can distinguish between the states “no sensor elements covered” and “certain sensor elements covered and thus completely covered”.

[0080] In the state “no sensor elements covered” the measuring data is rejected or, if possible, corrected, and thus measuring errors eliminated, furthermore a warning can be given to the user and/or an action to correct the sensors can be demanded.

15 **[0081]** In the state “certain sensor elements covered and thus completely covered” the detected covered sensor elements can be used for measurements as accurately as possible, and the geometric position of the contact area can be processed further.

We Claim

1. Measuring device to measure physiological values from a human or animal skin surface and to detect non-precise application of testing sites onto measuring sensors and for use in robust measuring systems, the measuring device is comprised of:

a plurality of sensor elements for the performance of physiological measurements whereby the sensor elements are disposed on a sensor surface and are divided into a number of main sensors and auxiliary sensors; and

a data processing unit for differentiating between signals from the main sensors and the auxiliary sensors to detect non-precise application of testing sites onto measuring sensors;

whereby the relative positions of the main sensors and the auxiliary sensors are known to the data processing unit, so that through signals from the main sensors and the auxiliary sensors a contact area is determined within which all main sensors are completely covered; and the data processing unit only uses signals from completely covered main sensors within the determined contact area for actual measurements, or only uses the signals of completely covered auxiliary sensors within the determined contact area for actual measurements.

2. The measuring of claim 1, wherein said measuring device contains at least one reference sensor.

3. The measuring device according to any one of claims 1 or 2, whereby the plurality of sensors on the sensor surface is arranged in the form of a matrix, and the sensors serve at the same time or consecutively as main sensors, auxiliary sensors and, if reference sensors are present, as reference sensors; and the sensors are designed to measure in matrix fashion to determine a contact area which consists only of completely covered sensors.

4. The measuring device according to any one of claims 1-3, wherein the physiological values include electrical resistance.

5. The measuring device according to any one of claims 1-4, whereby the plurality

of sensors is moveable so that the contact with the test area at first contact or during movements is tracked and sustained.

6. The measuring device according to any one of claims 1-5, whereby the plurality of sensors is pliable to conform to the shape of the portion of skin undergoing measurement.

7. The measuring device according to any one of claims 1-6, whereby the sensors are spring mounted so that the contact with the test area at first contact or during movements is tracked and sustained.

8. The measuring device according to any one of claims 1-7, whereby the plurality of sensors or the measuring device itself is/are spring mounted in order to produce a constant bearing pressure onto the skin.

9. The measuring device according to any one of claims 1-8, whereby the data processing unit distinguishes between states where no sensors are covered and states where certain sensors are completely covered.

10. The measuring device according to claim 9, whereby the data processing unit creates a warning if the state where certain sensors are completely covered is not attained.

11. The measuring device according to any one of claims 9 or 10, whereby the data processing unit analyzes the geometric position of the contact area.

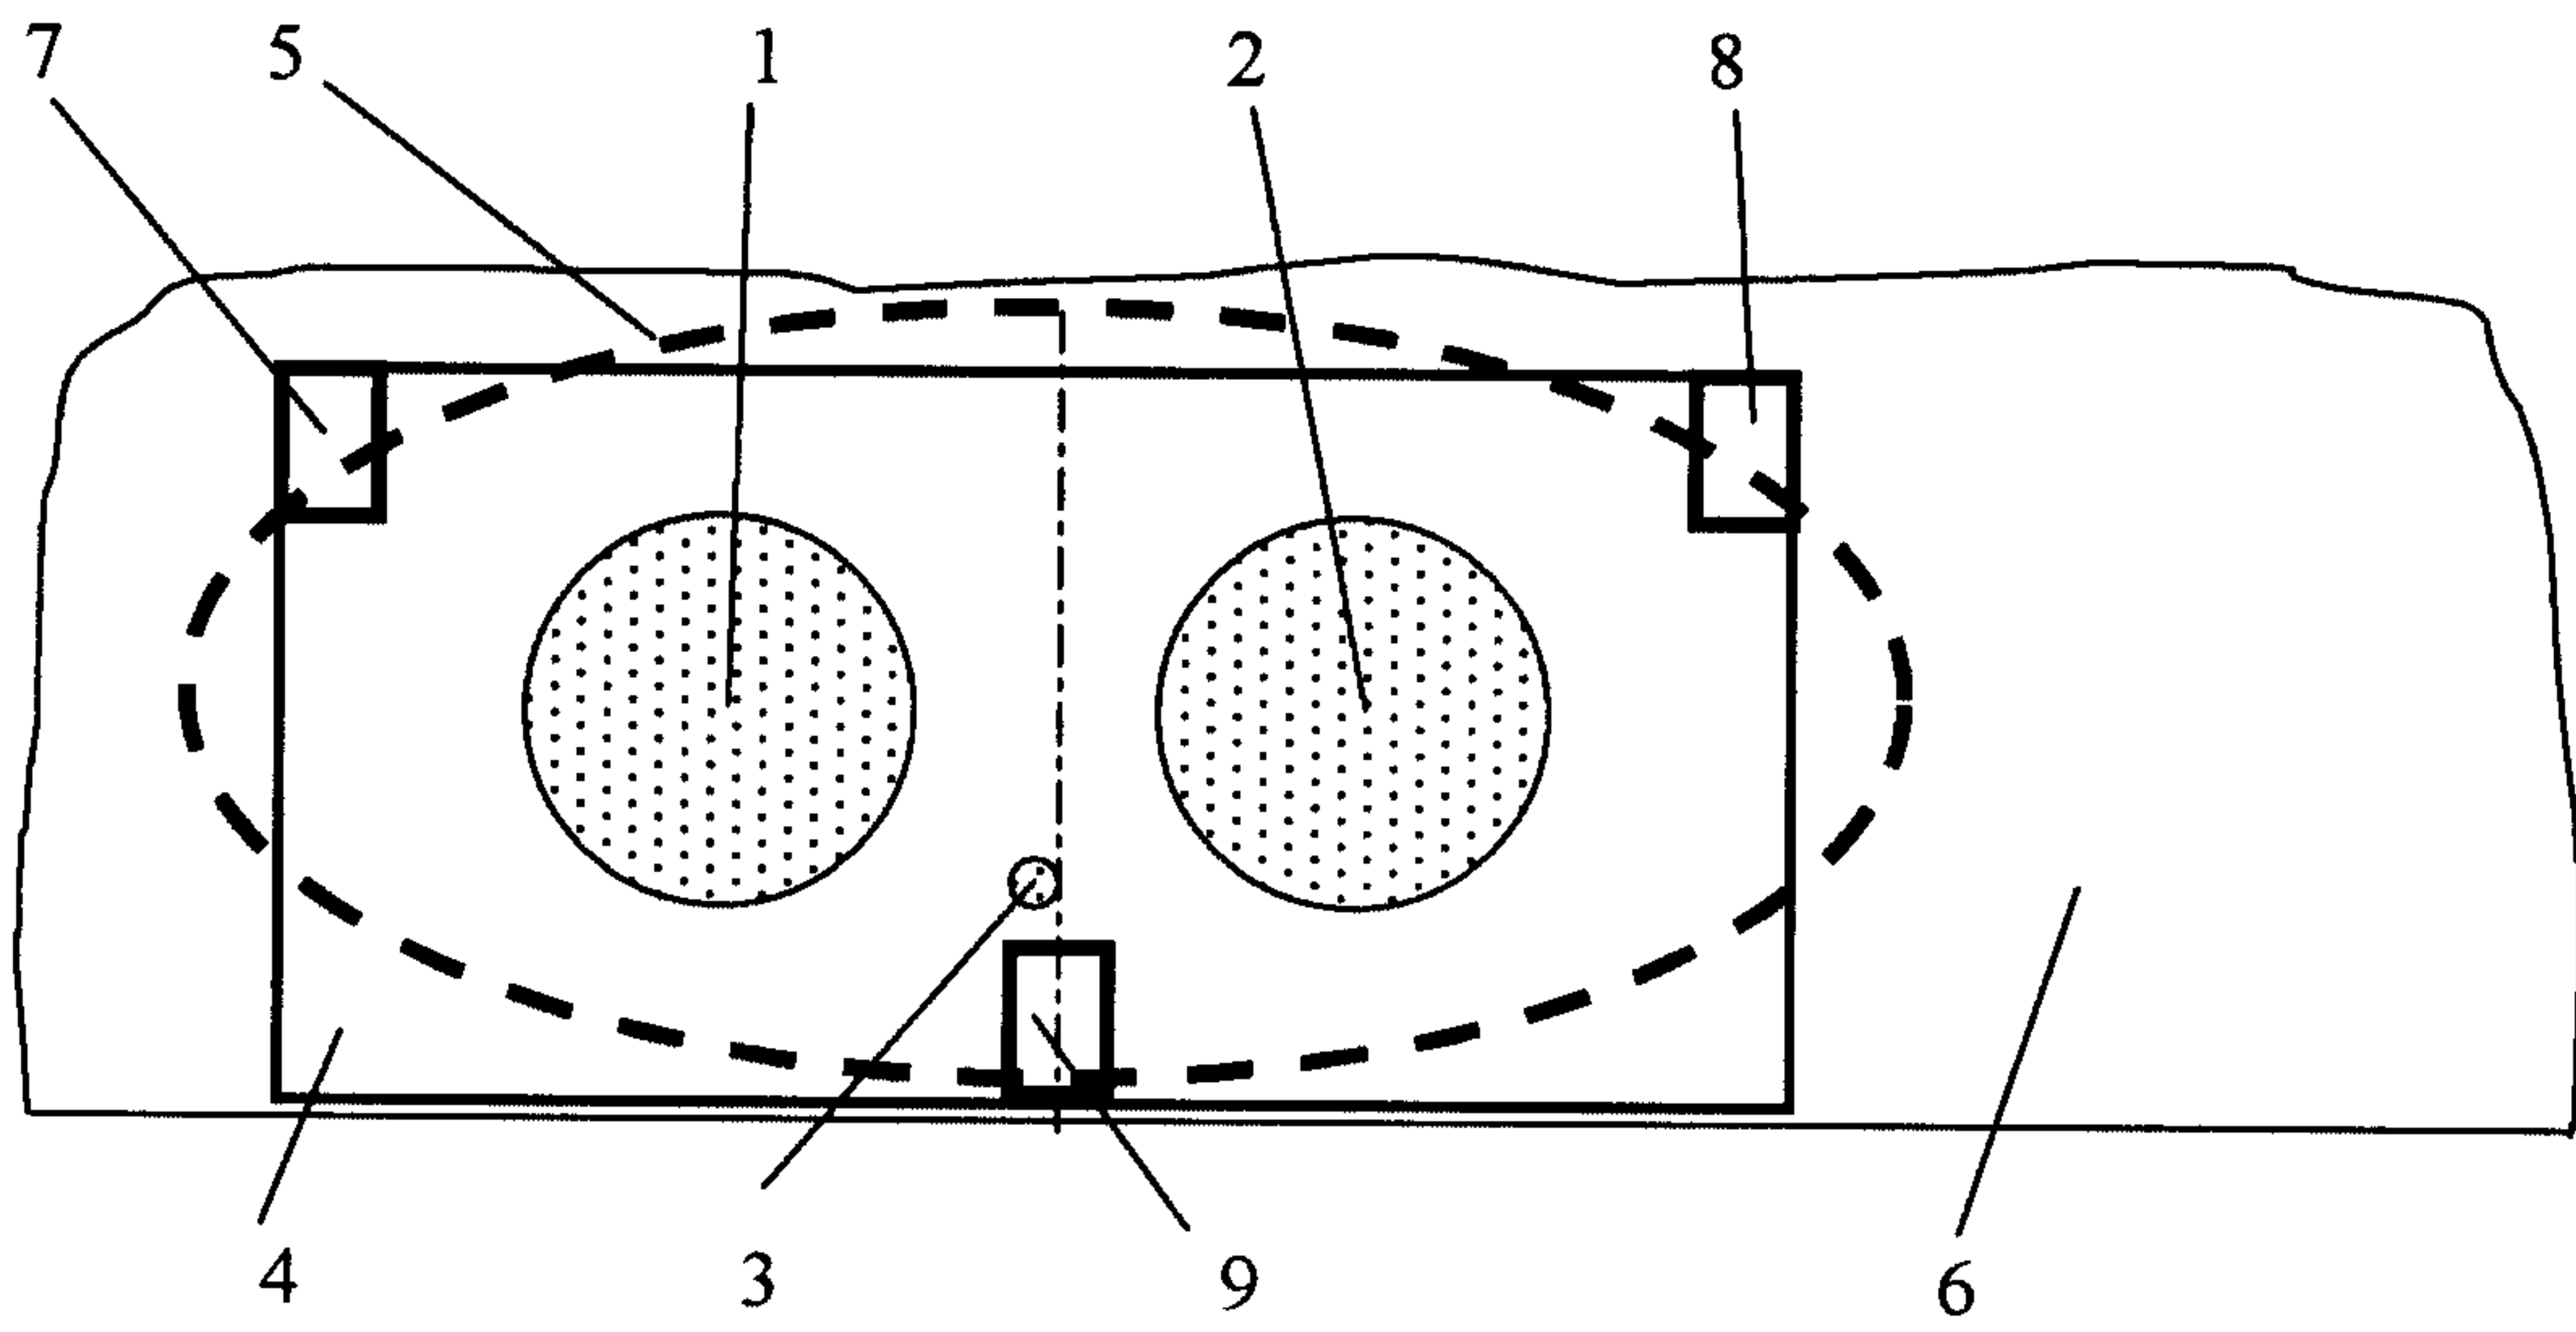


Figure 1

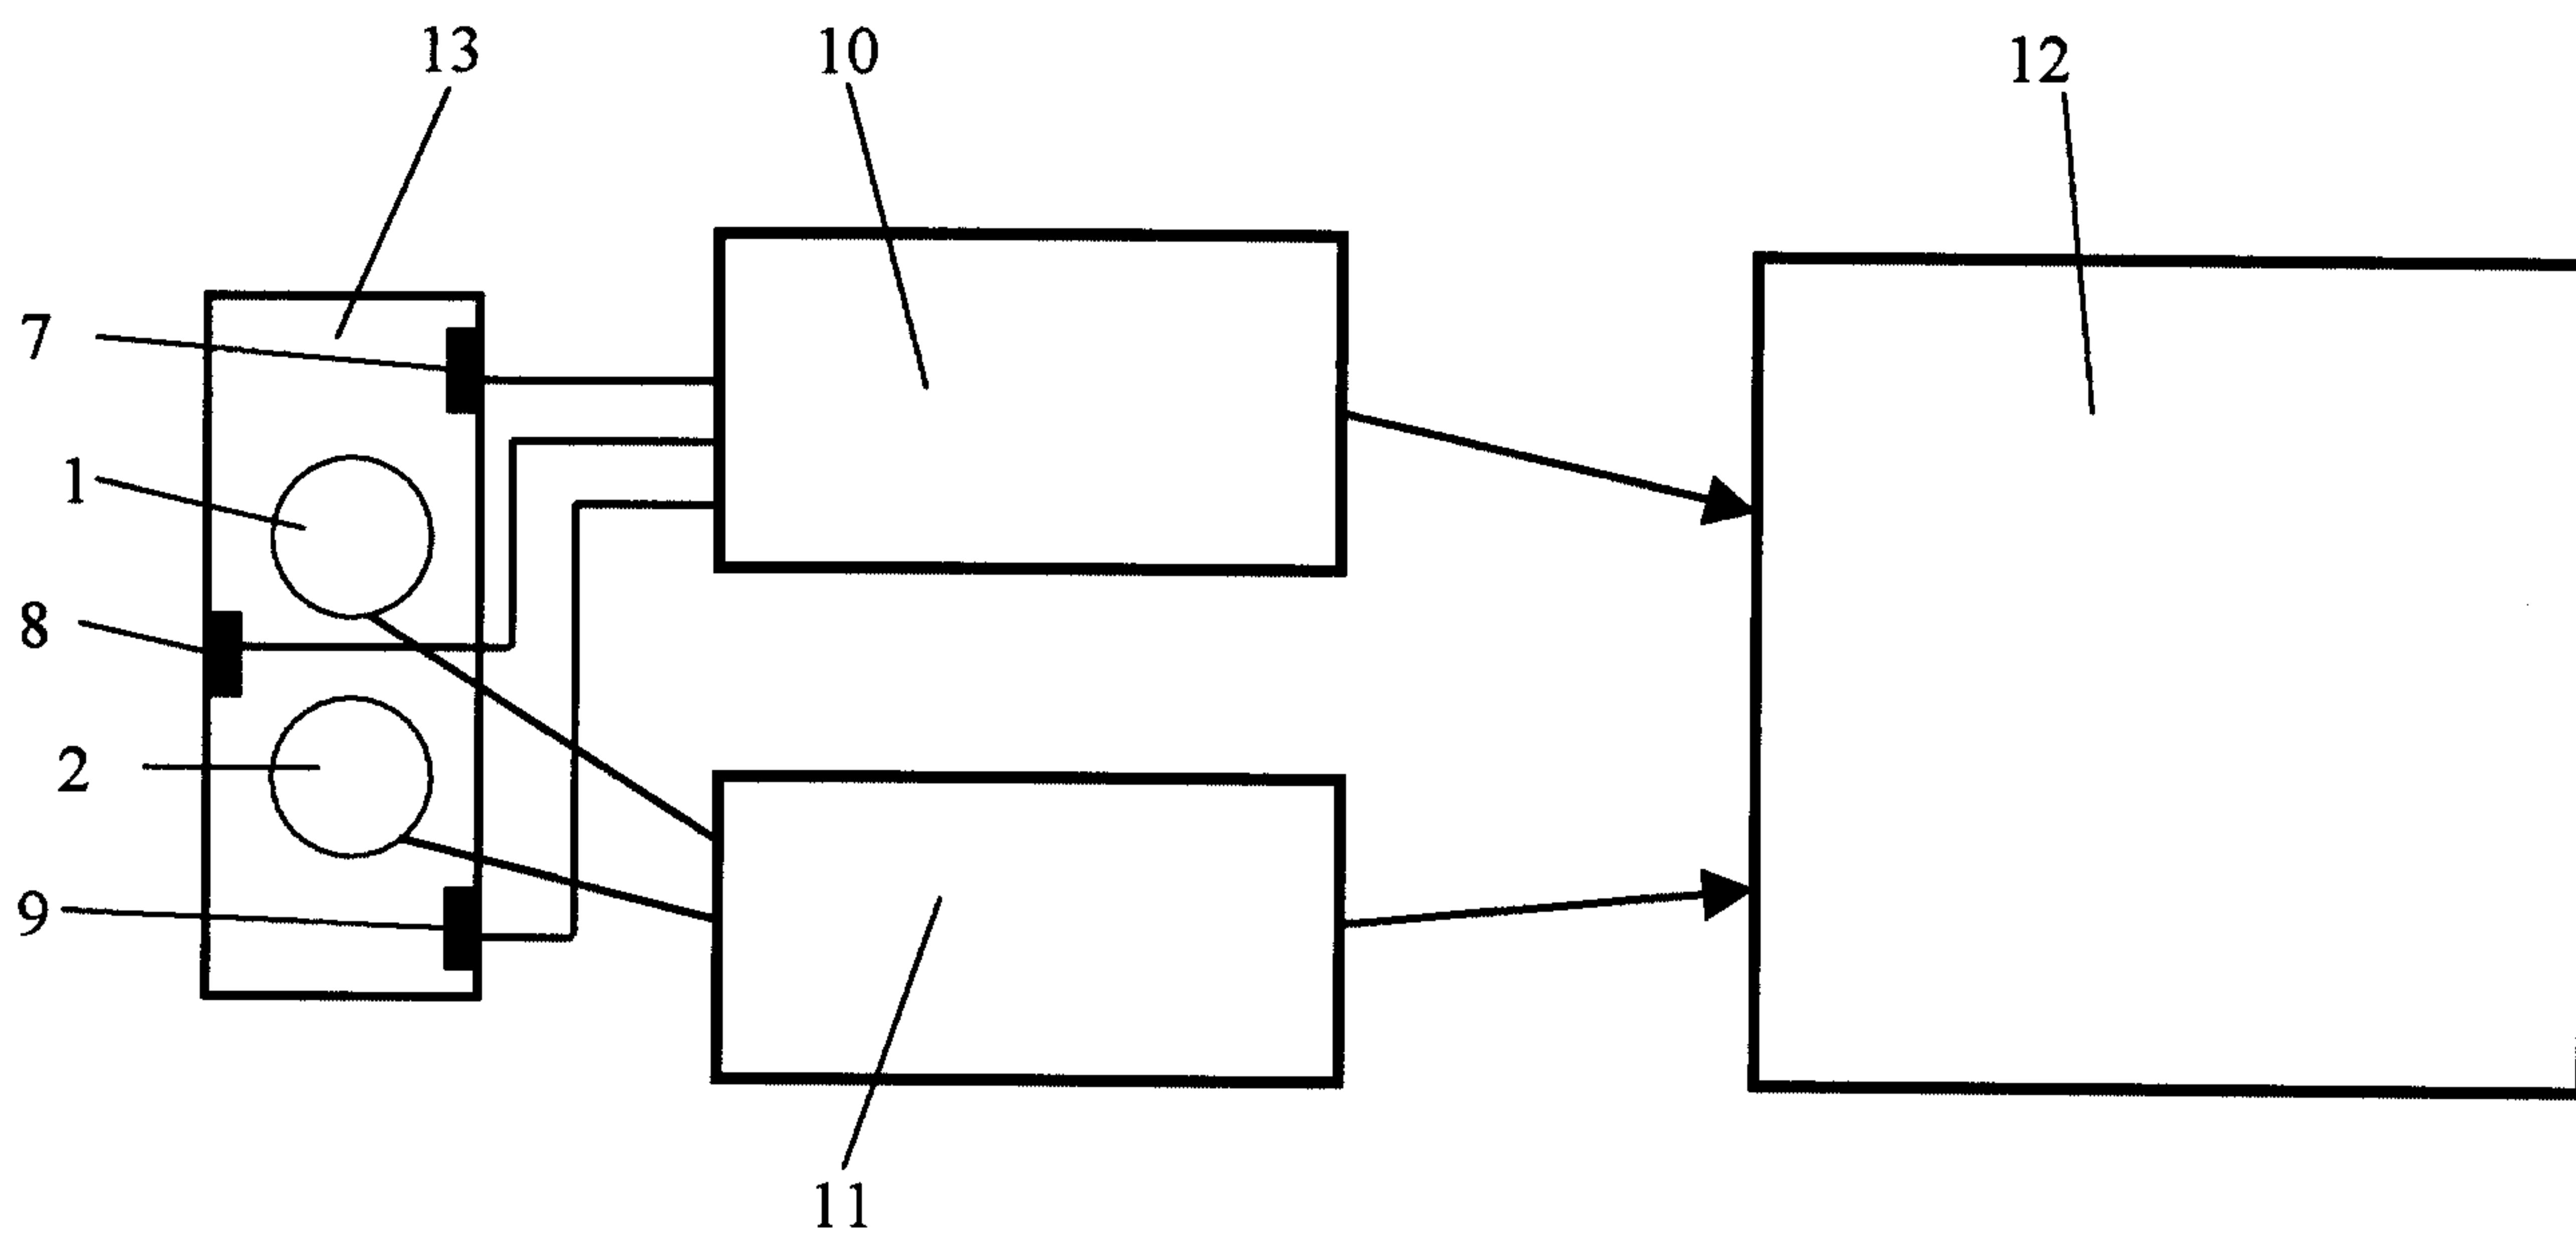


Figure 2

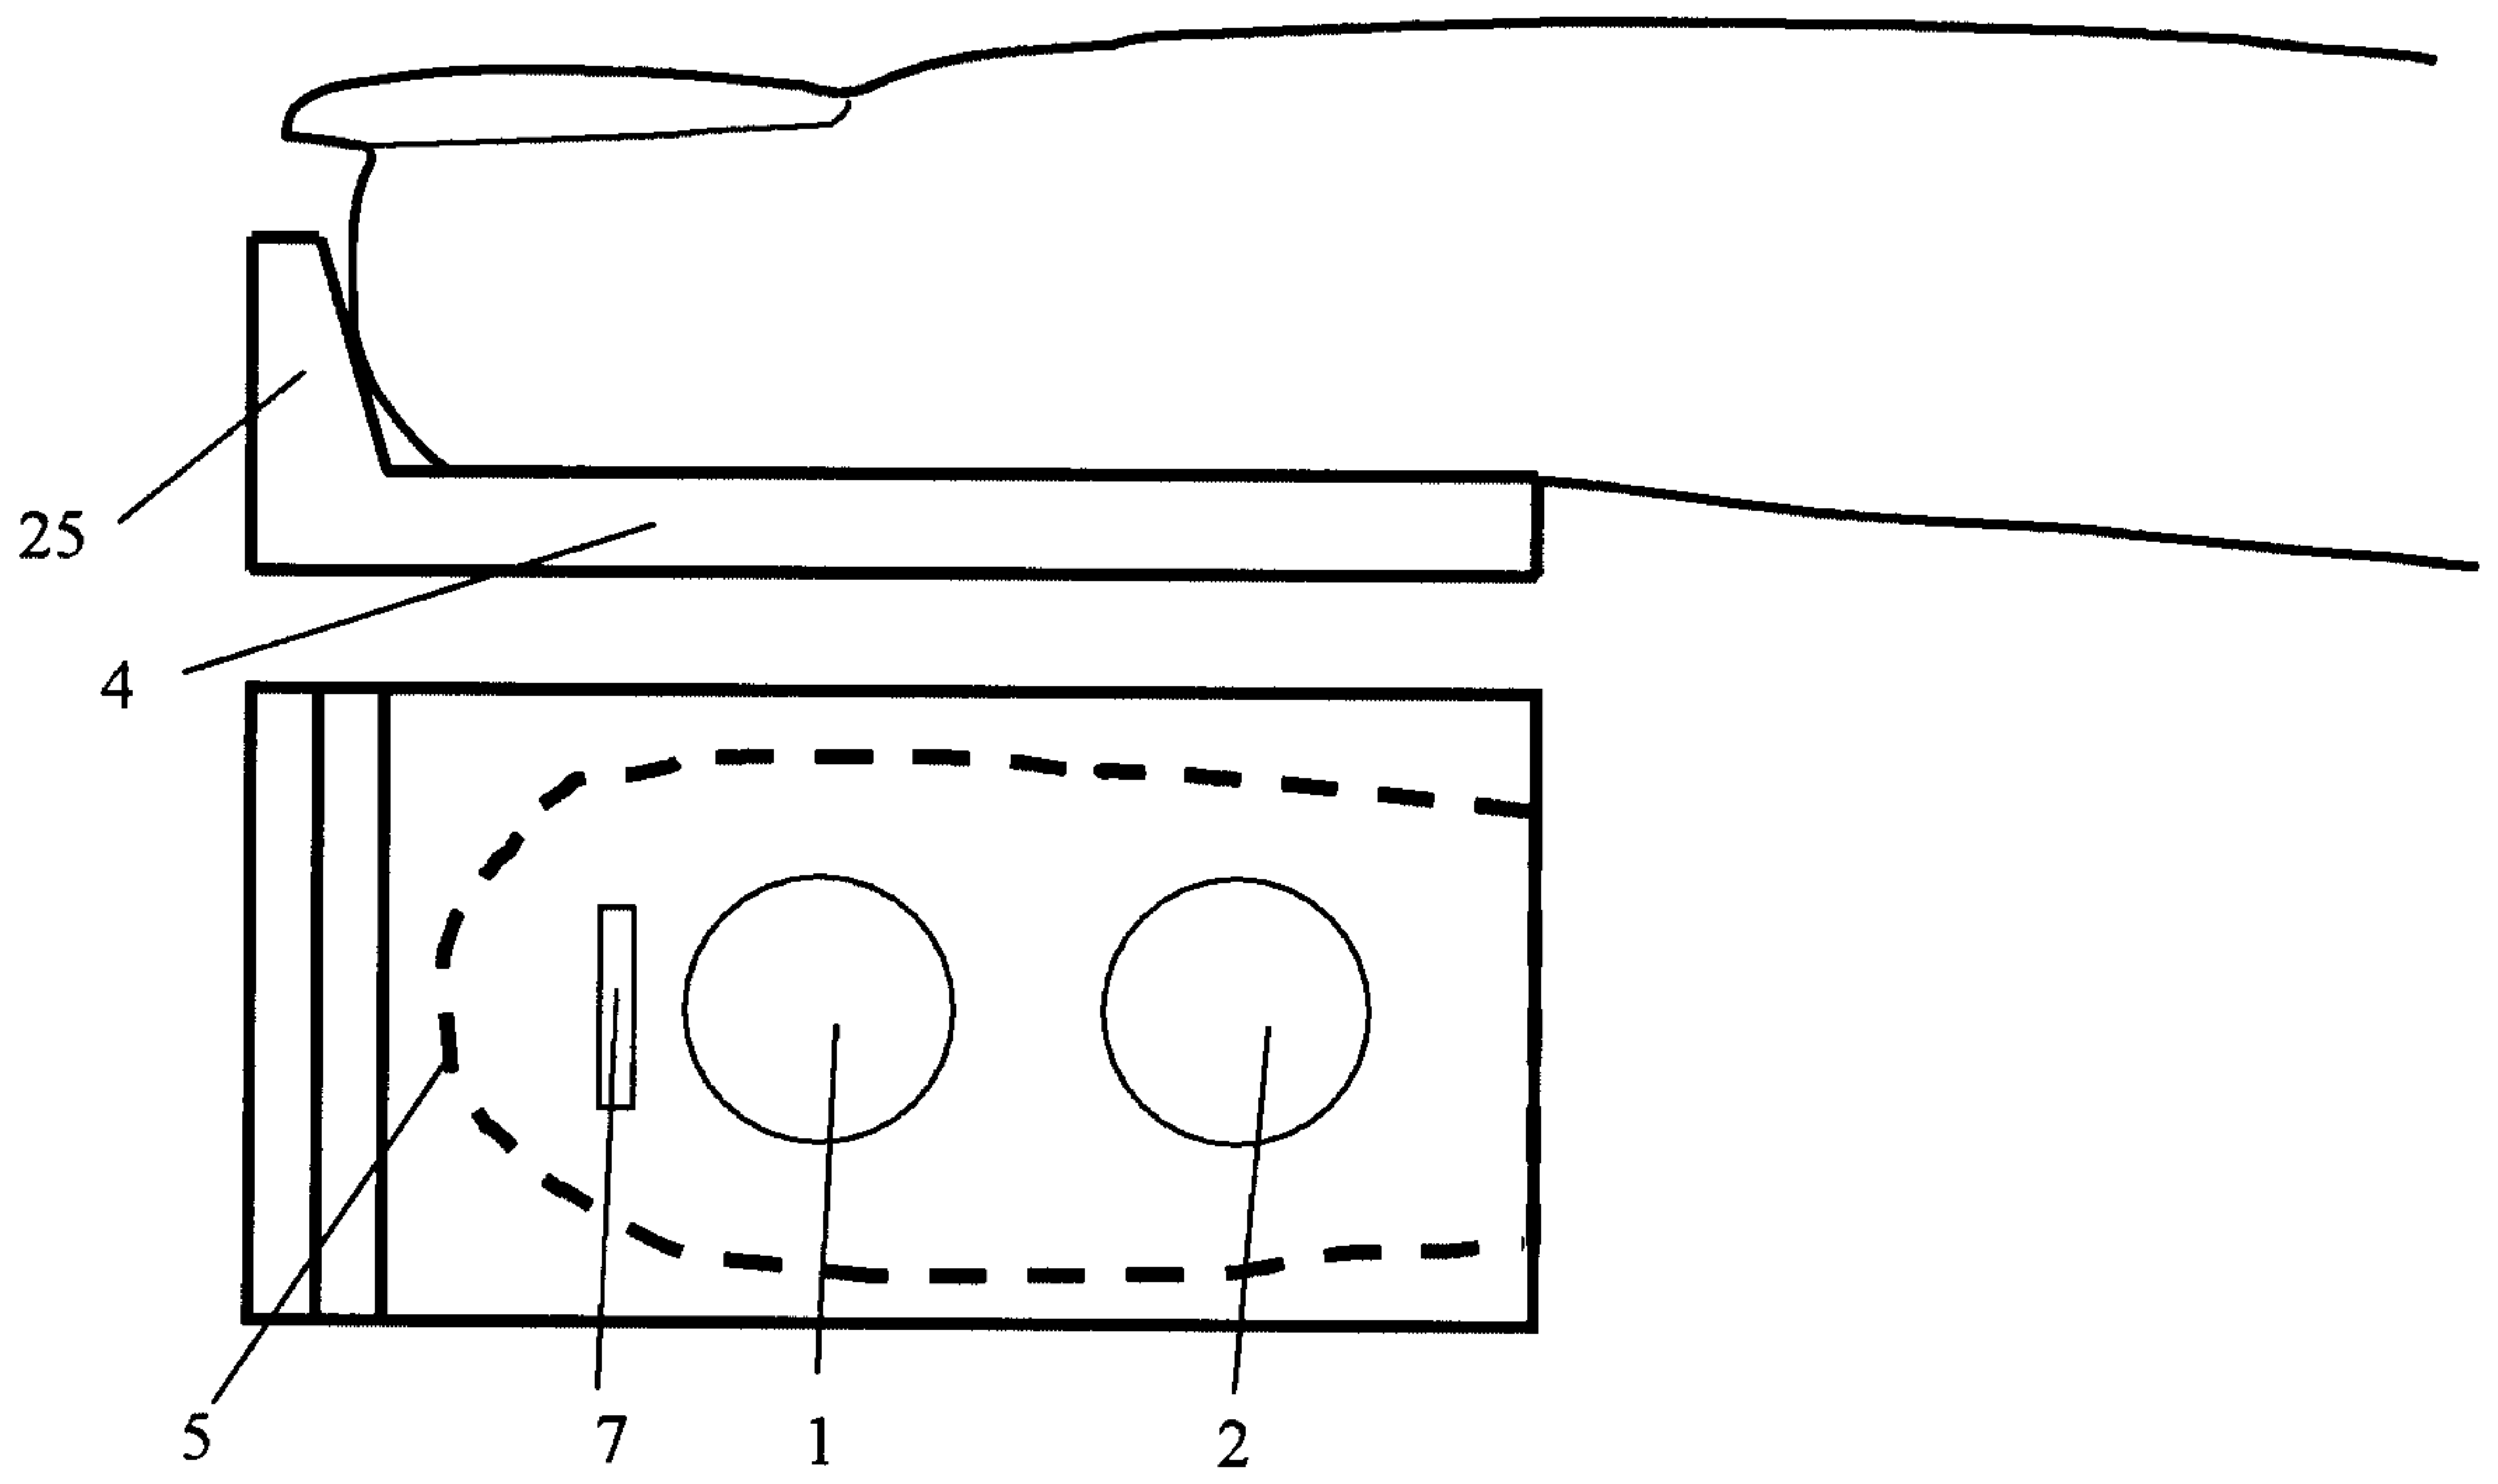


Figure 3

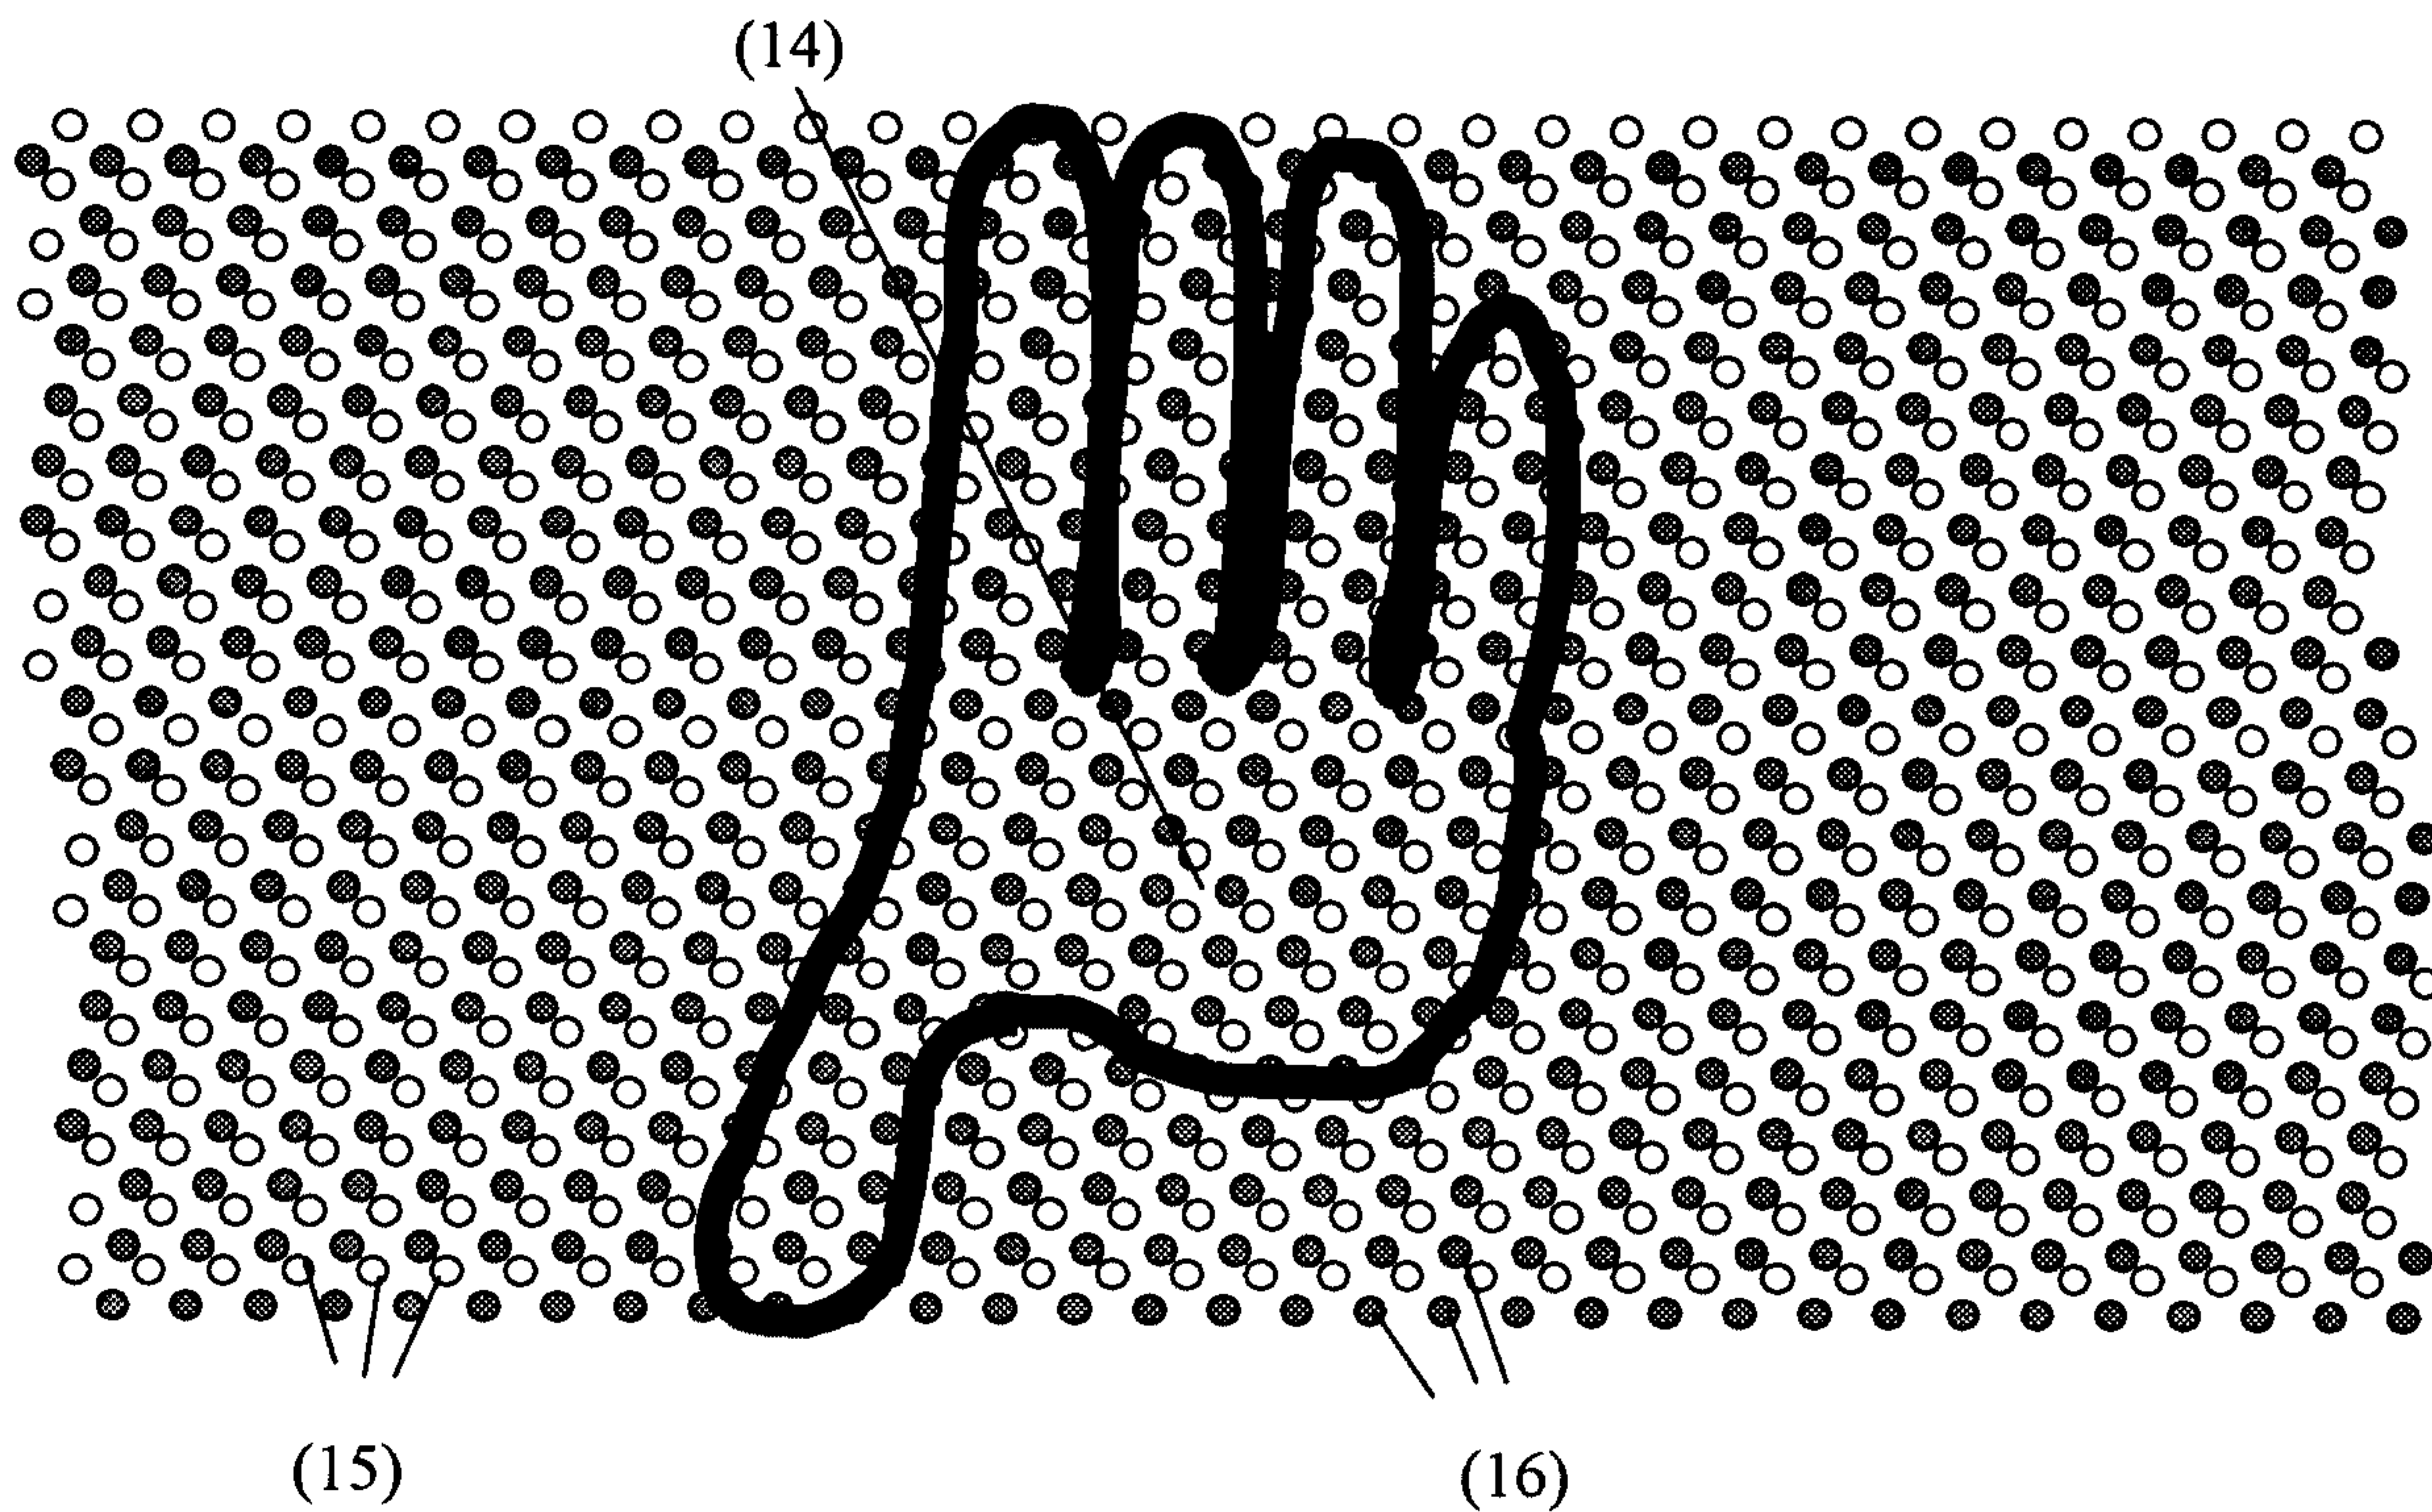


Figure 4

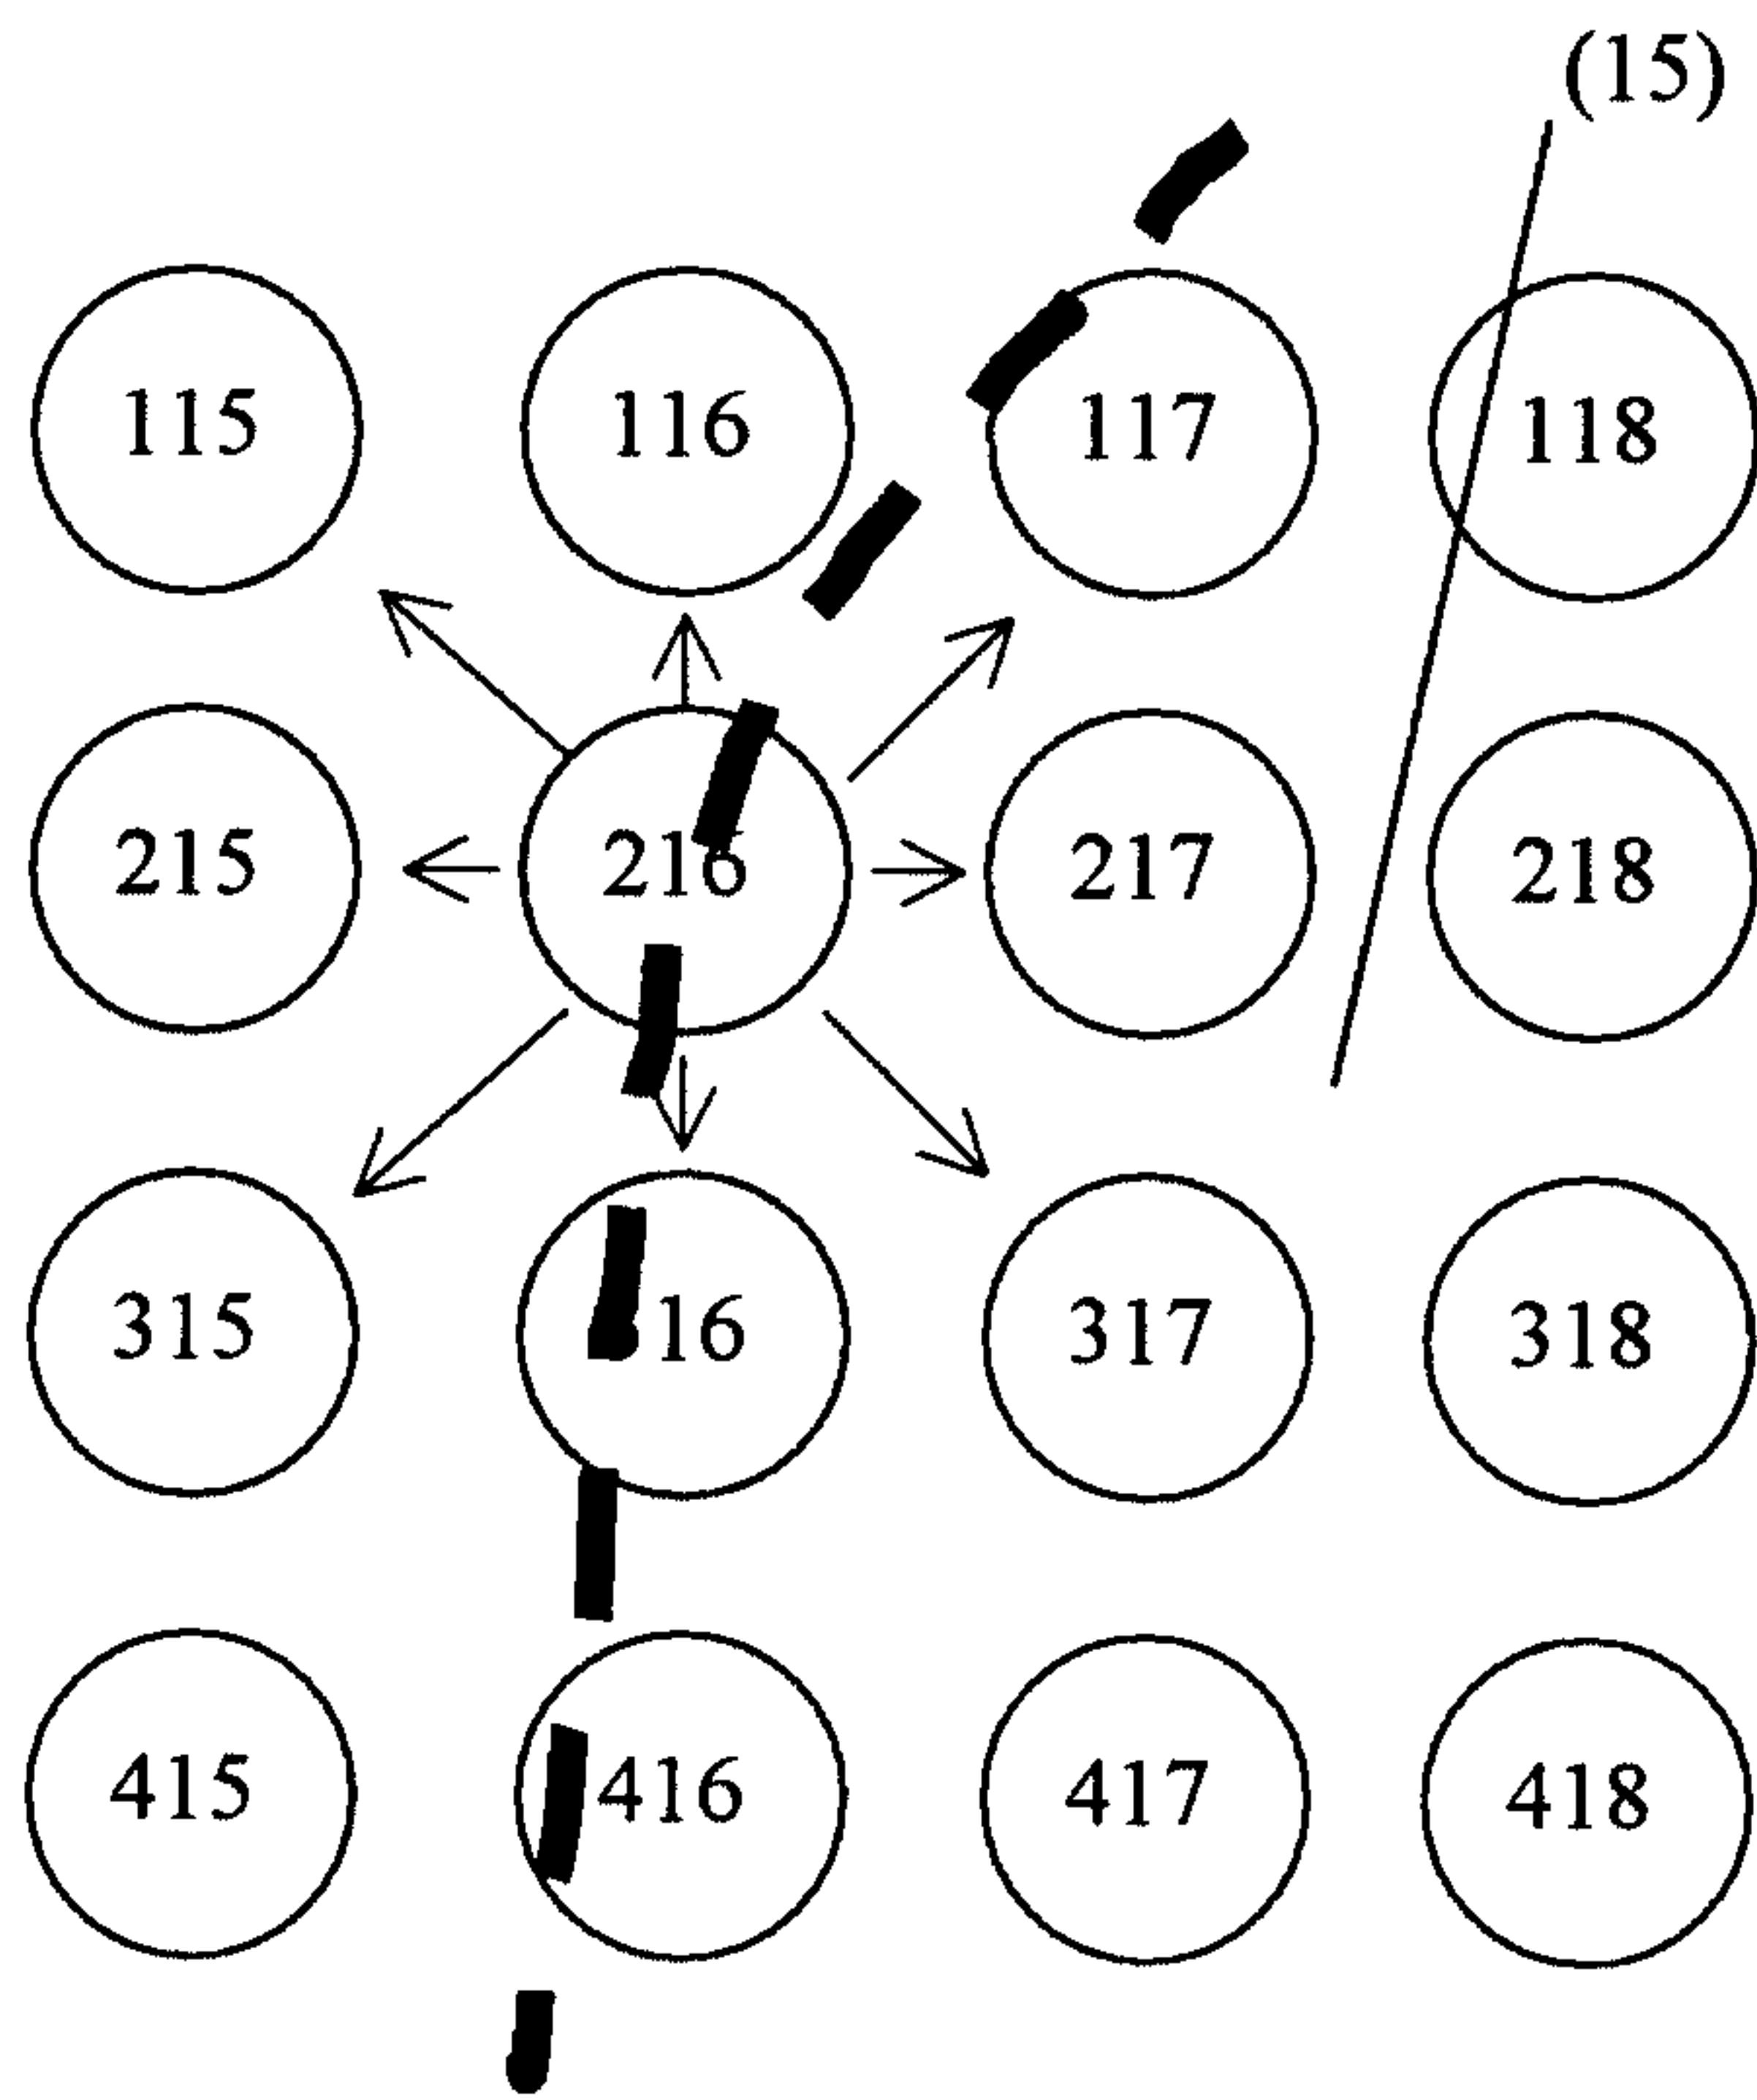


Figure 5a

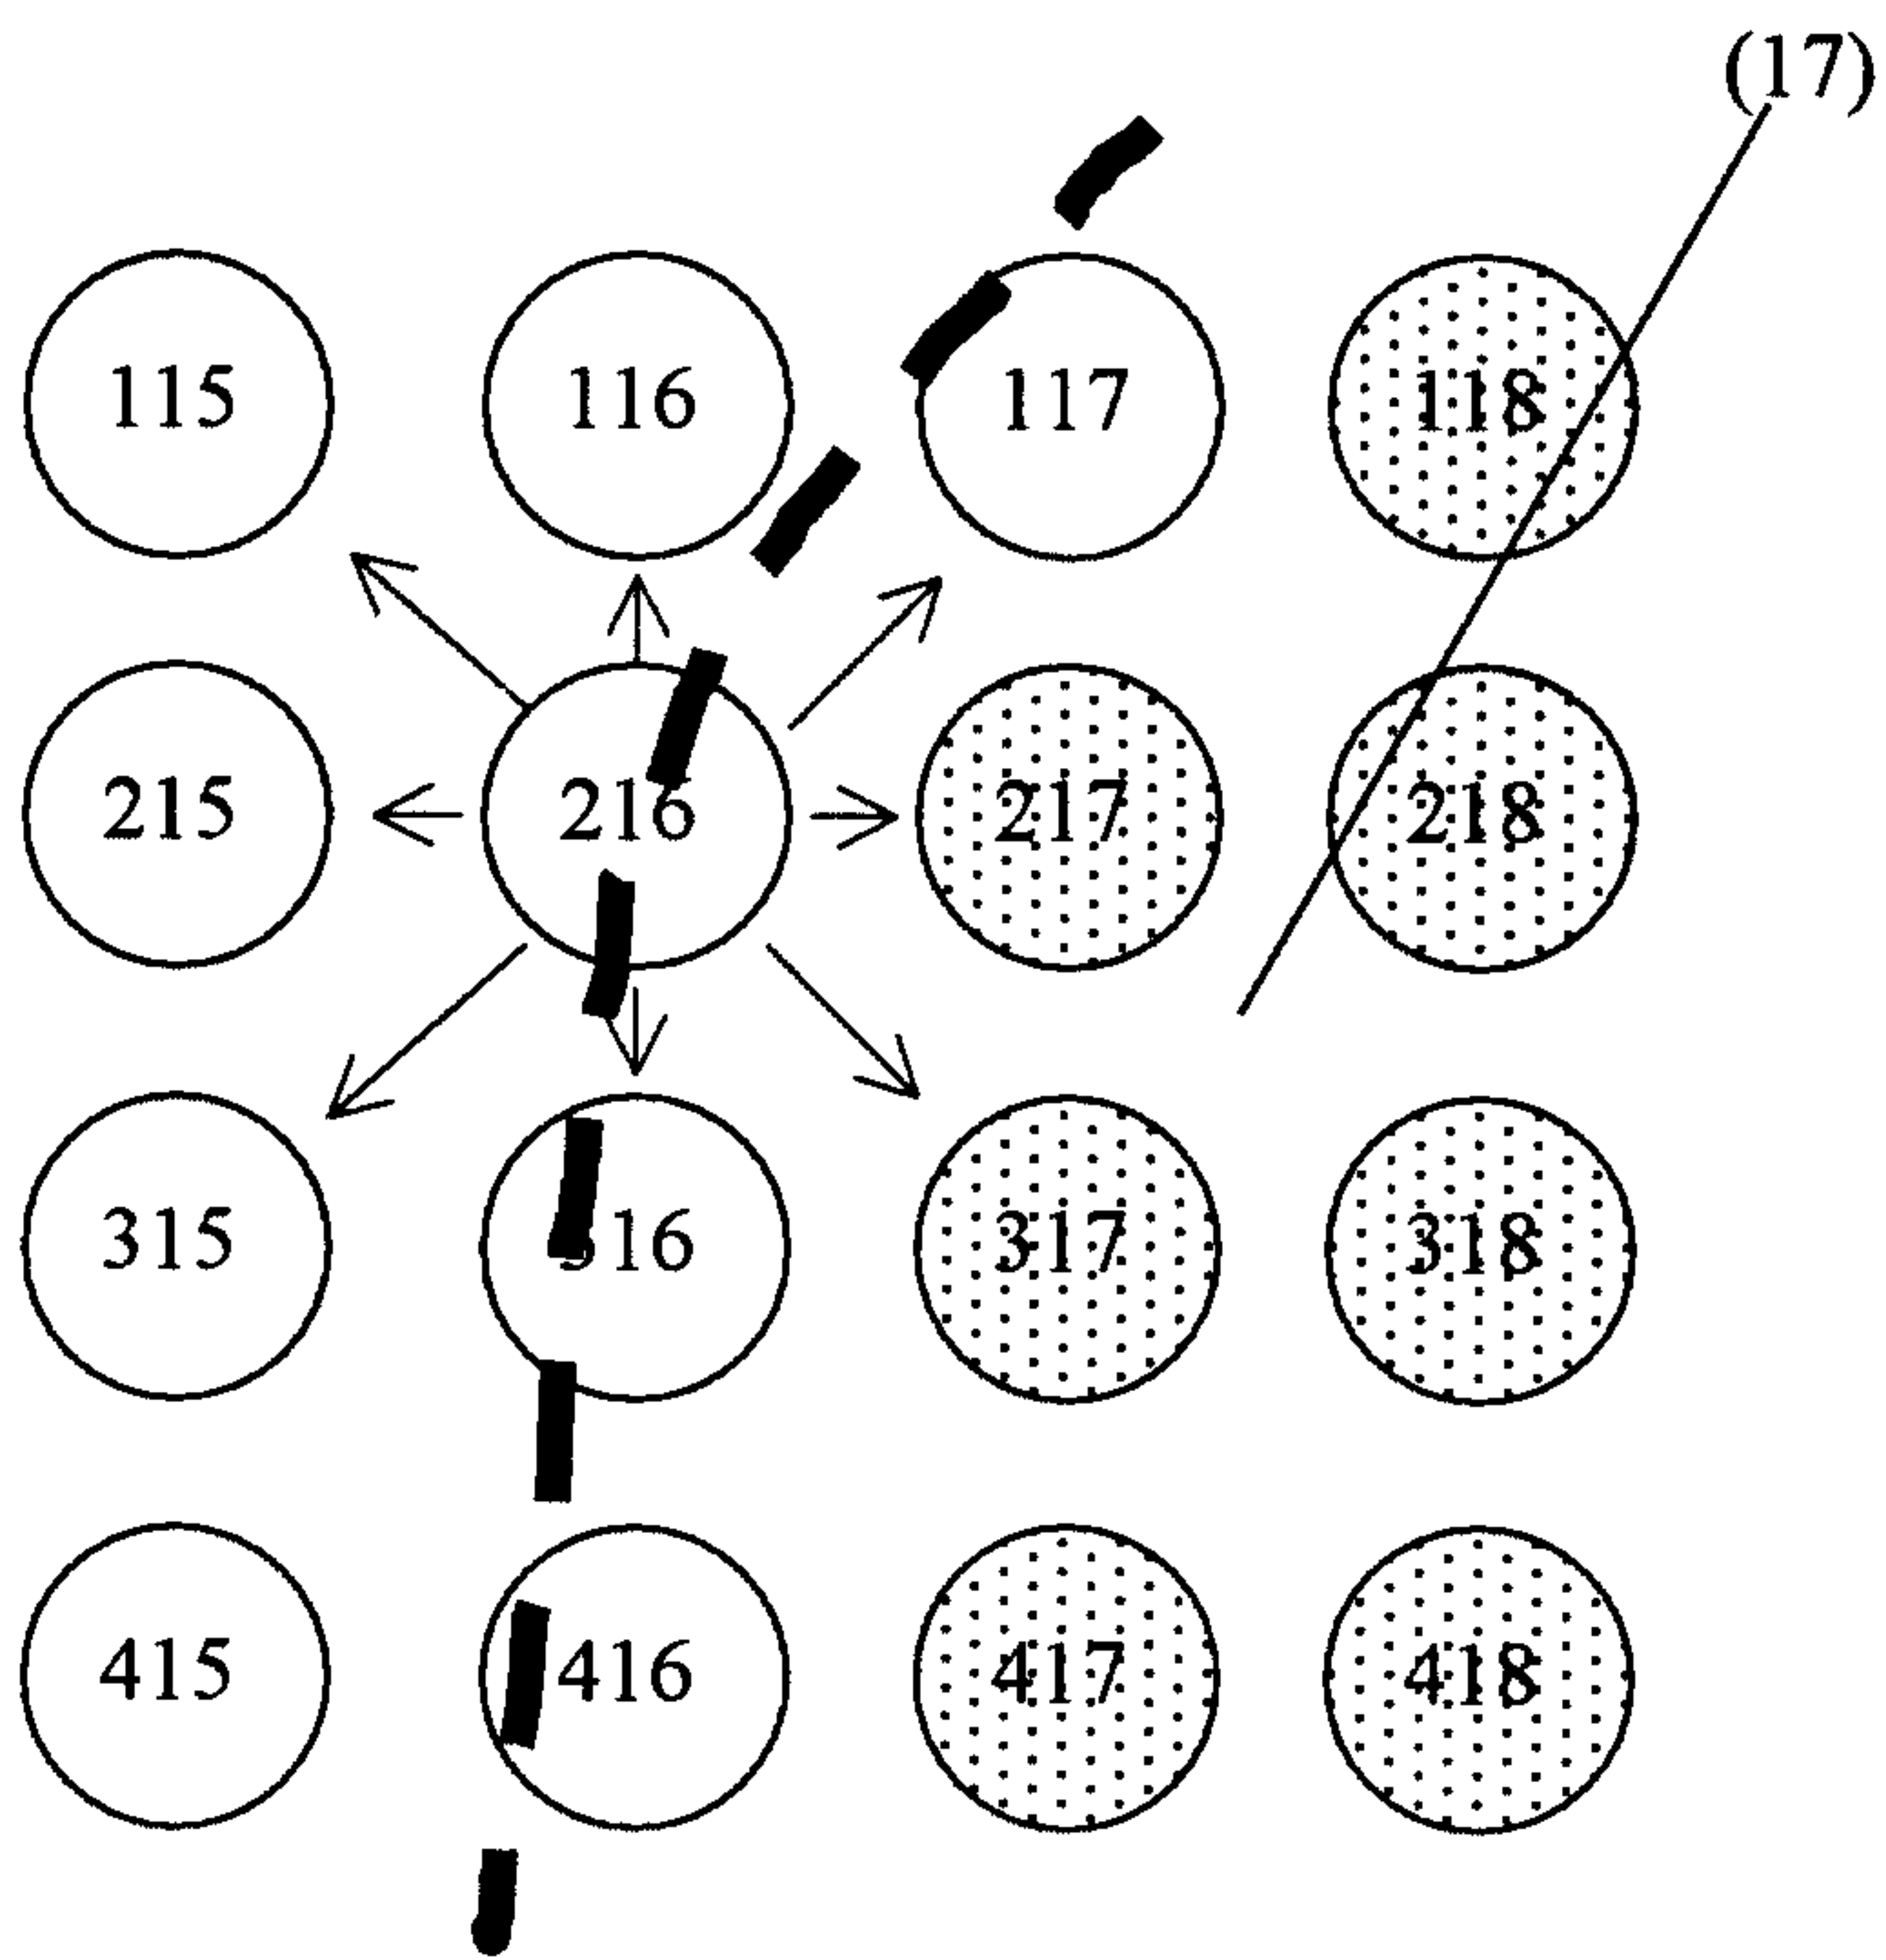


Figure 5b

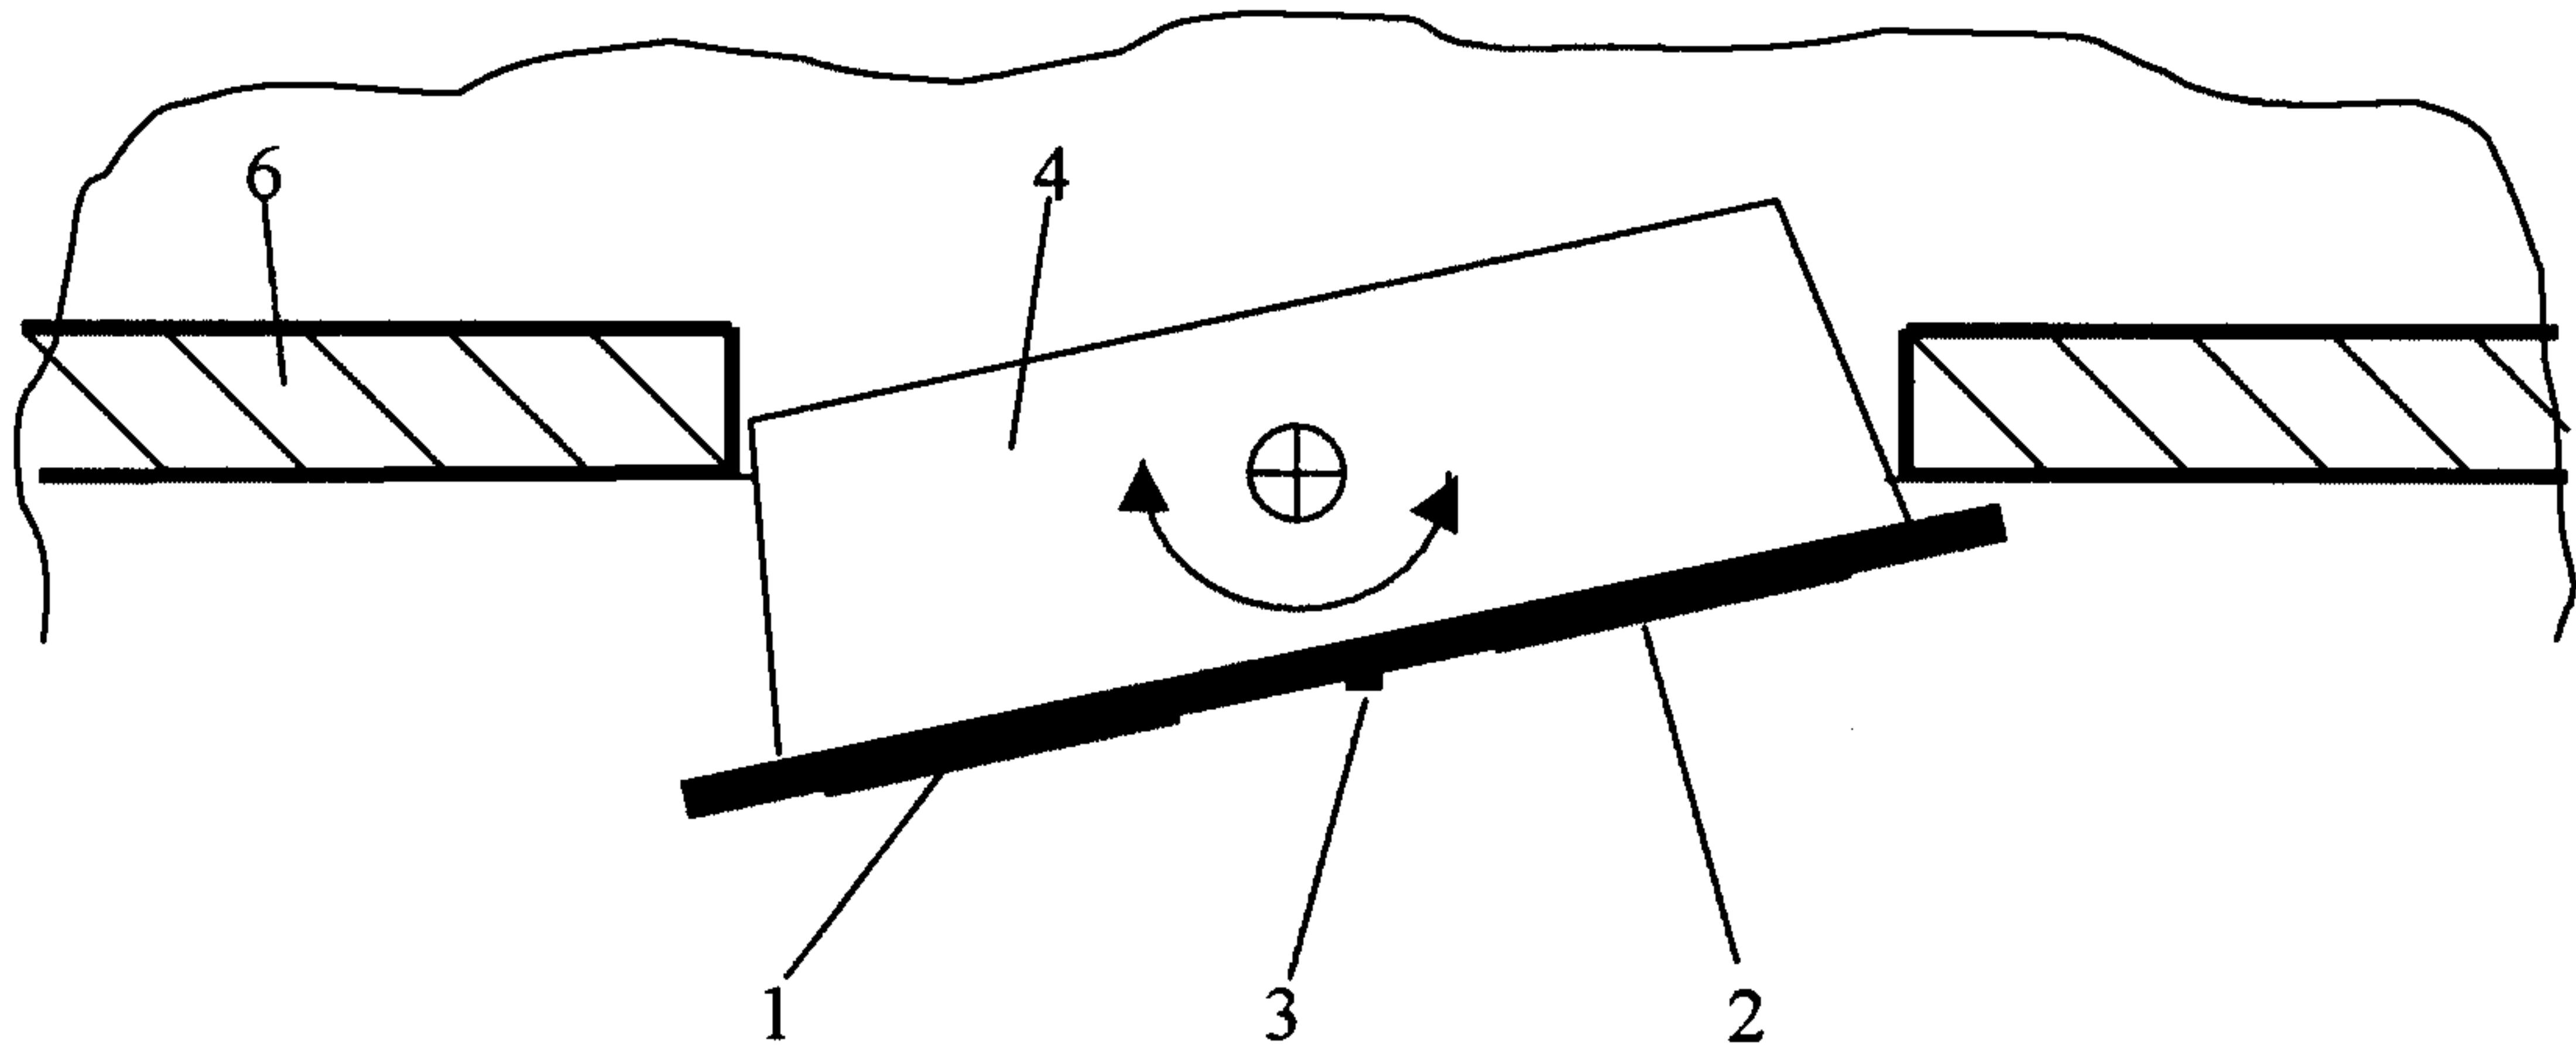


Figure 6

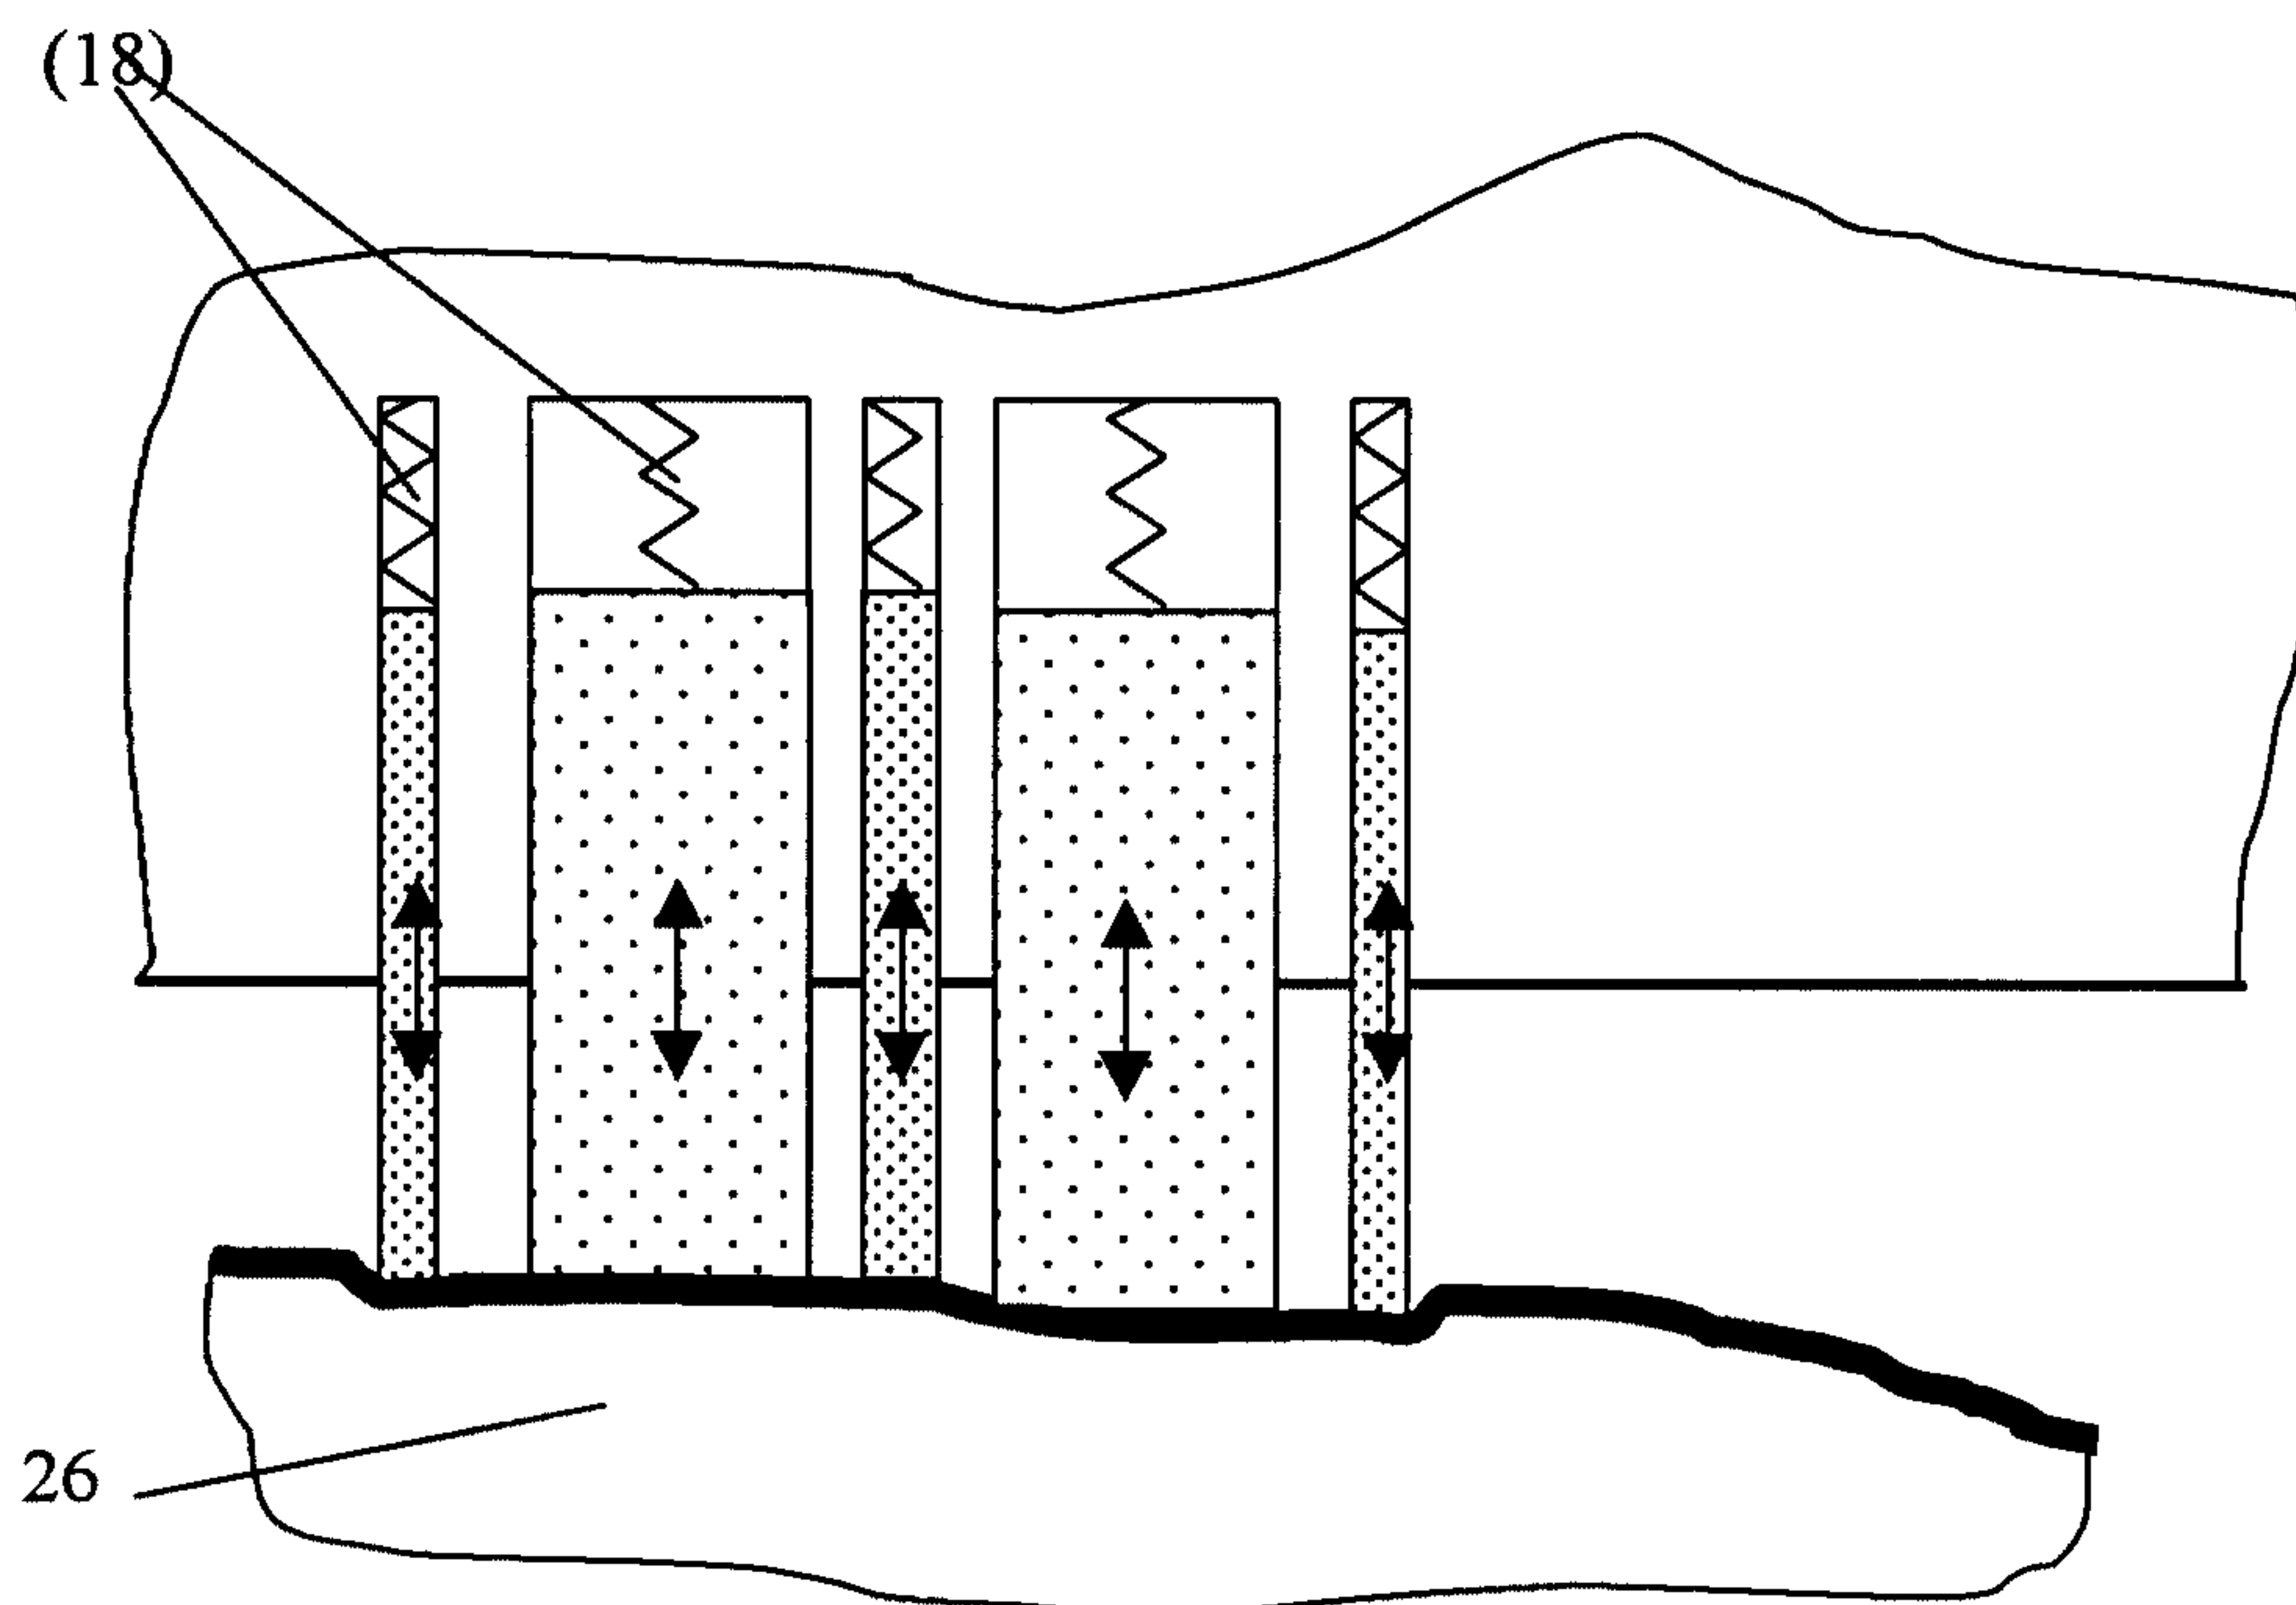


Figure 7

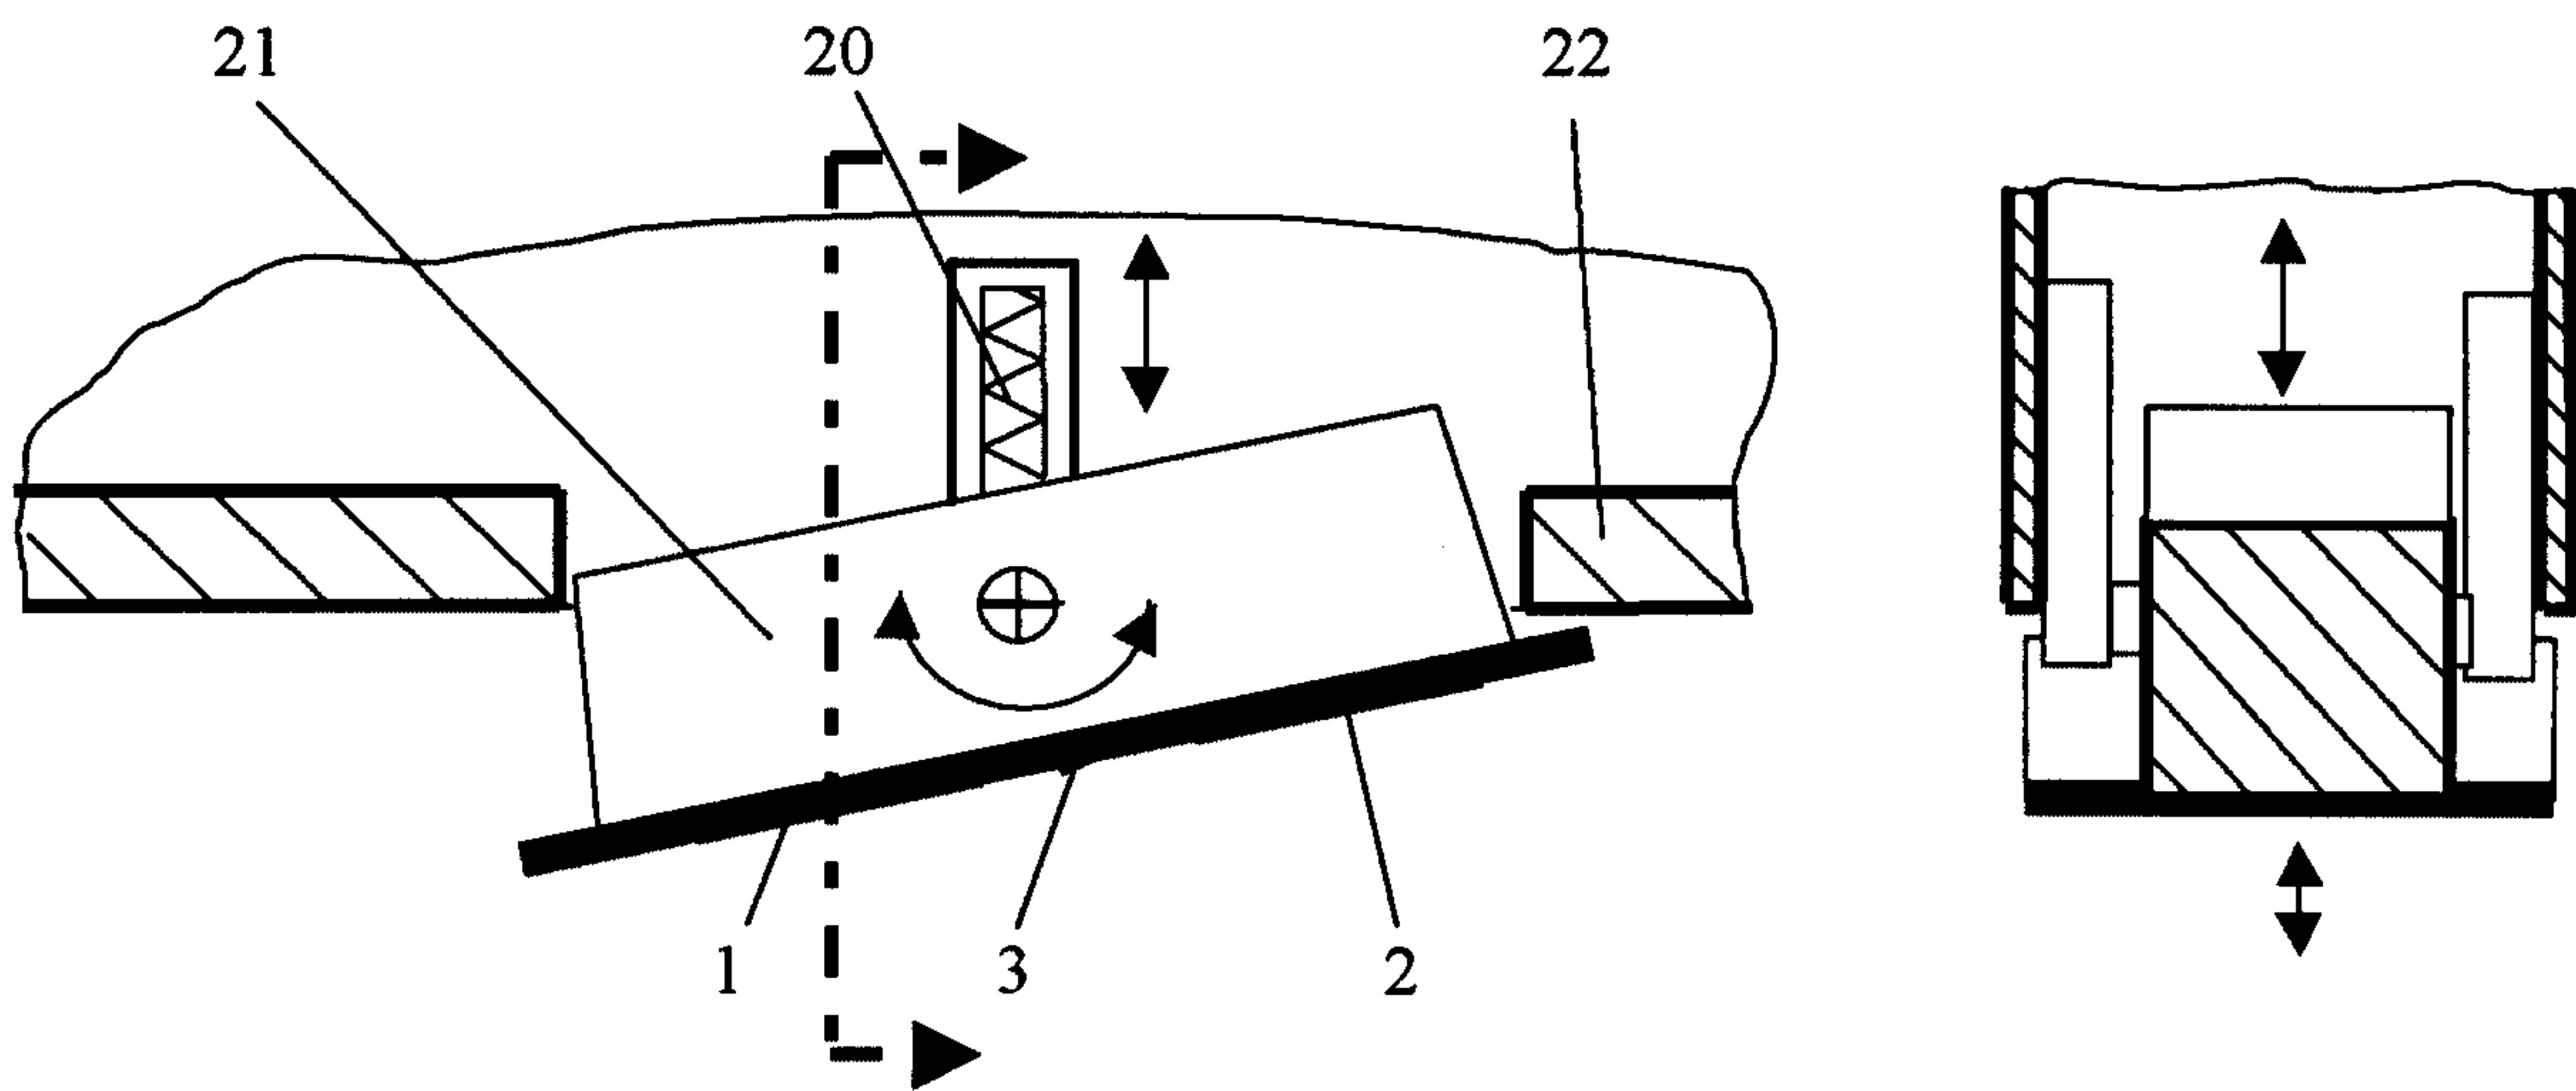


Figure 8

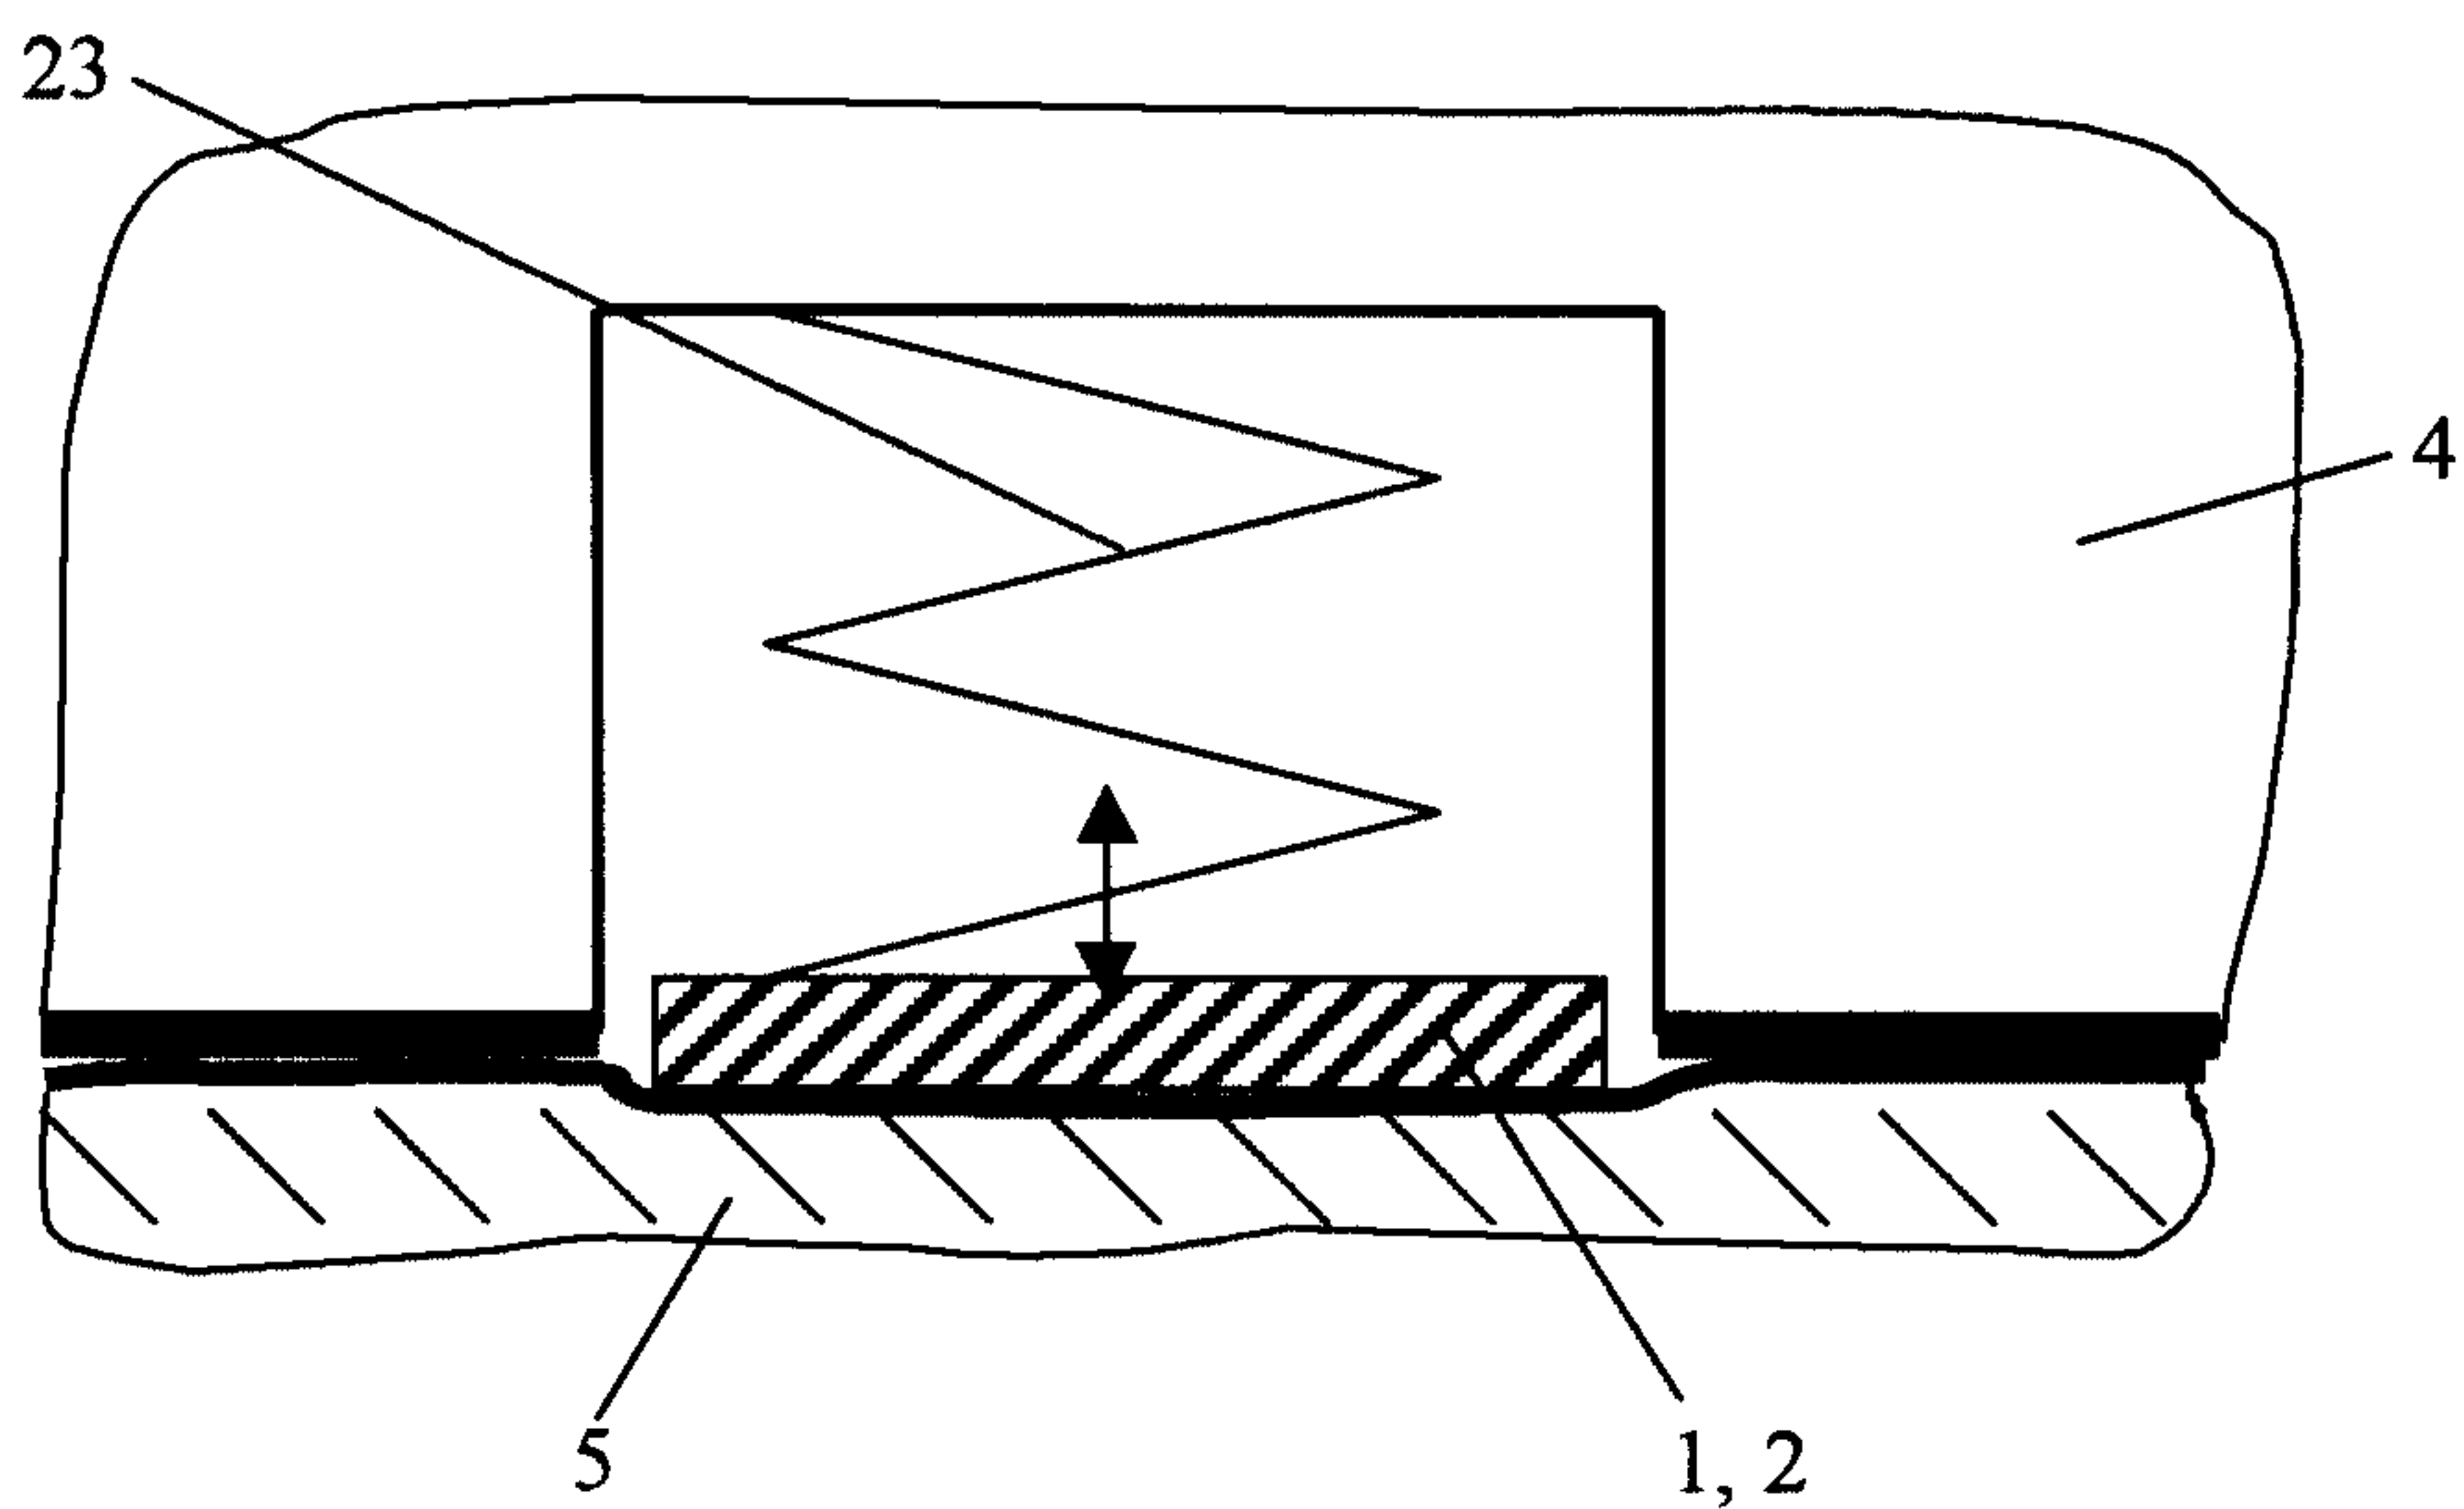


Figure 9

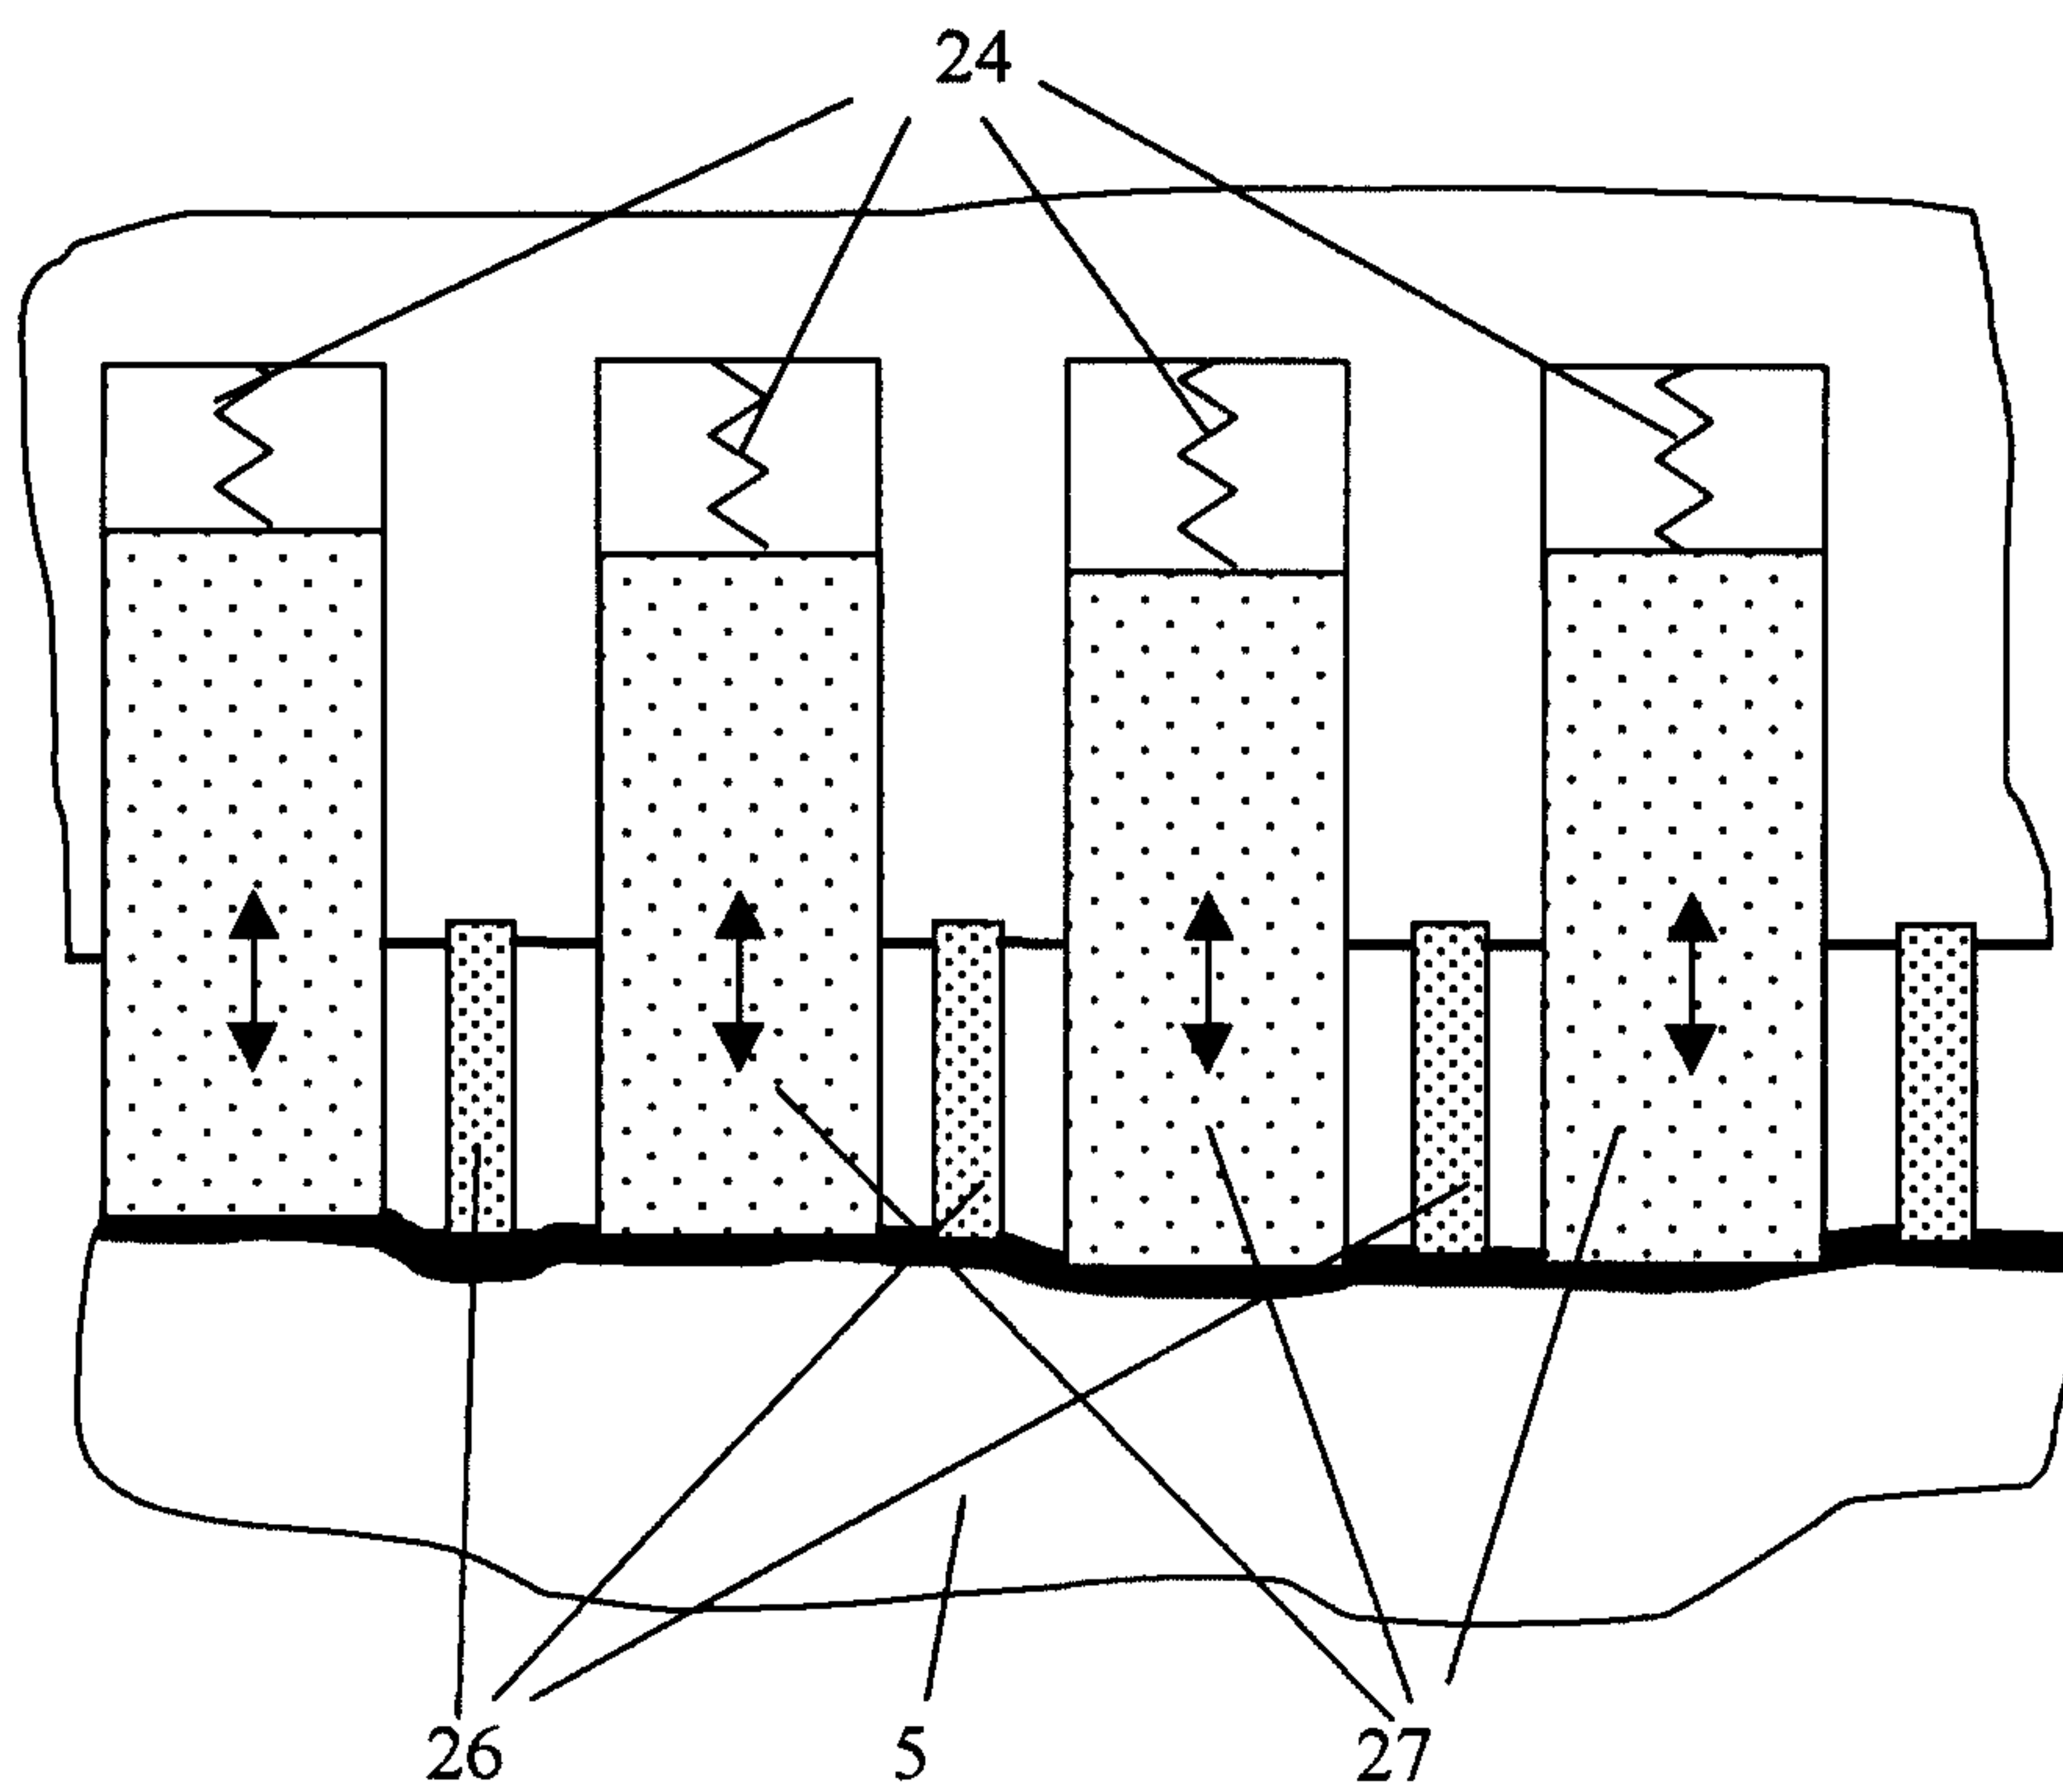


Figure 10

