



US 20230095591A1

(19) **United States**(12) **Patent Application Publication**
MCGRAW et al.(10) **Pub. No.: US 2023/0095591 A1**(43) **Pub. Date: Mar. 30, 2023**(54) **METHOD AND APPARATUS OF HOT TAPPING MULTIPLE COAXIAL OR NESTED STRINGS OF UNDERWATER PIPING AND/OR TUBING FOR OVERTURNED WELLS OR PLATFORMS**(71) Applicant: **AES-EOT EQUIPMENT HOLDINGS, LLC**, Larose, LA (US)(72) Inventors: **Harry MCGRAW**, Broussard, LA (US); **Leslie M. BLAND**, Metairie, LA (US); **Daniel S. BANGERT**, Broussard, LA (US); **Mark F. GRAVOUIA**, Youngsville, LA (US); **Rizal MASINGKAN**, New Iberia, LA (US)(21) Appl. No.: **17/967,987**(22) Filed: **Oct. 18, 2022****Related U.S. Application Data**

(63) Continuation of application No. 17/106,369, filed on Nov. 30, 2020, now Pat. No. 11,473,384, which is a continuation of application No. 16/377,431, filed on Apr. 8, 2019, now Pat. No. 10,851,605, which is a continuation of application No. 15/853,613, filed on Dec. 22, 2017, now Pat. No. 10,253,587, which is a continuation of application No. 14/950,908, filed on Nov. 24, 2015, now Pat. No. 9,851,038, which is a continuation of application No. 14/263,088, filed on Apr. 28, 2014, now Pat. No. 9,194,525, which is a continuation of application No. 13/717,890, filed on Dec. 18, 2012, now Pat. No. 8,707,979, which is a continuation of application No. 13/248,781, filed on Sep. 29, 2011, now Pat. No. 8,333,211, which is a continuation of application No. PCT/US2010/029389, filed on Mar. 31, 2010.


(60) Provisional application No. 61/165,475, filed on Mar. 31, 2009.

Publication Classification(51) **Int. Cl.****E21B 29/12** (2006.01)**E21B 17/01** (2006.01)**E21B 29/10** (2006.01)**B23B 41/00** (2006.01)**F16L 41/06** (2006.01)**B23B 47/28** (2006.01)**E02B 17/00** (2006.01)(52) **U.S. Cl.**CPC **E21B 29/12** (2013.01); **E21B 17/01**(2013.01); **E21B 29/10** (2013.01); **B23B****41/006** (2013.01); **F16L 41/06** (2013.01);**B23B 47/281** (2013.01); **B23B 41/003**(2013.01); **E02B 2017/0052** (2013.01); **Y10T****137/6123** (2015.04); **Y10T 408/56275**(2015.01); **Y10T 408/563** (2015.01); **Y10T****137/8359** (2015.04); **B23B 2270/08** (2013.01);**Y10T 408/5612** (2015.01); **Y10T 137/0463**(2015.04); **B23B 2215/72** (2013.01); **Y10T****137/0458** (2015.04); **Y10T 137/0469**(2015.04); **Y10T 137/612** (2015.04); **Y10T****408/567** (2015.01); **B23B 2260/008** (2013.01)

(57)

ABSTRACT

A method and apparatus for tapping into a pressurized multiple strings of coaxially situated tubulars for wells and/or platforms which have overturned wherein the tapping occurs underwater via a diver or remotely operated vehicle. The assembly includes a tapping tool connectable to the tubular via a saddle connection and an adjustable tapping clamp with adjustable support/locking feet, compression plate with view ports, and angularly adjustable hot tapping system, along with a drill/saw system.

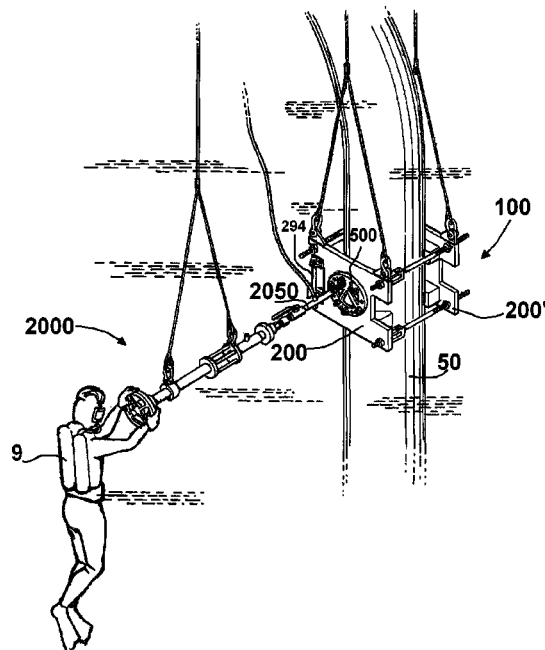

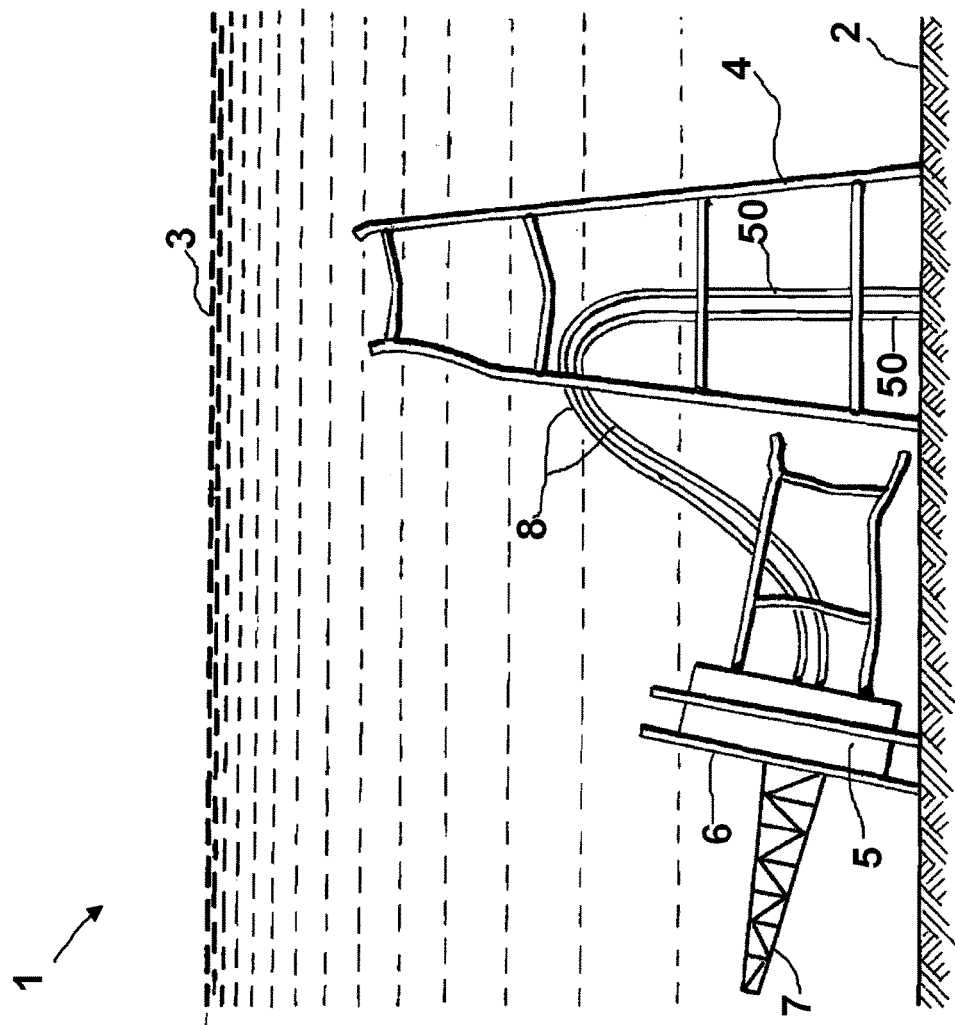


FIG. 1

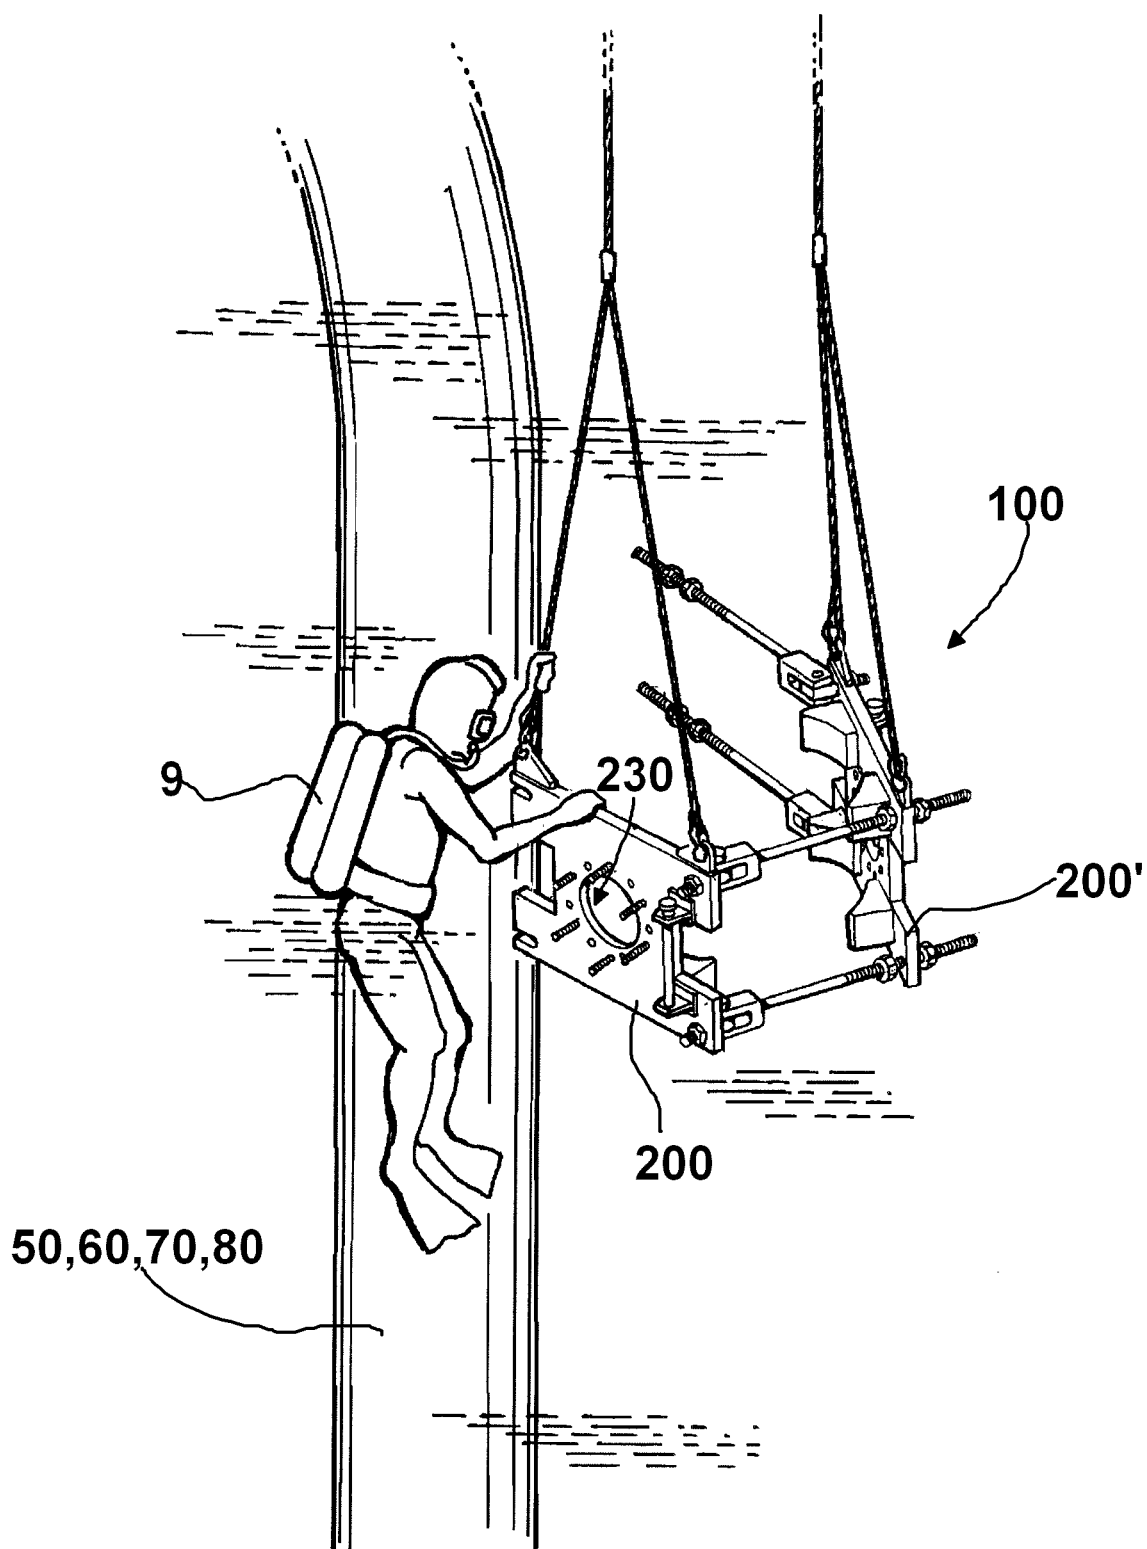


FIG. 2

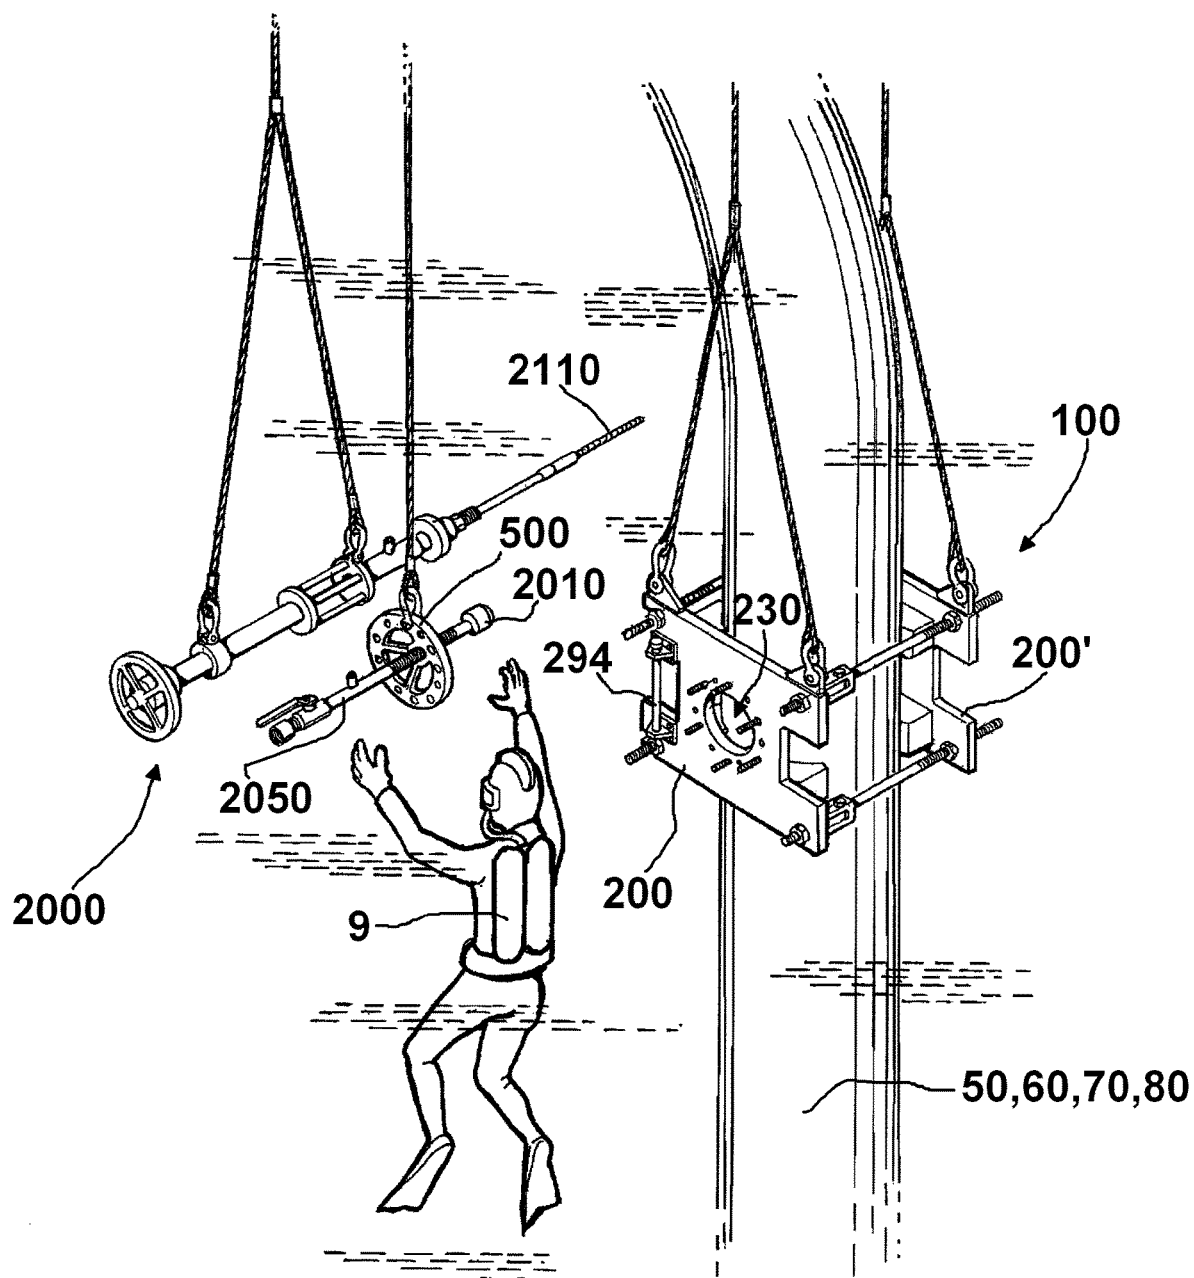


FIG. 4

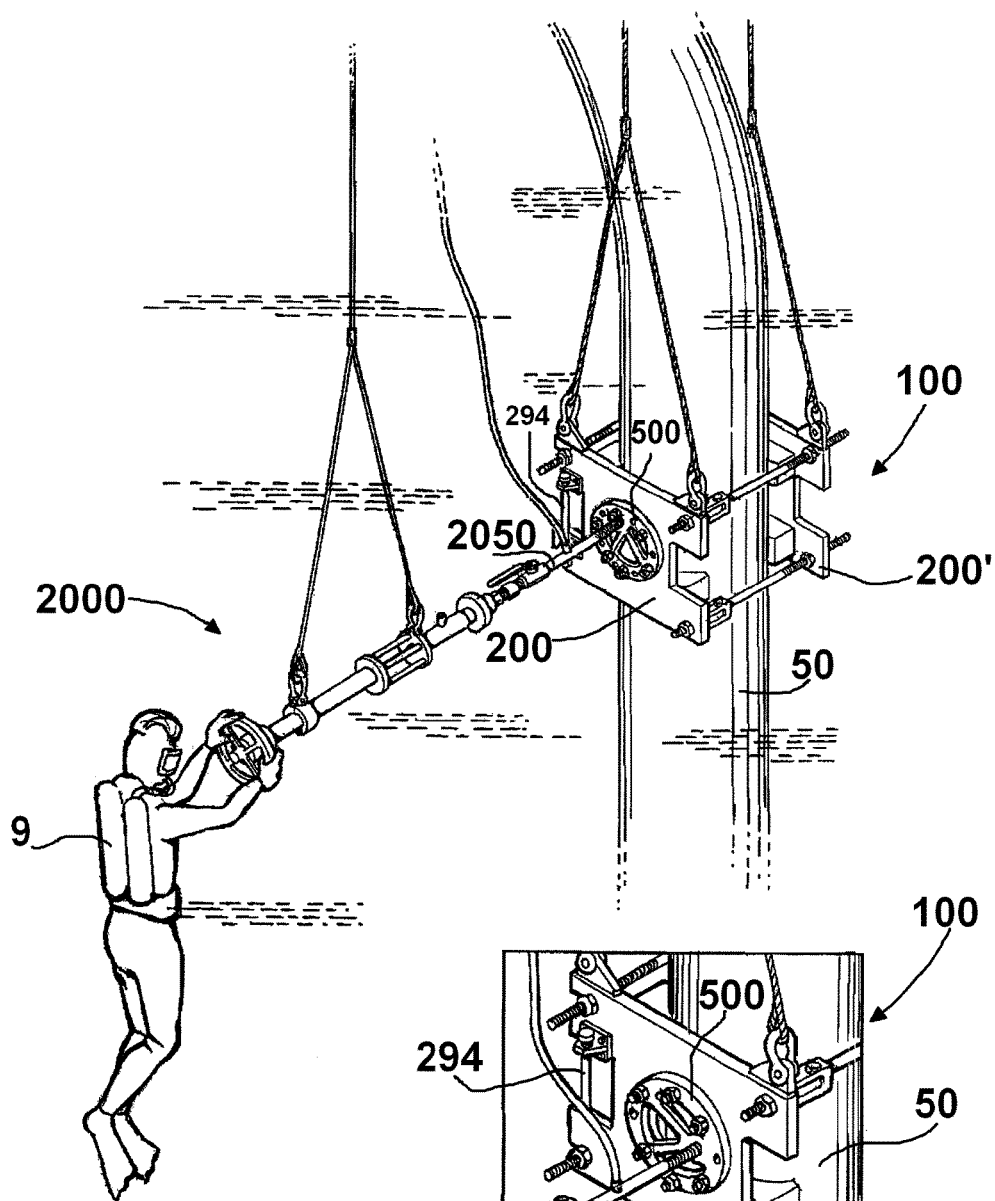


FIG. 5

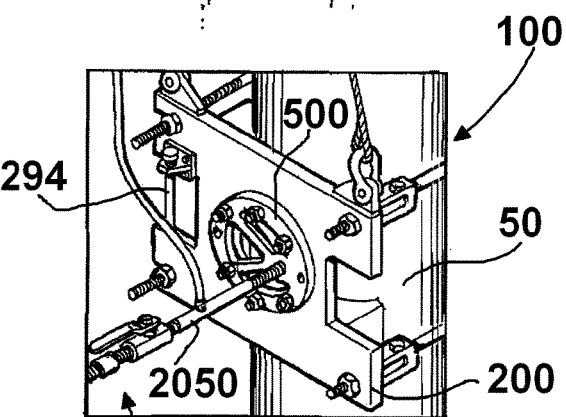


FIG. 6

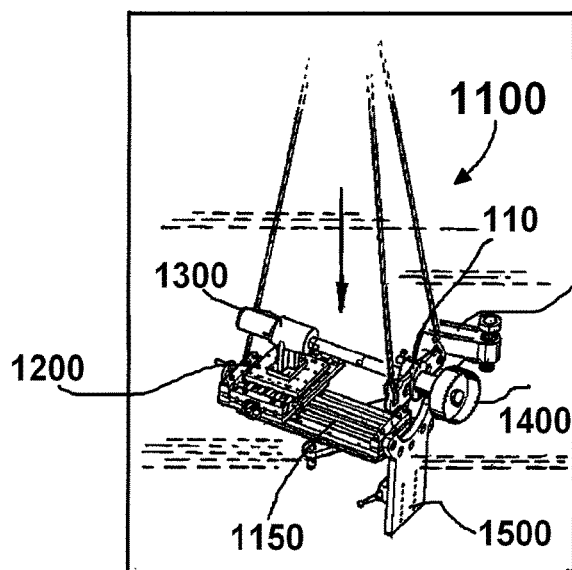


FIG. 7

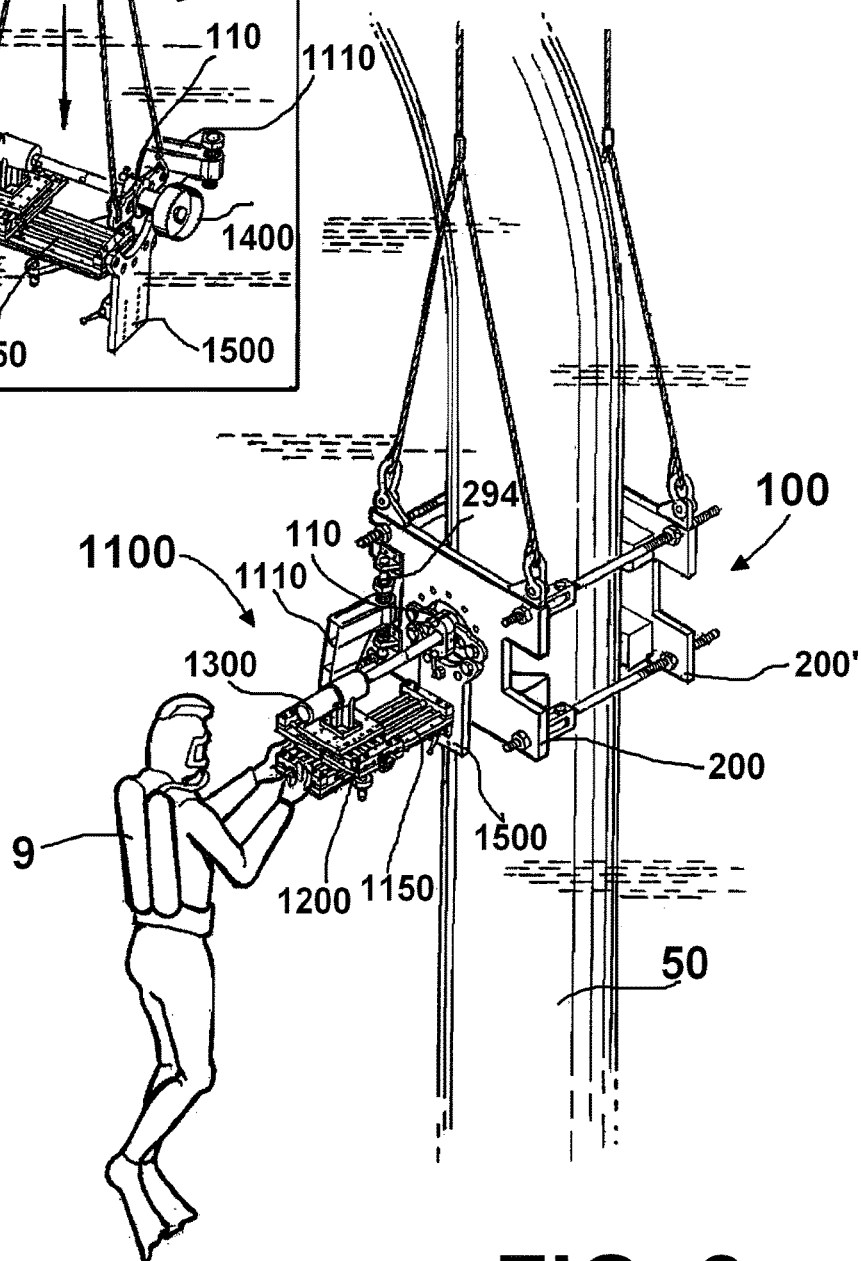


FIG. 8

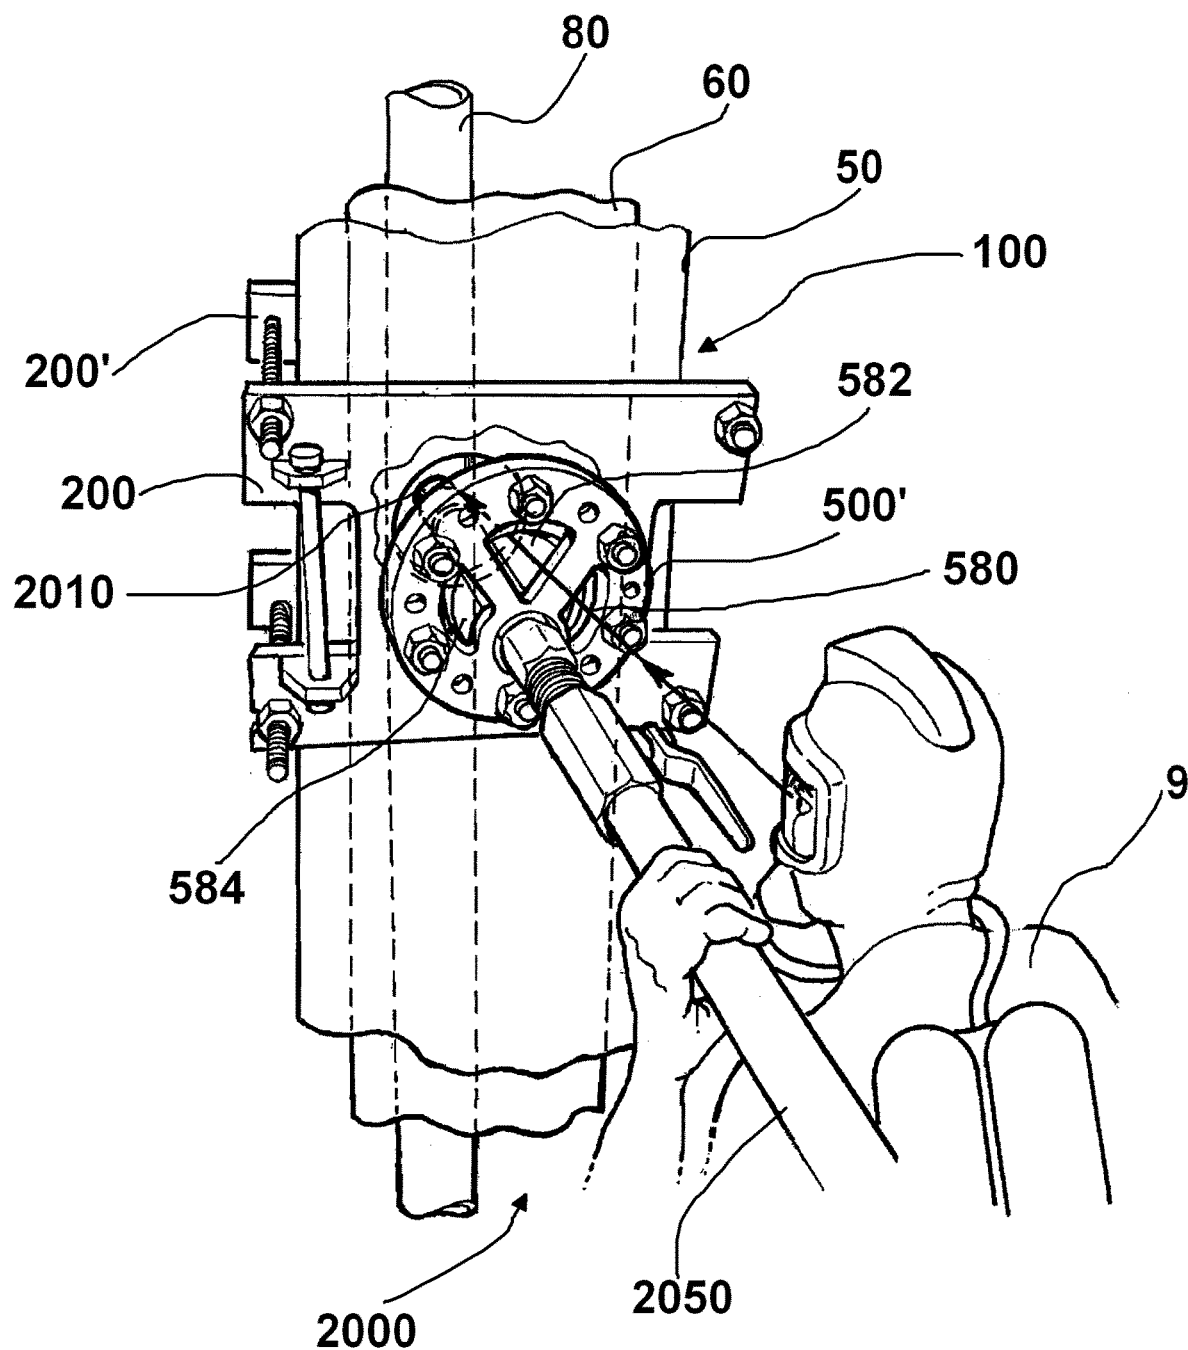


FIG. 9

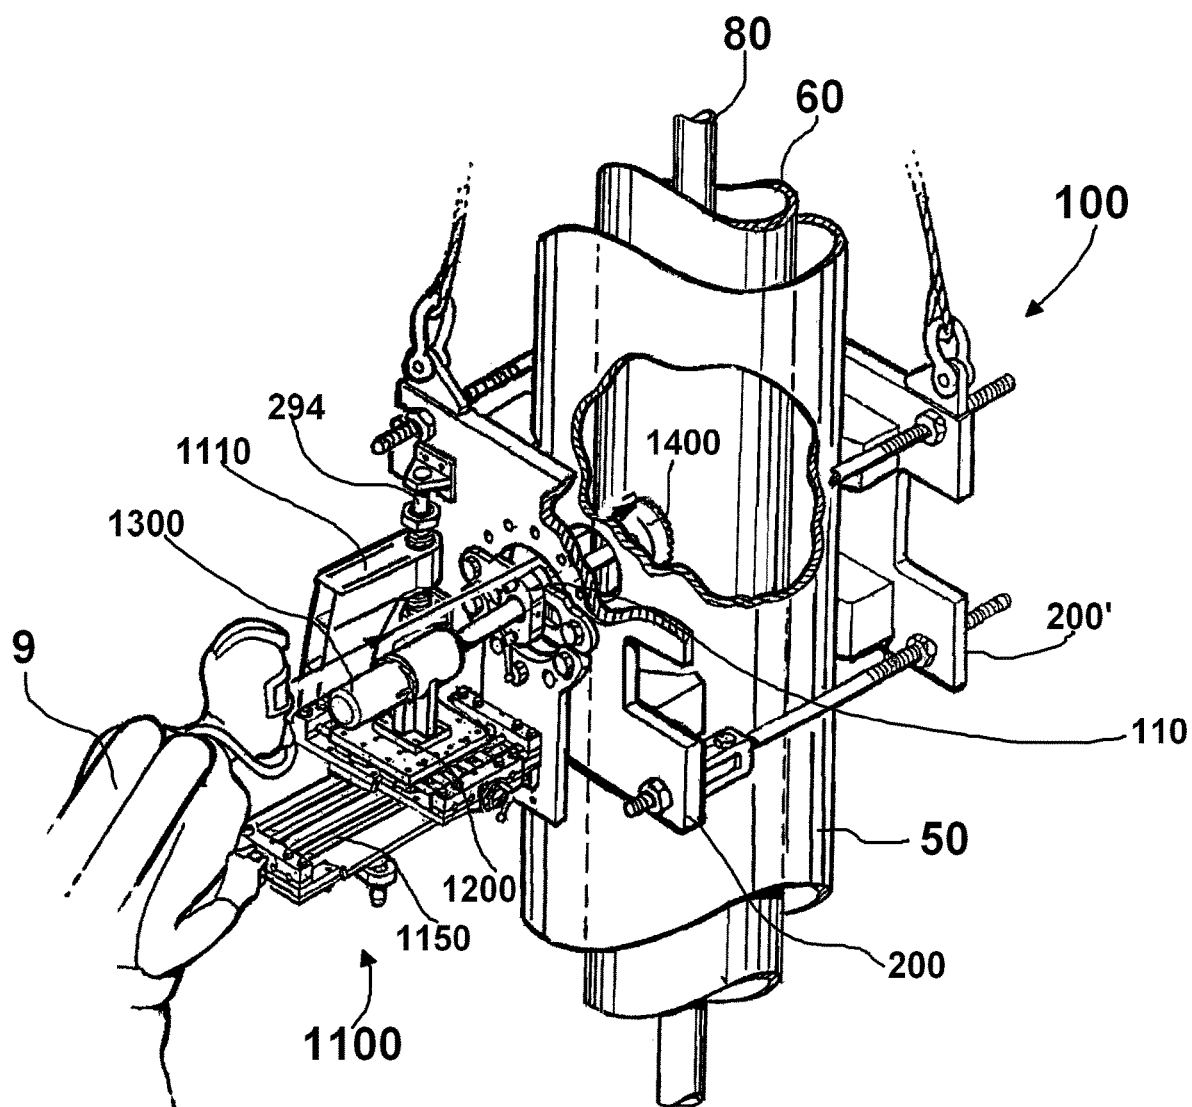


FIG. 10

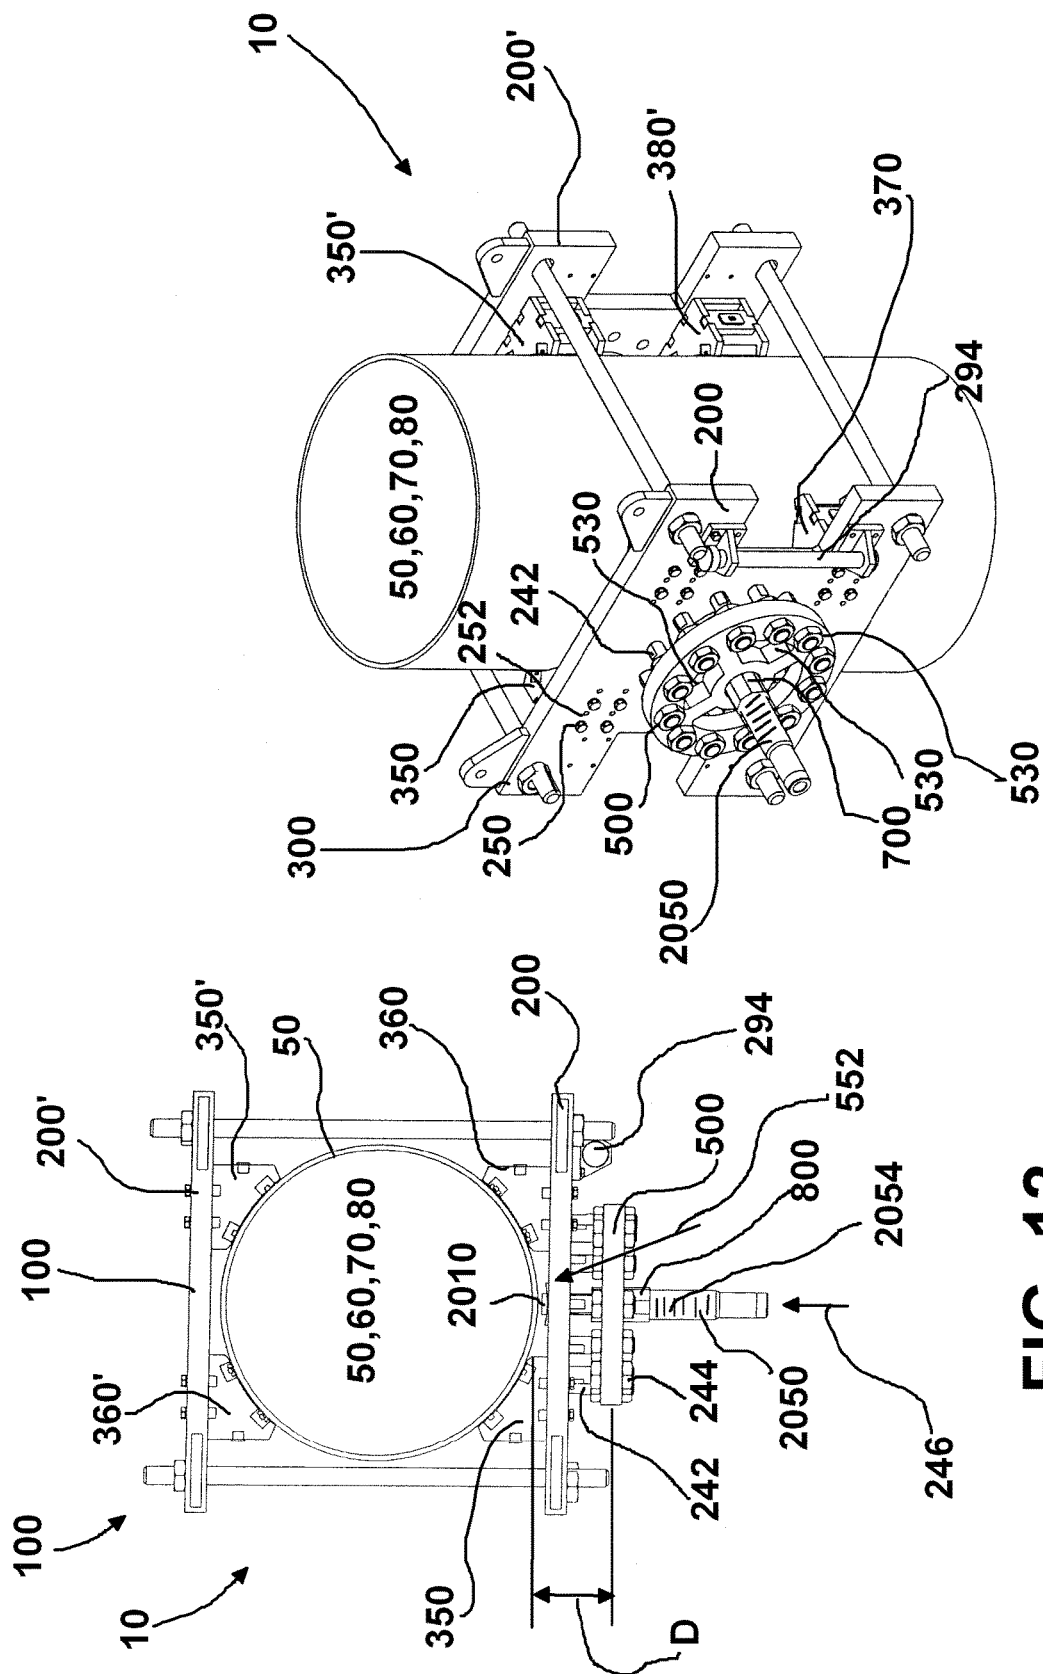


FIG. 11

FIG. 12

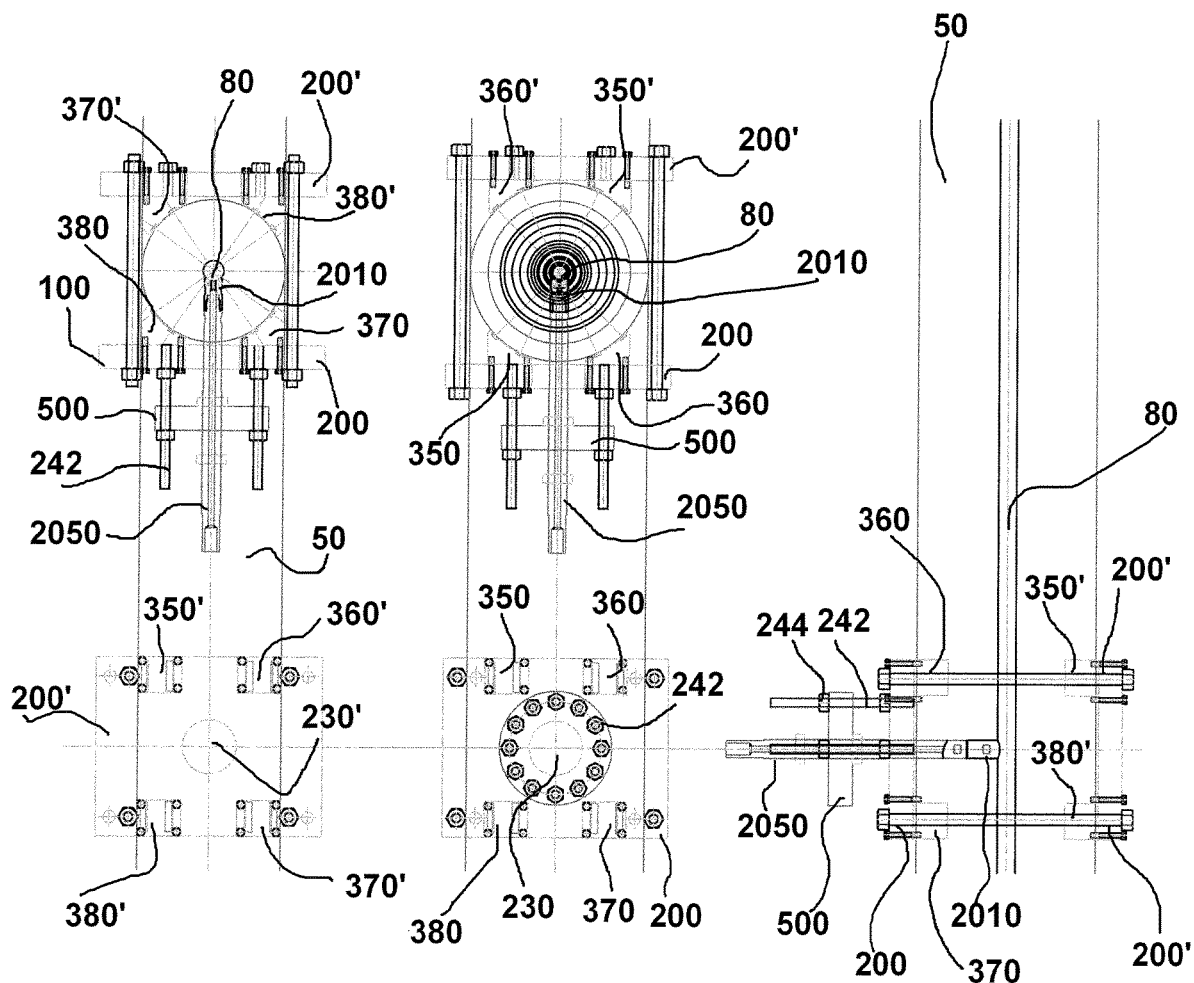


FIG. 15

FIG. 14

FIG. 13

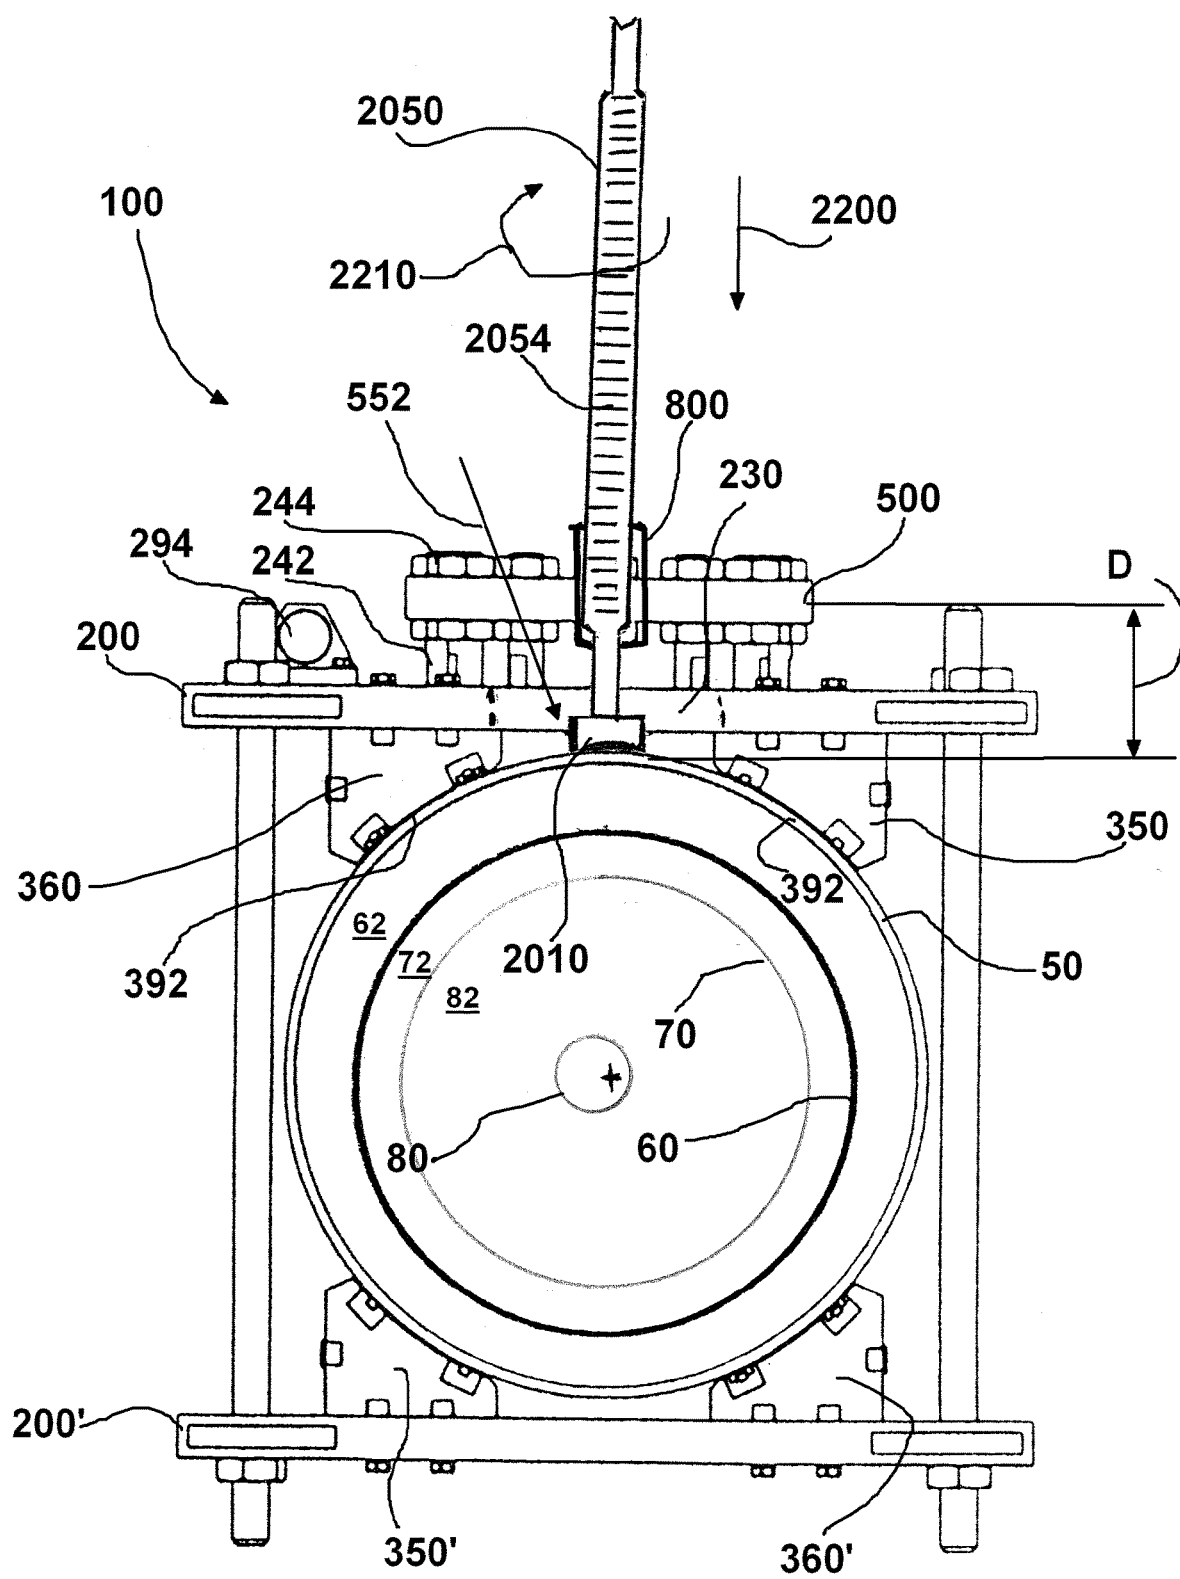
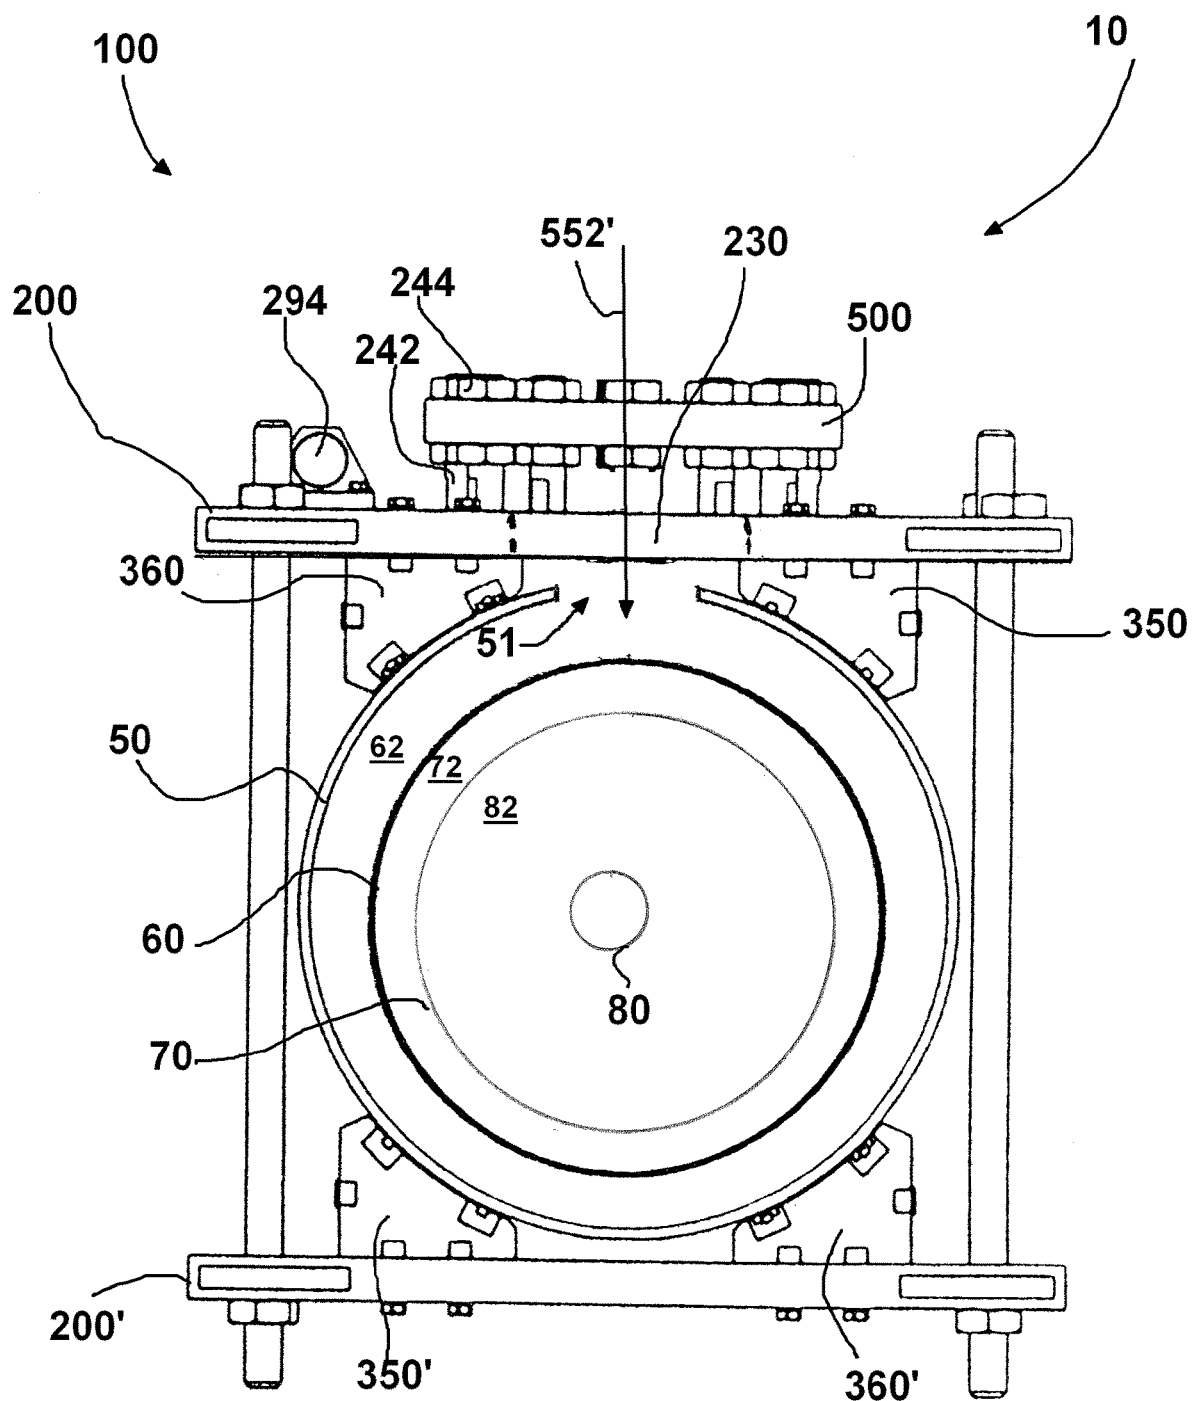


FIG. 16



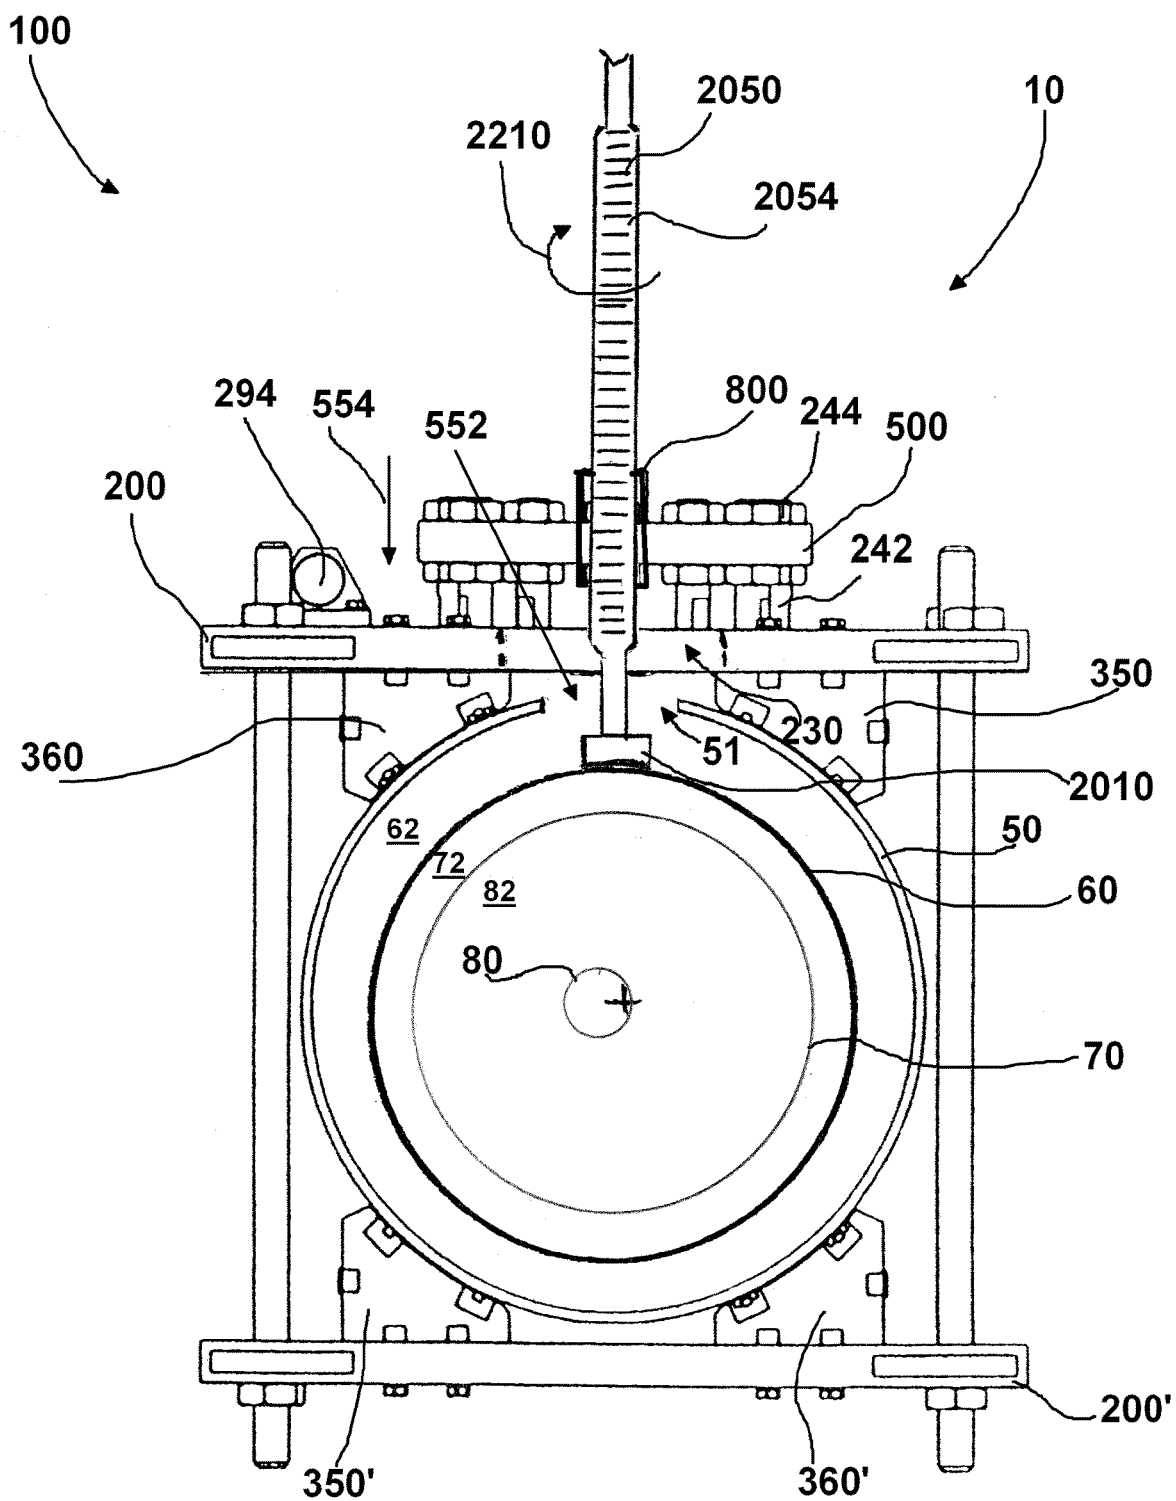
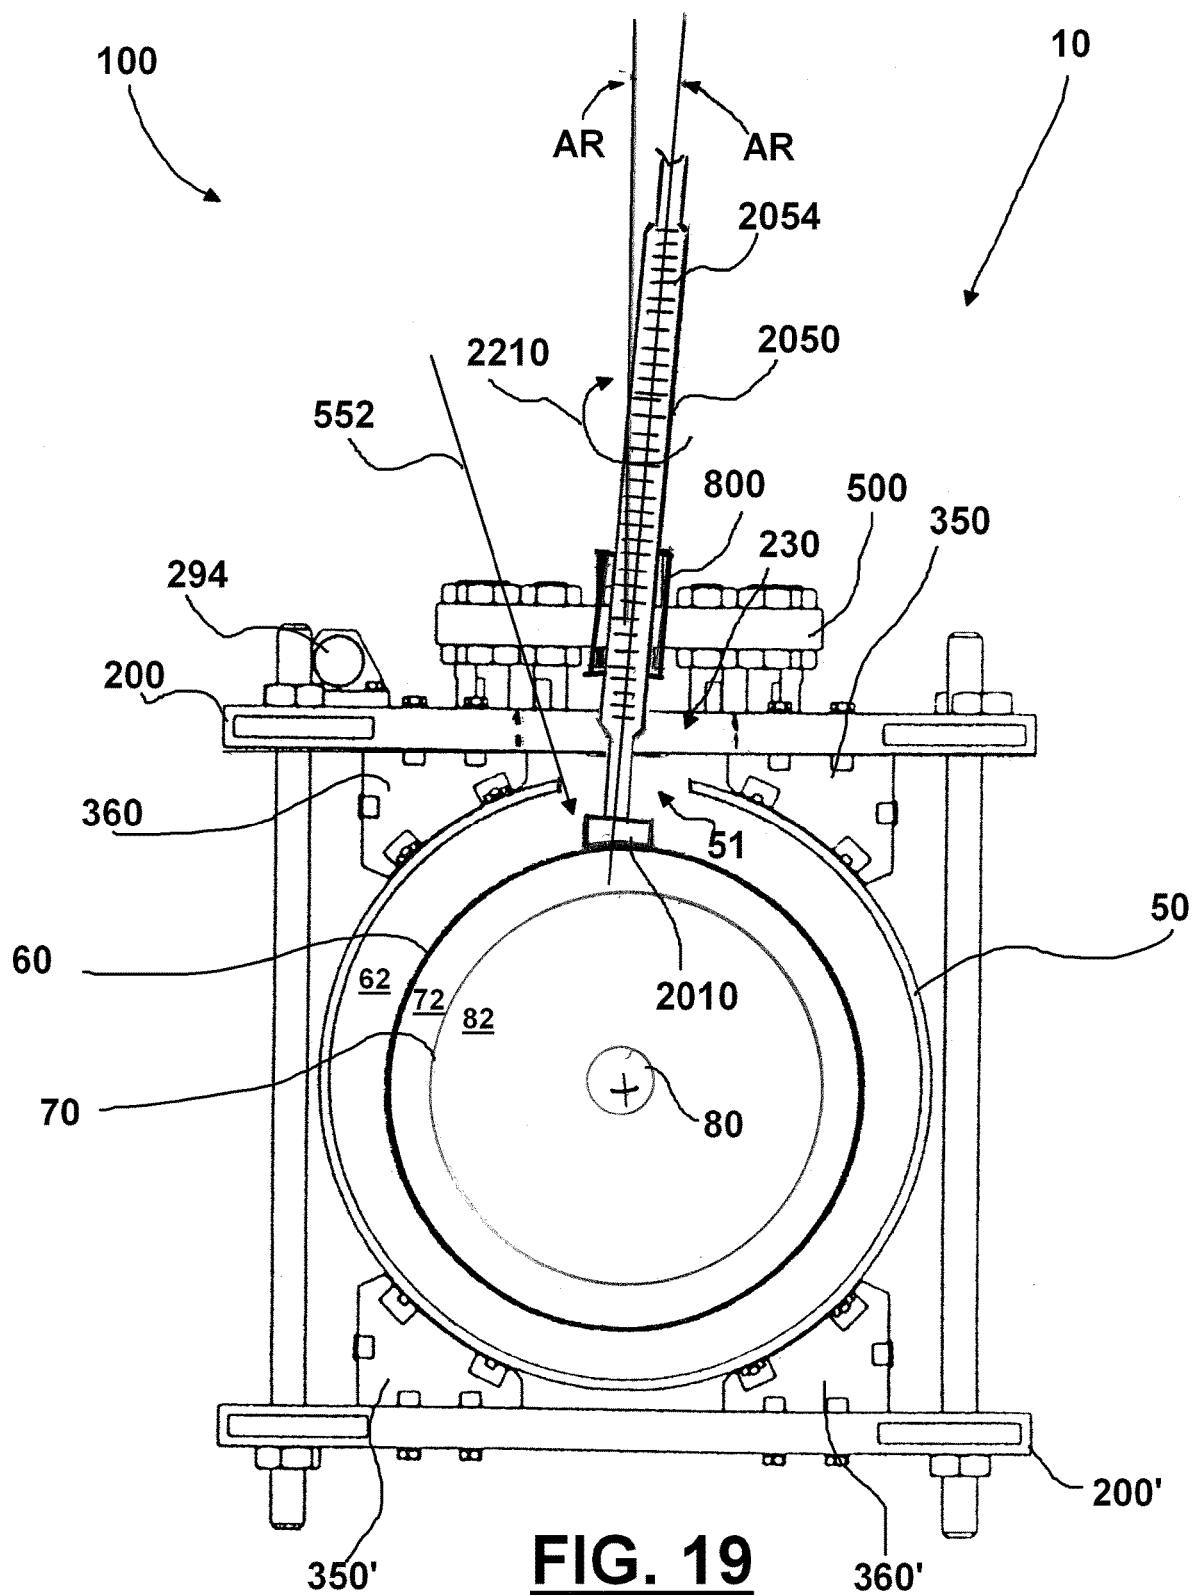


FIG. 18



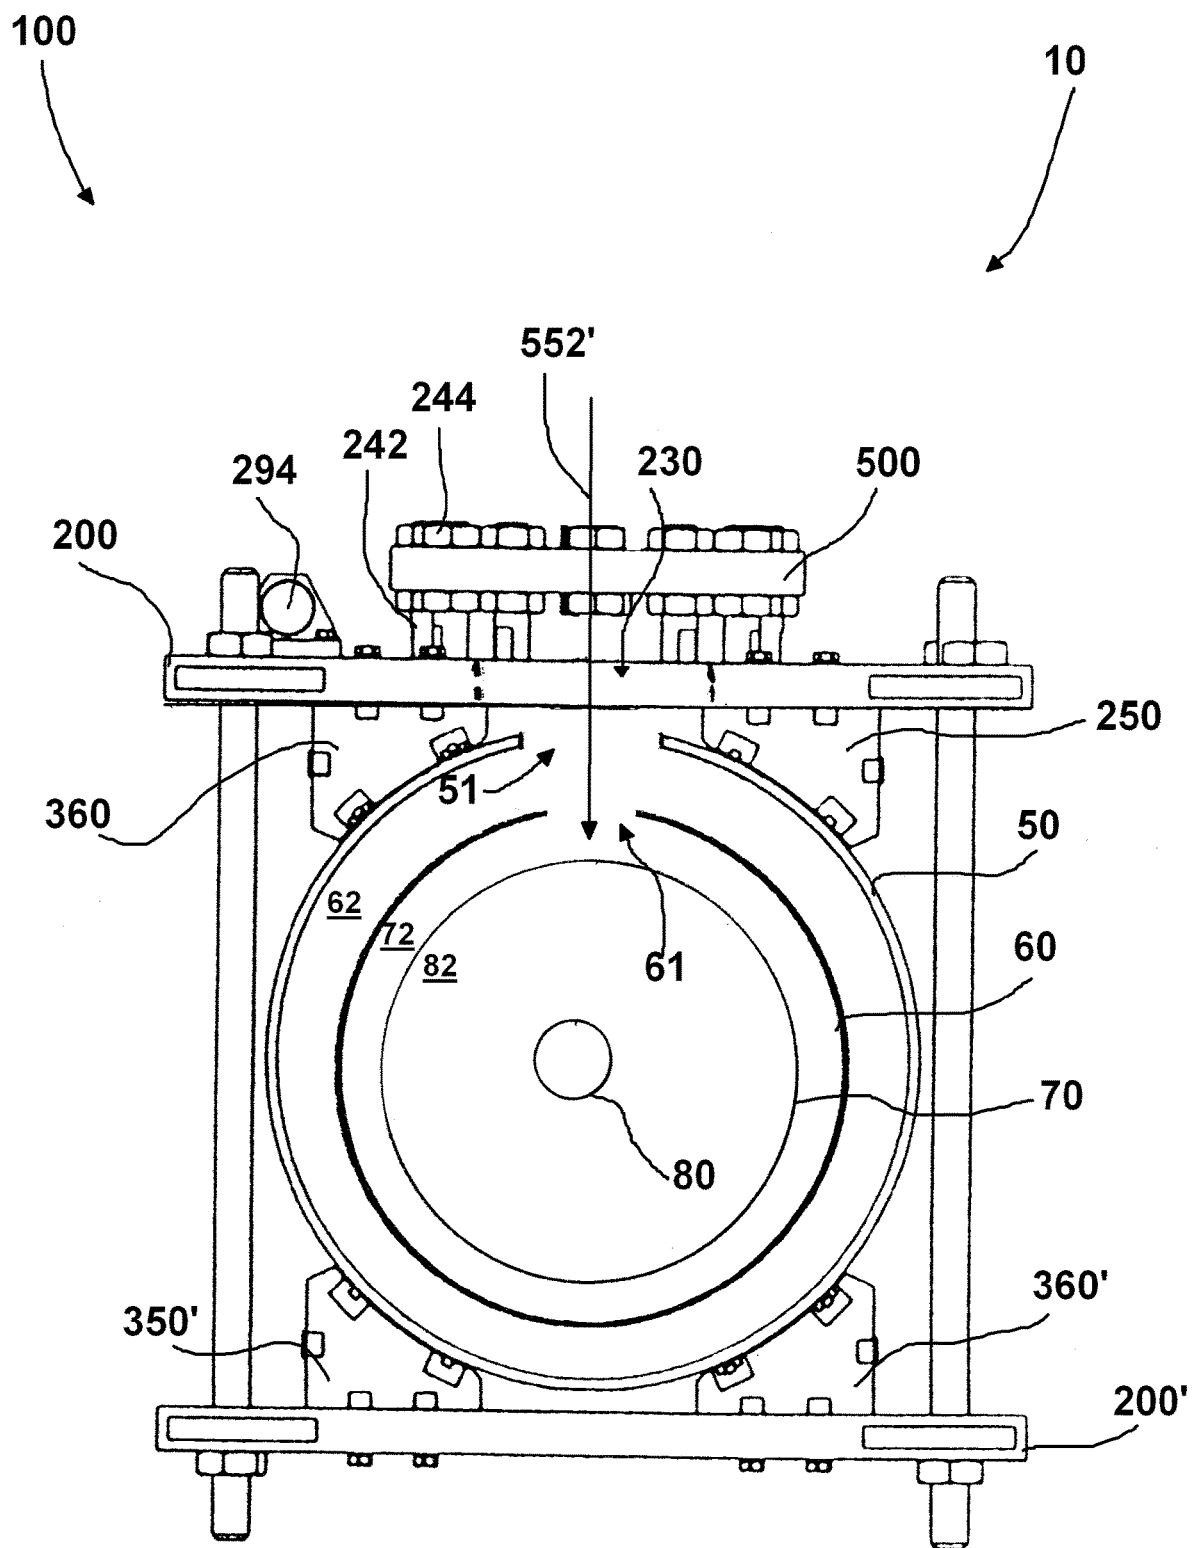


FIG. 20

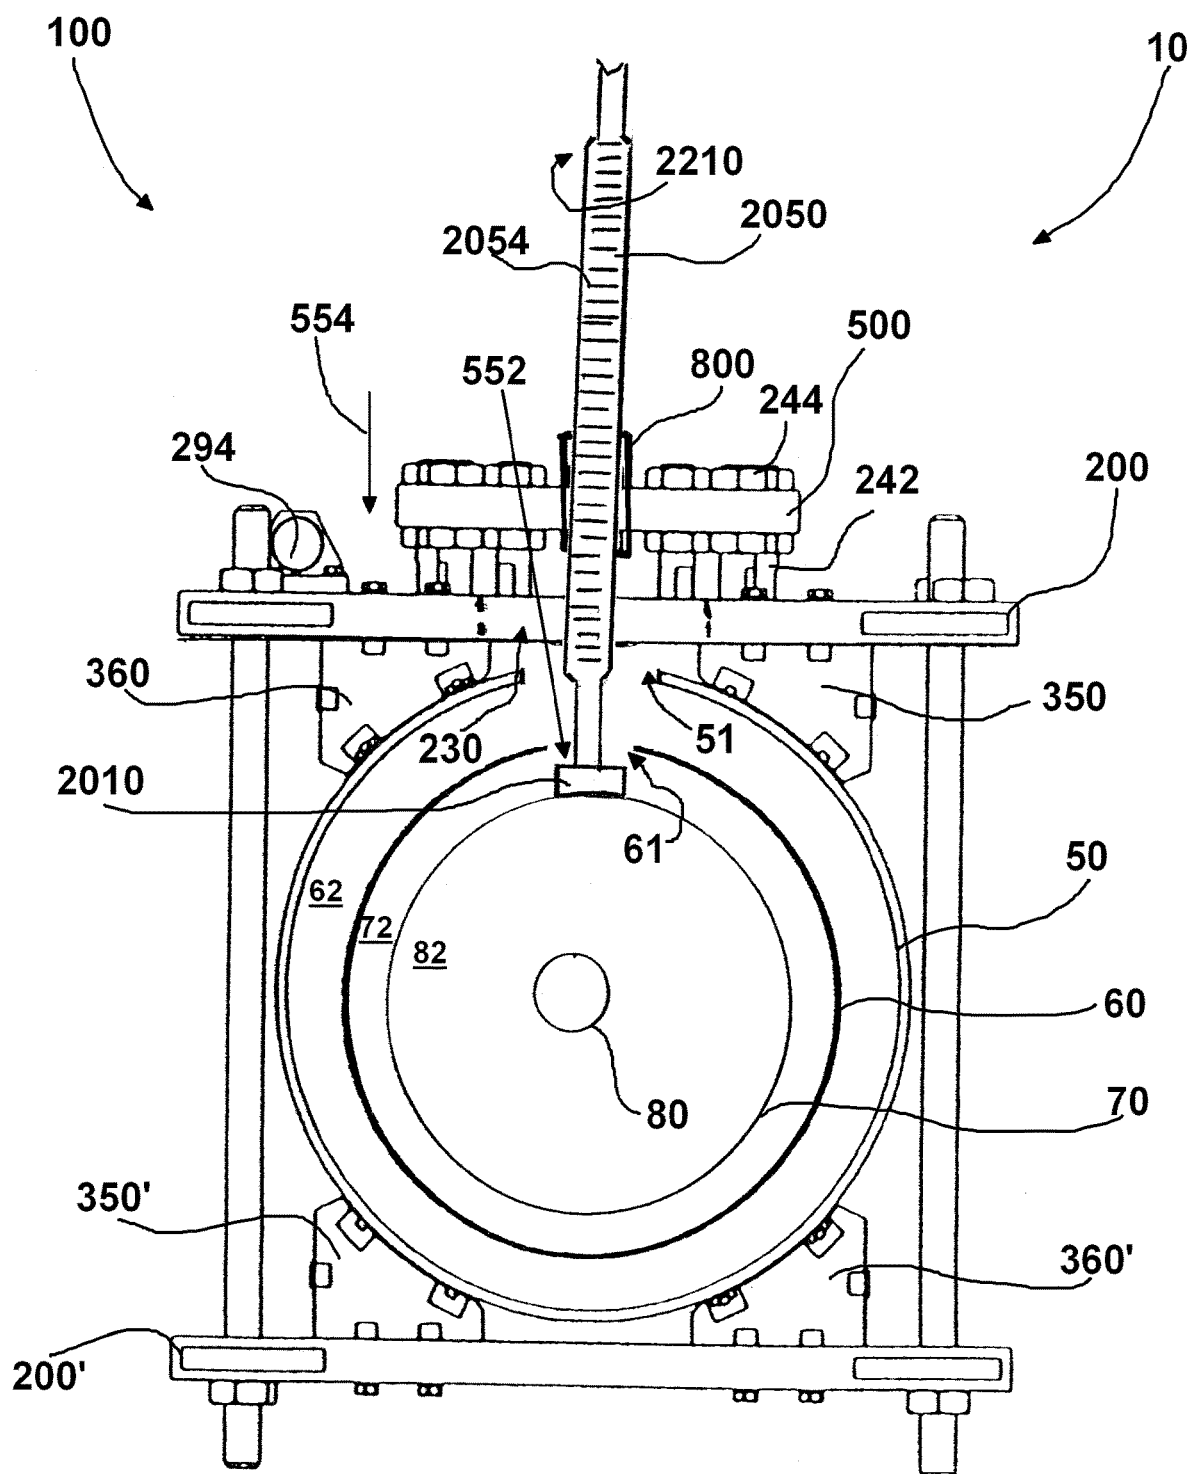
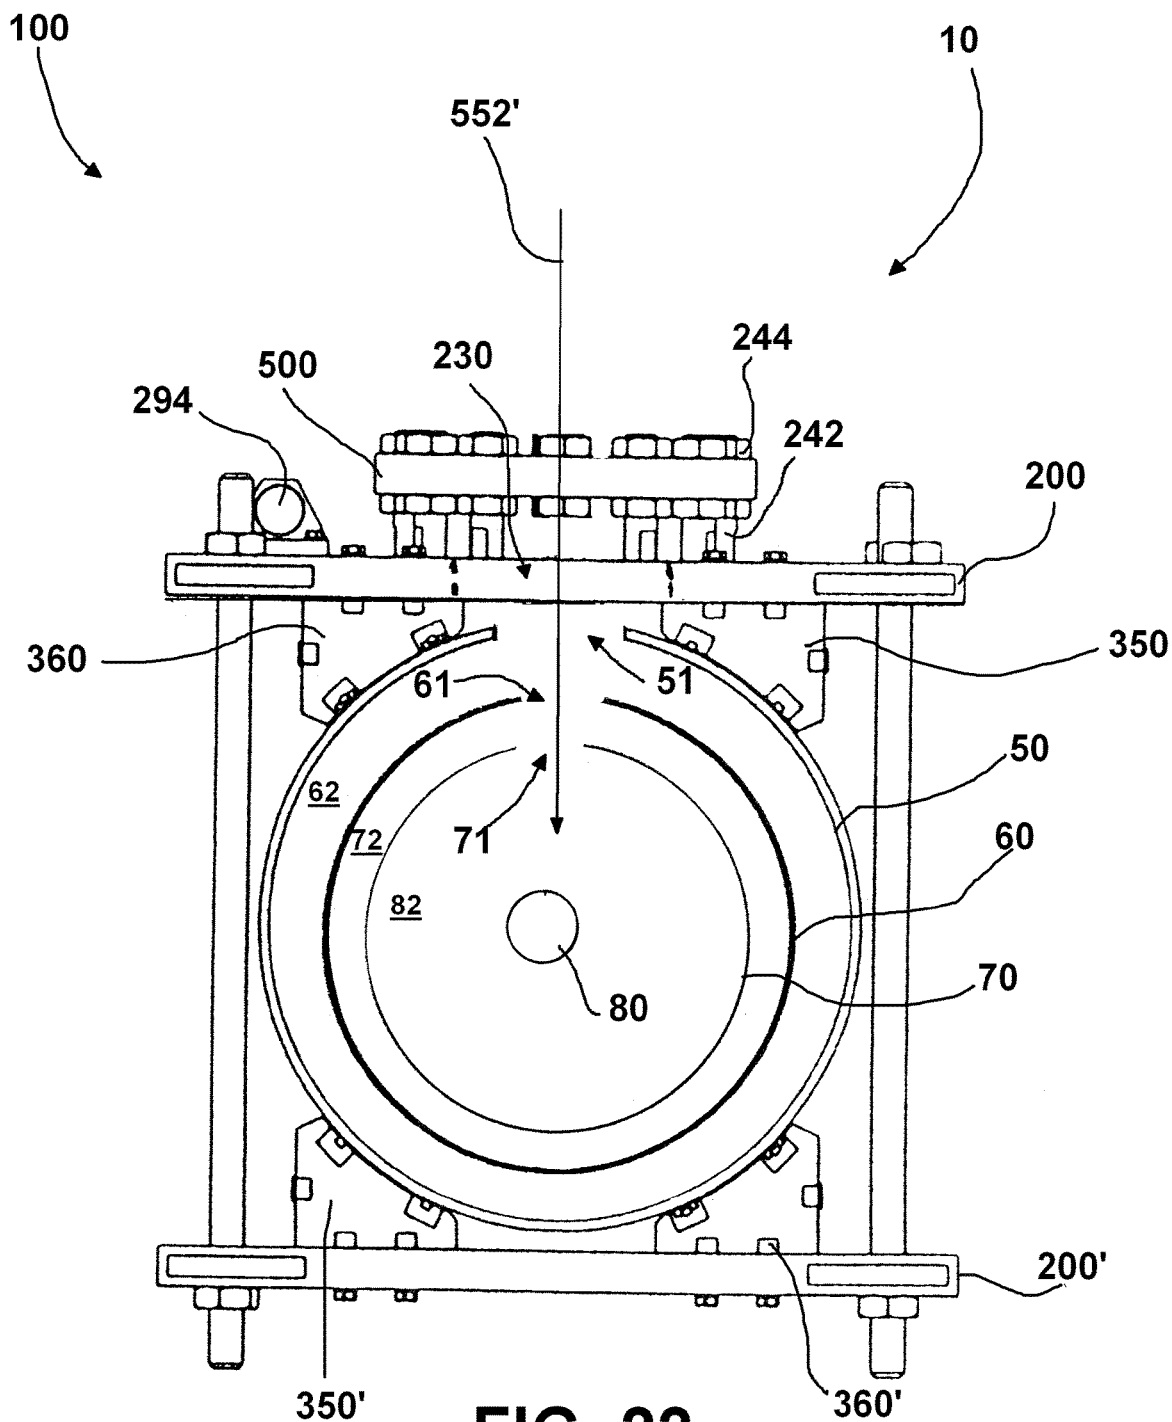


FIG. 21



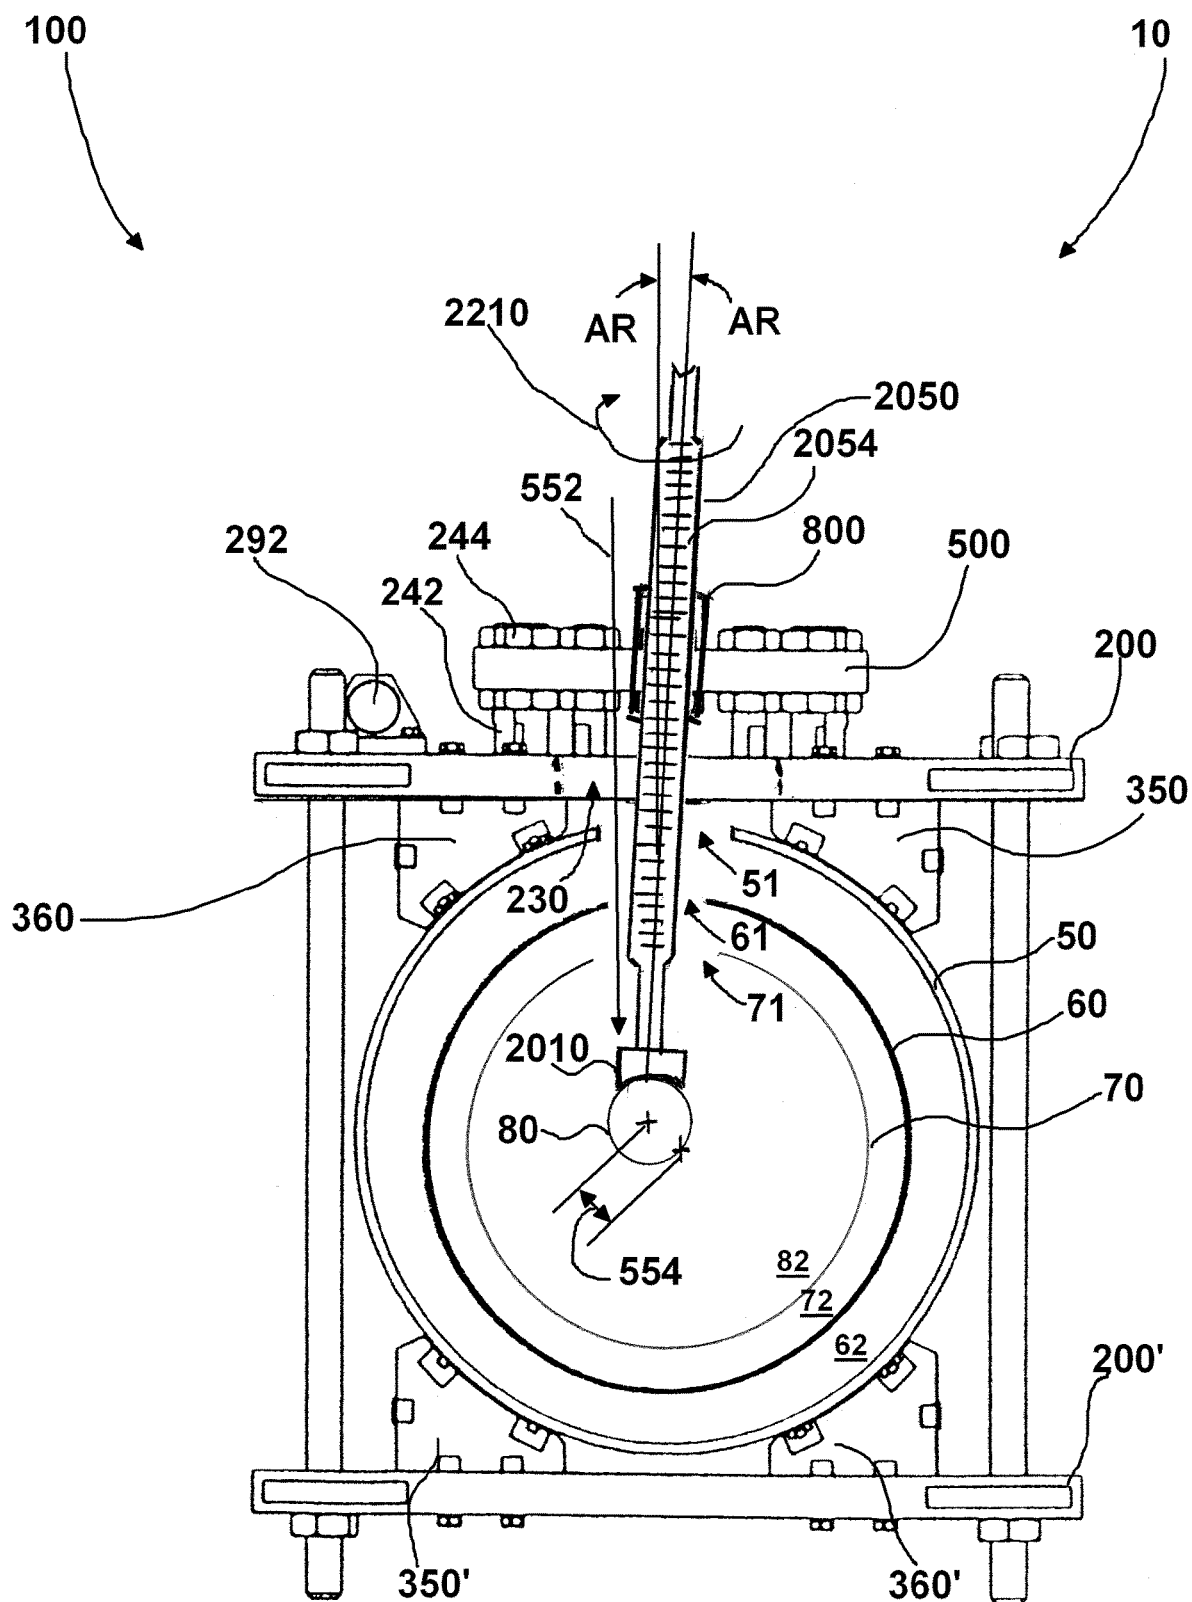
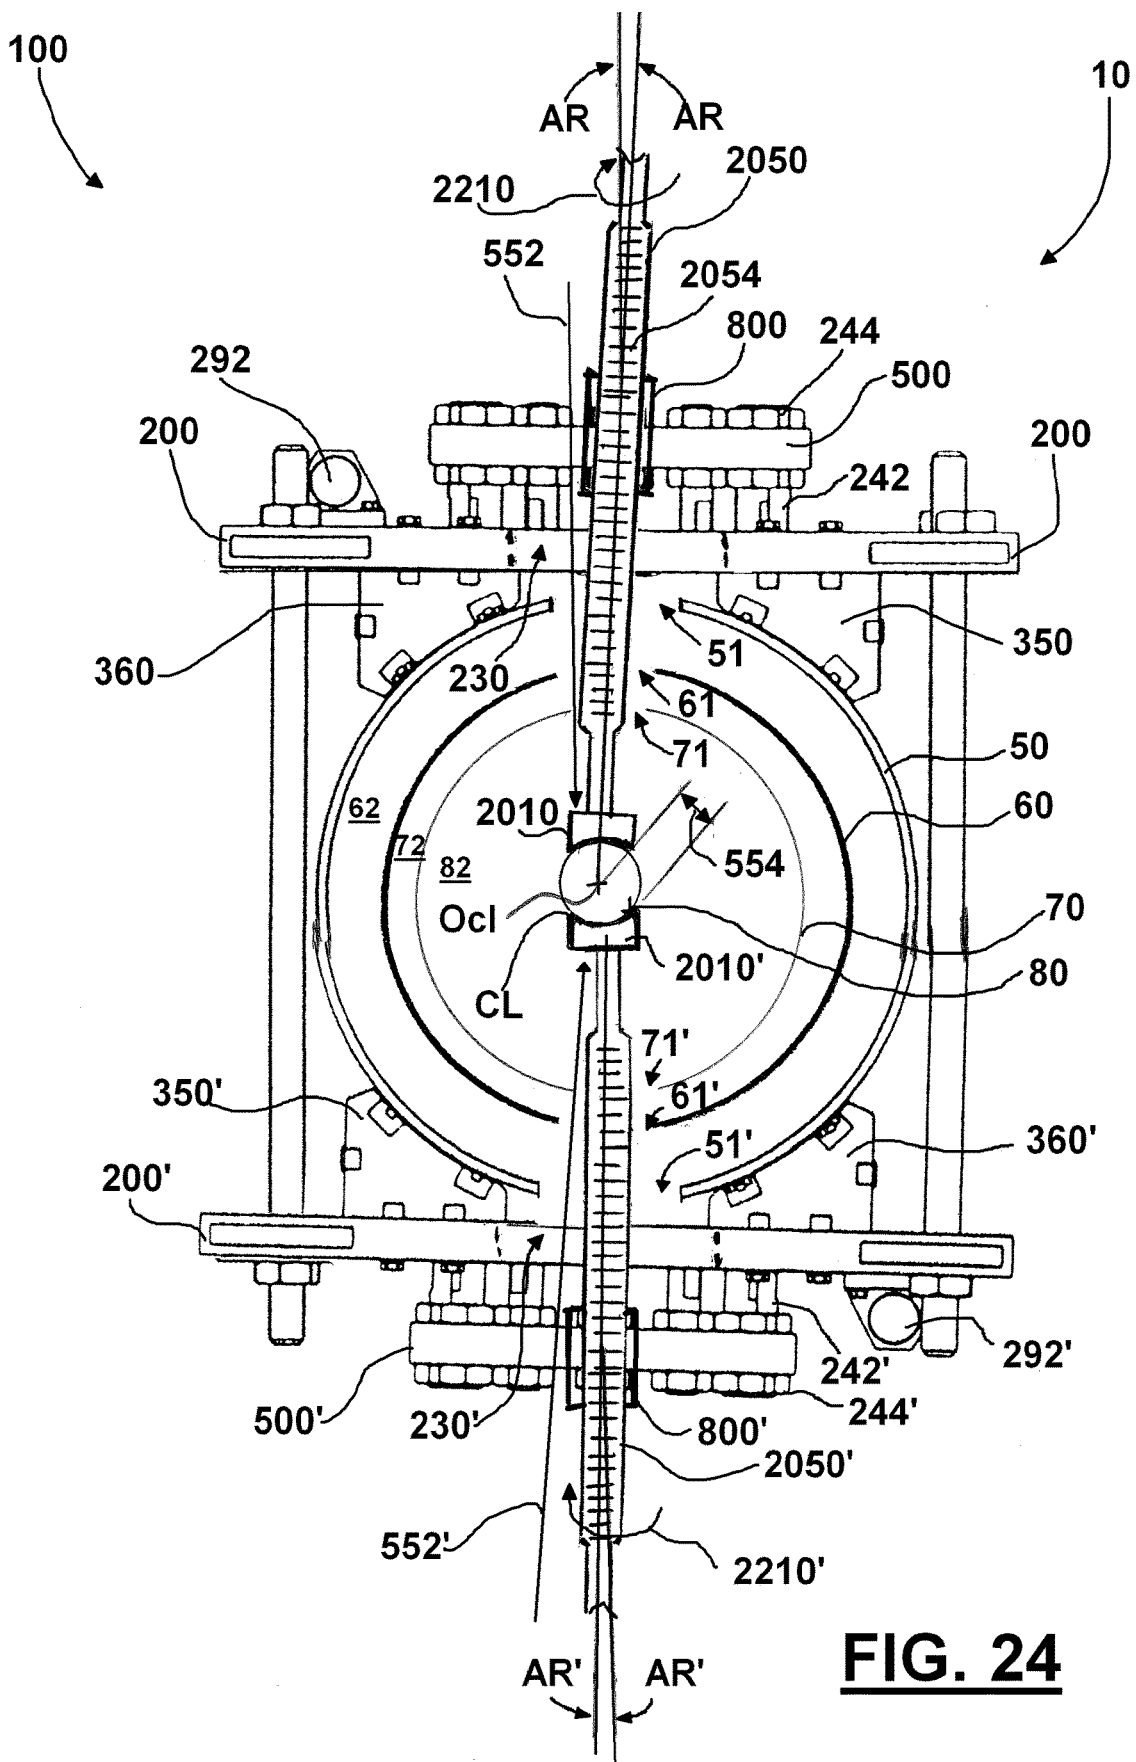


FIG. 23



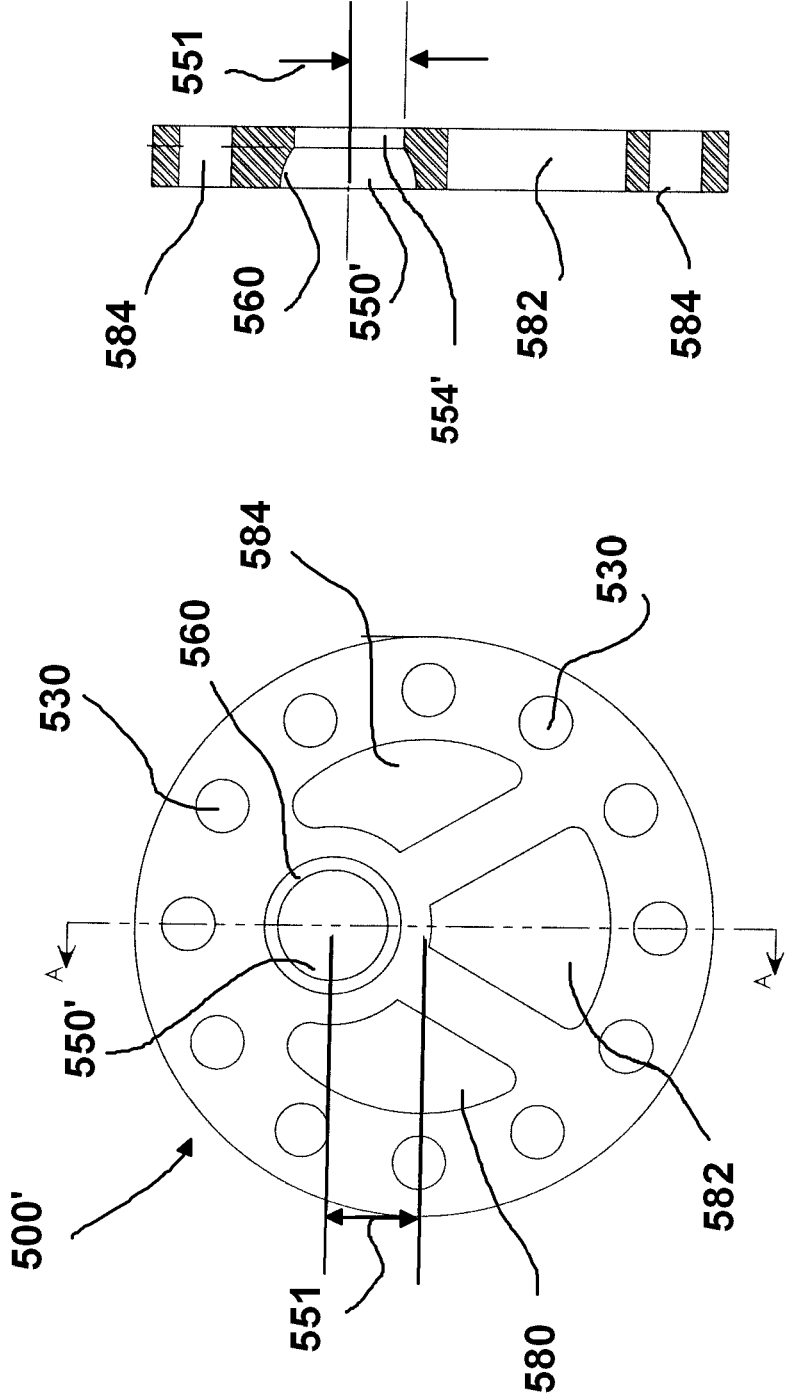


FIG. 26

FIG. 25

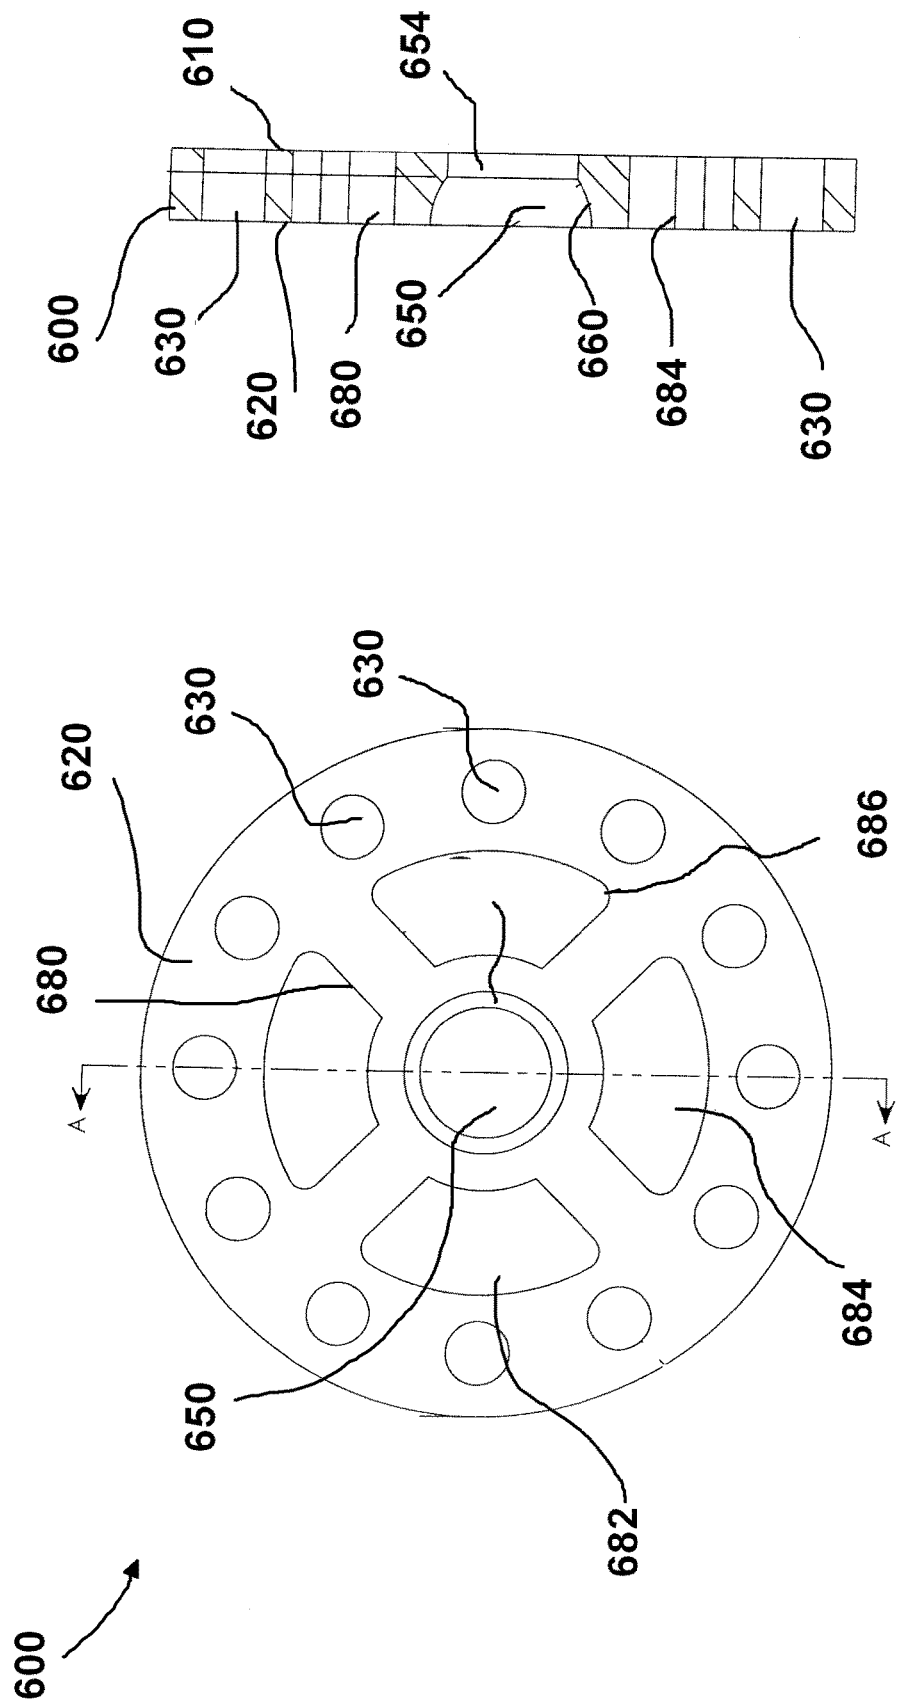


FIG. 27

FIG. 28

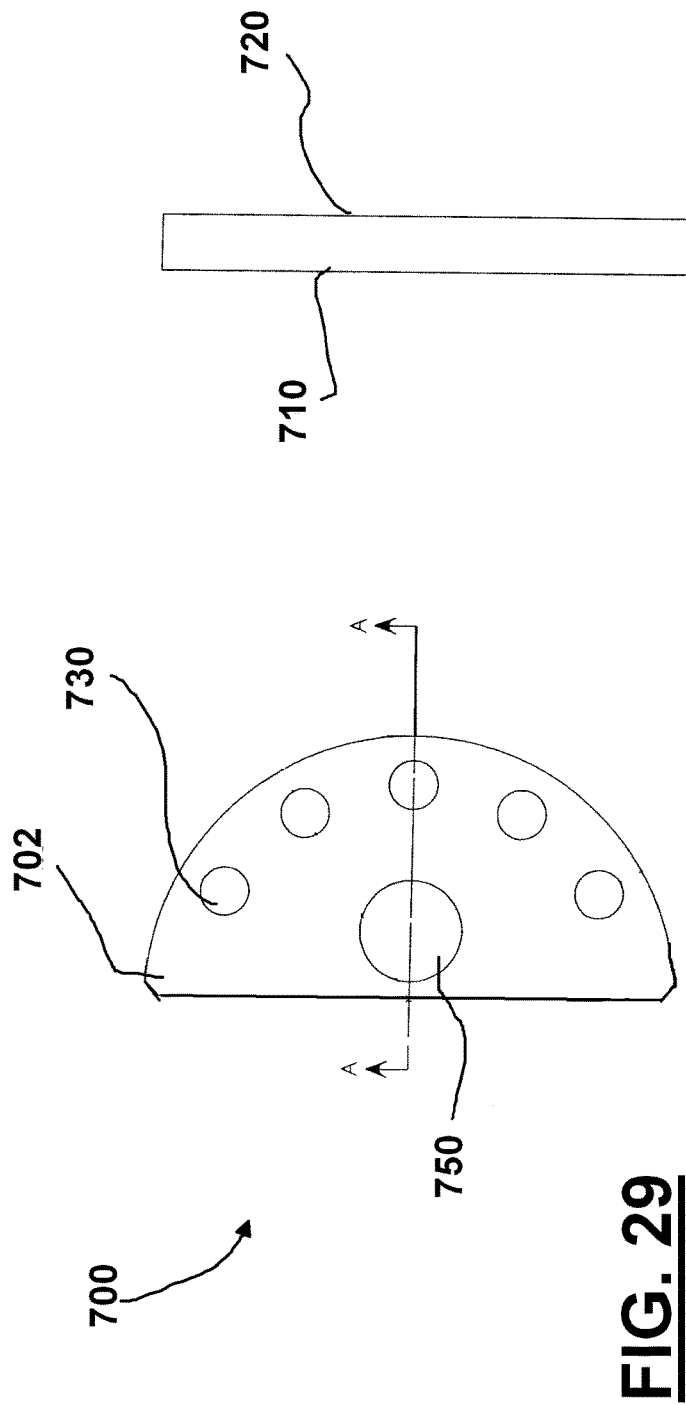


FIG. 31

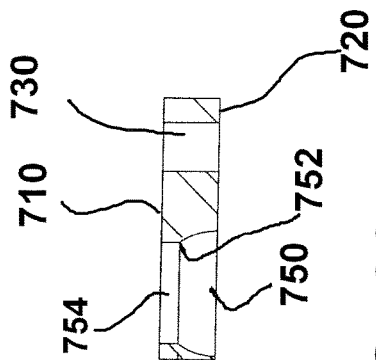
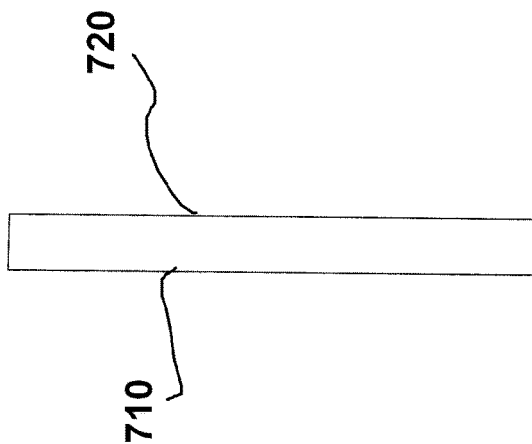


FIG. 30

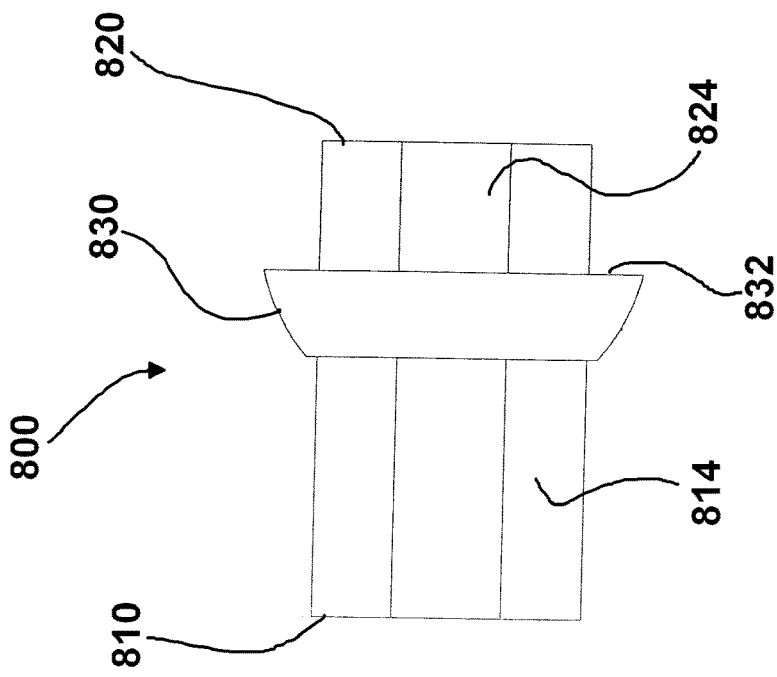


FIG. 32

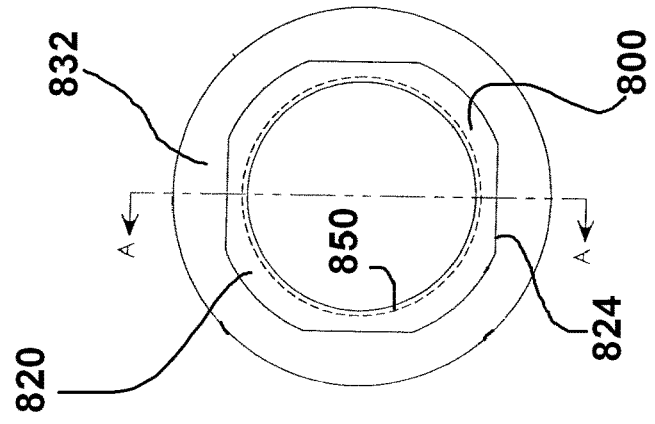


FIG. 33

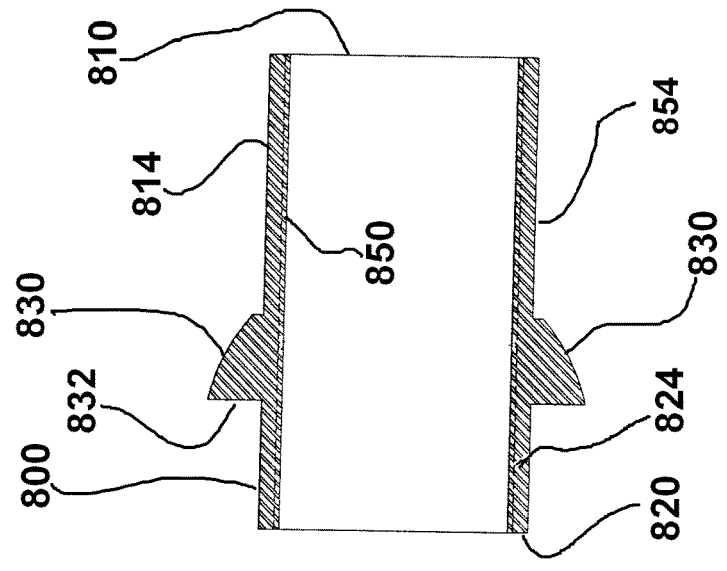


FIG. 34

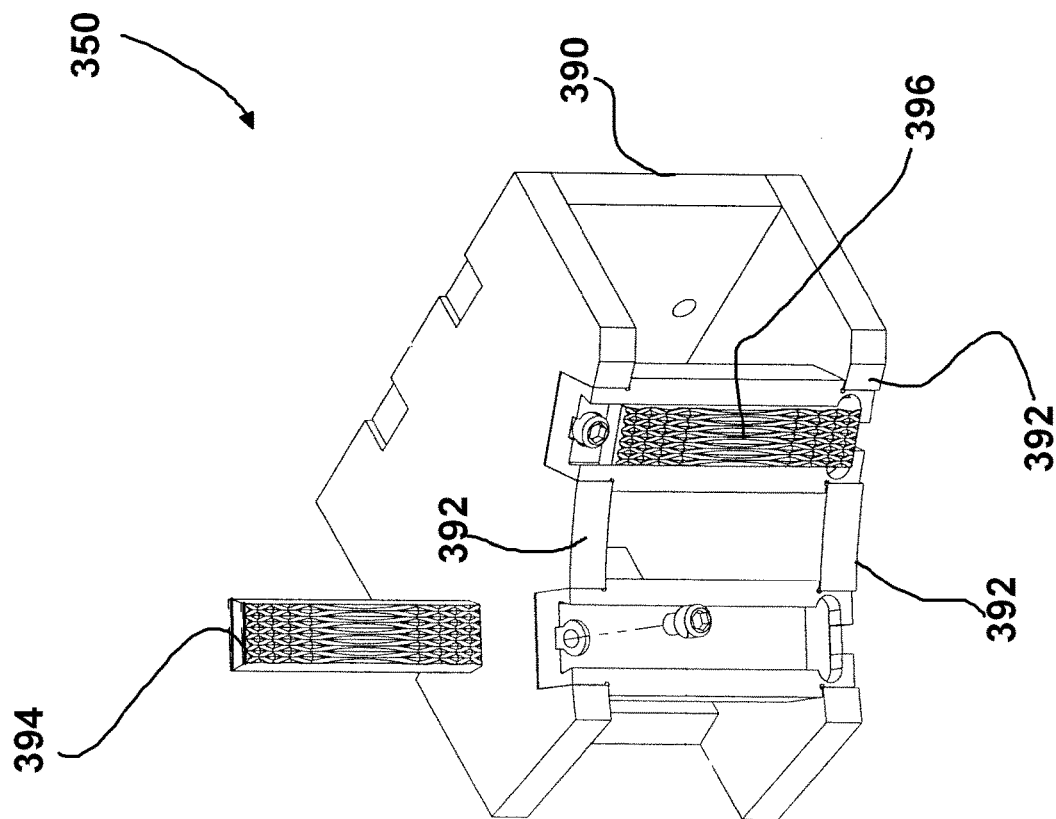


FIG. 35

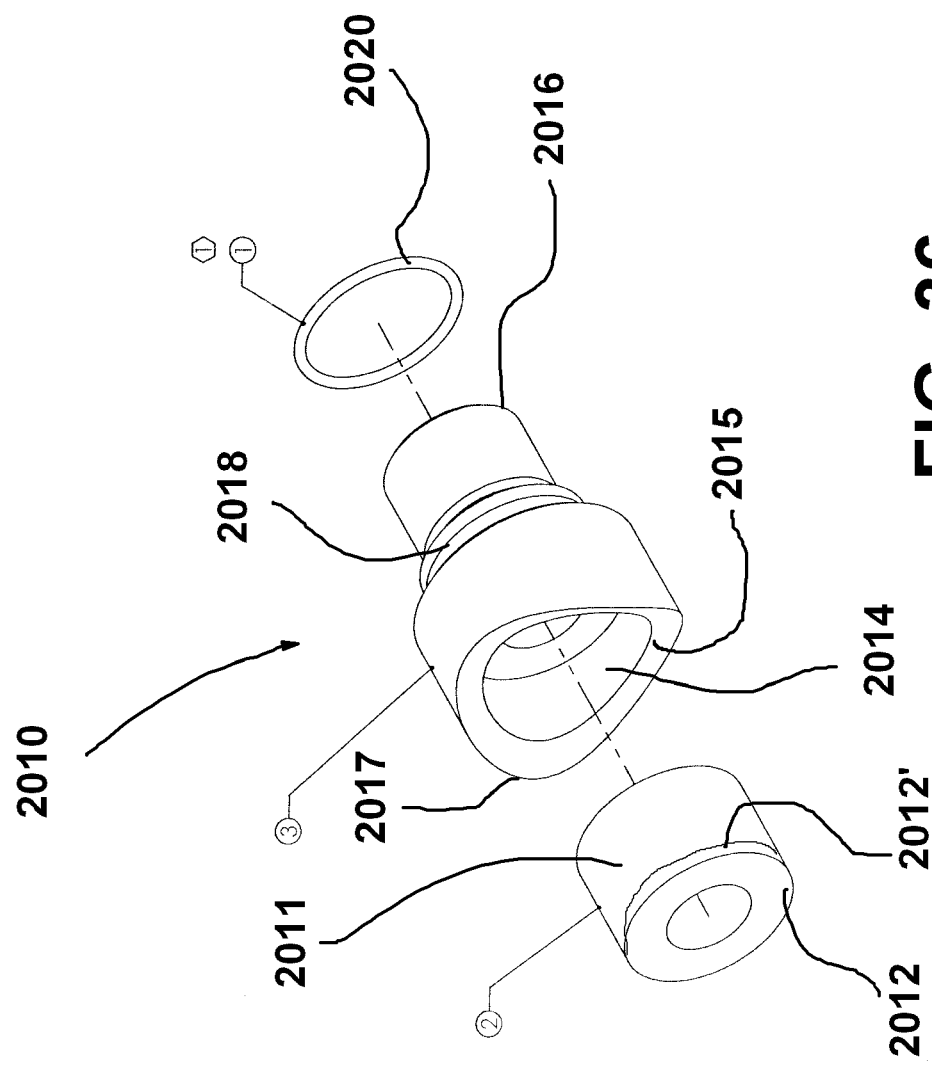
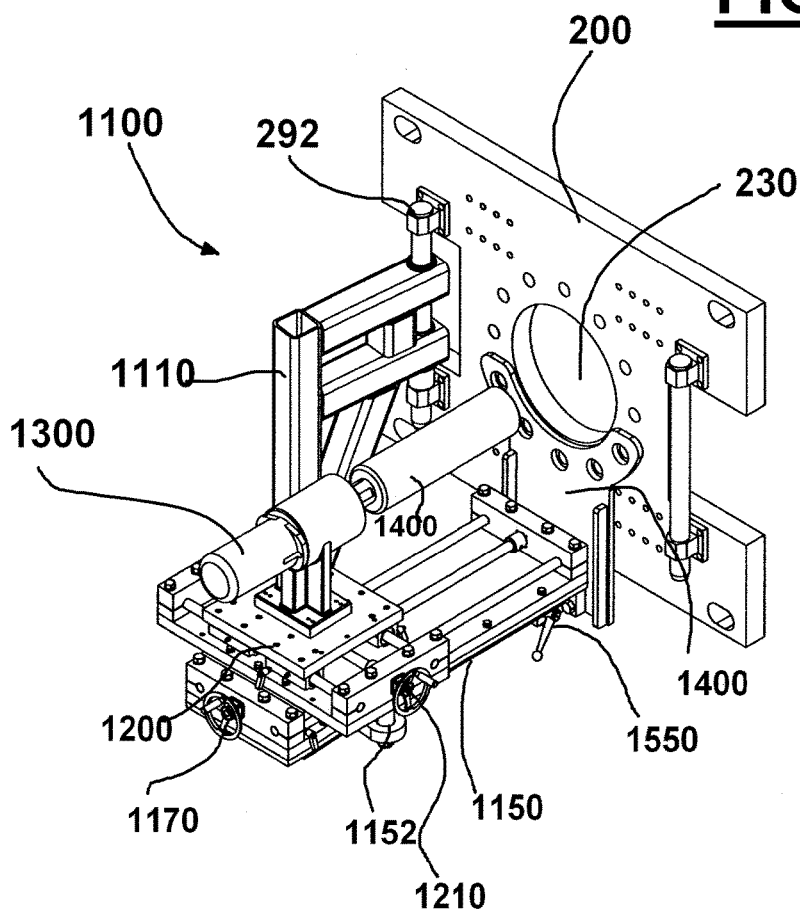
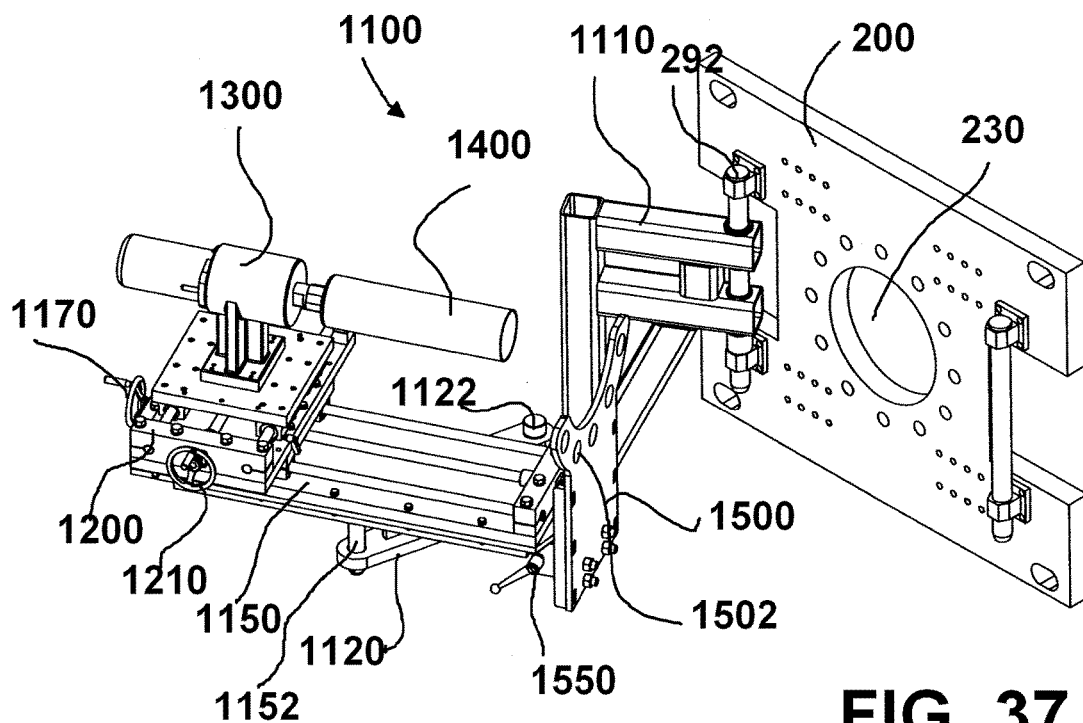
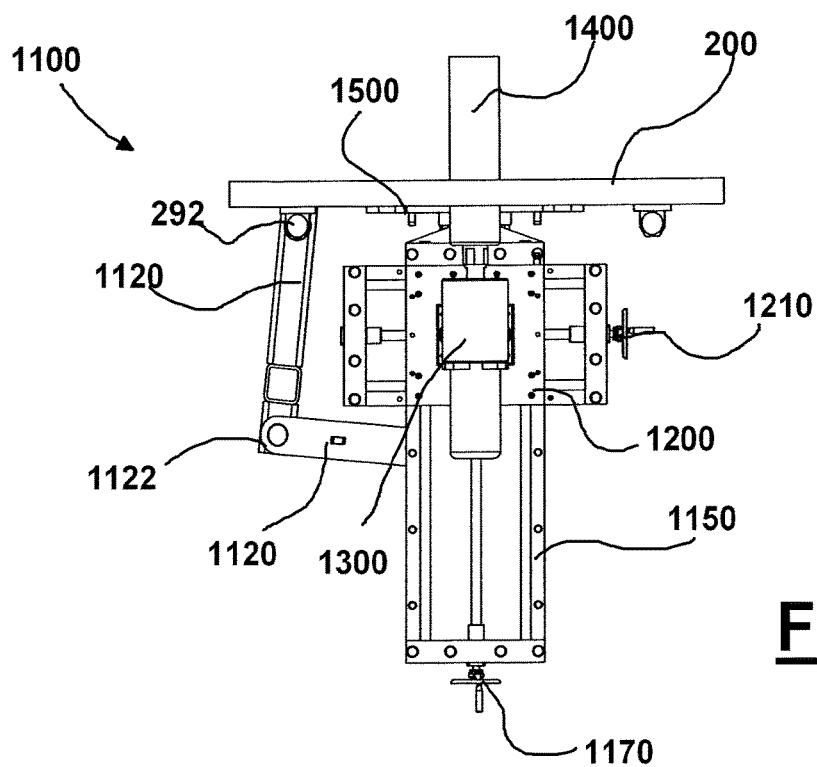
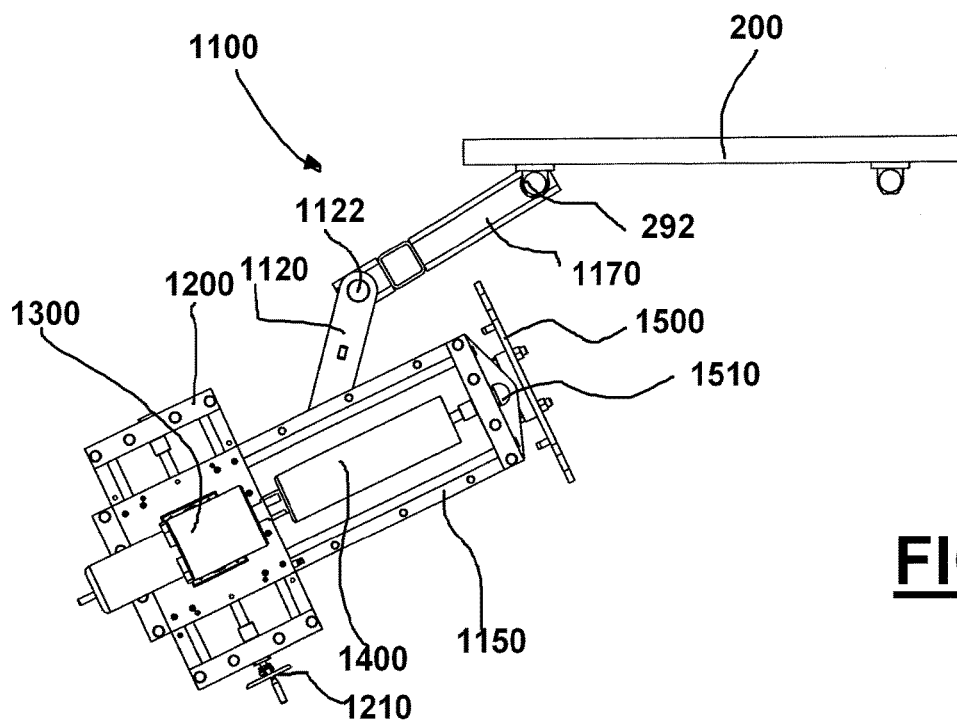


FIG. 36





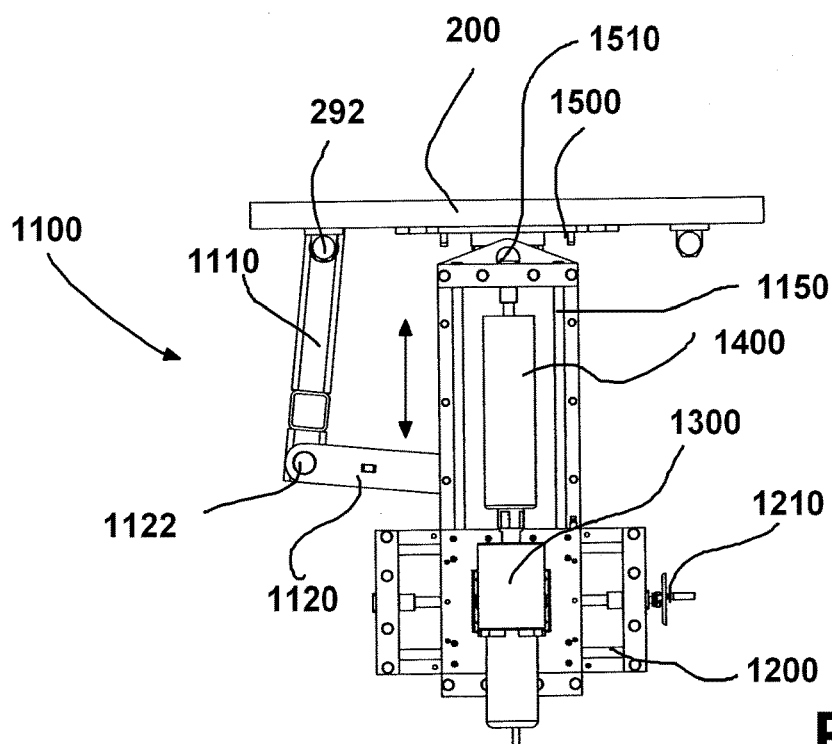


FIG. 41

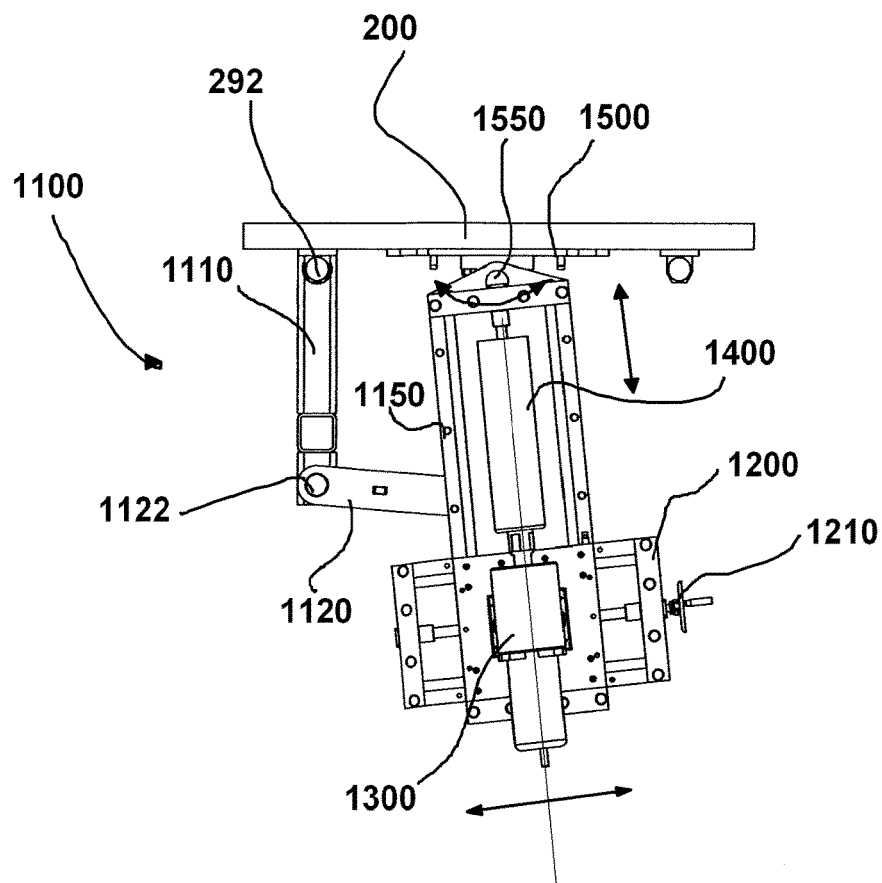
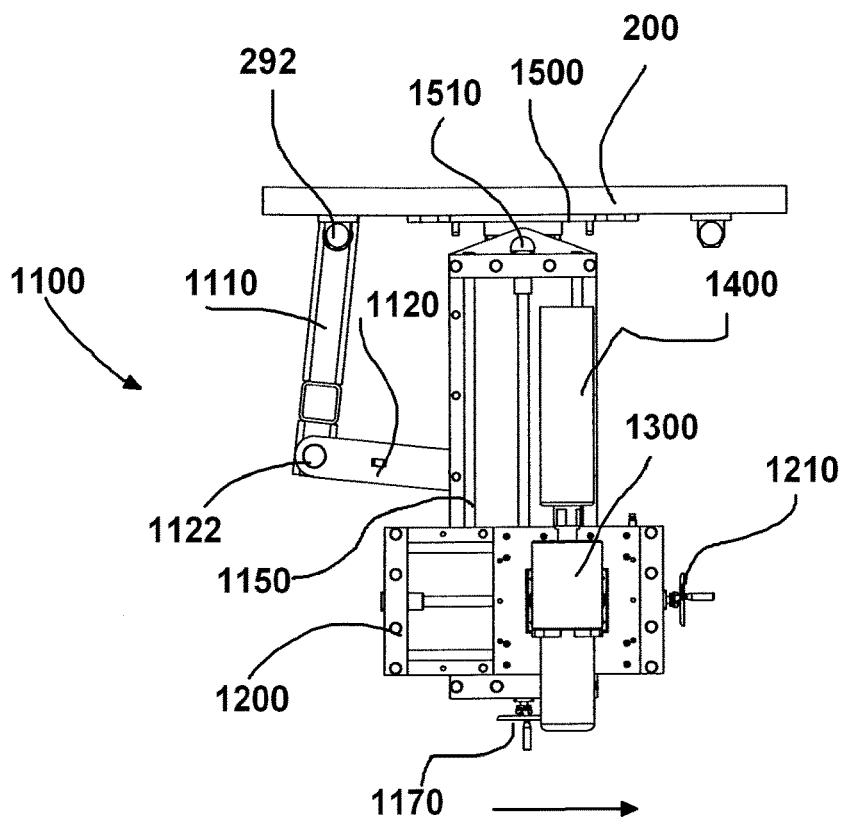
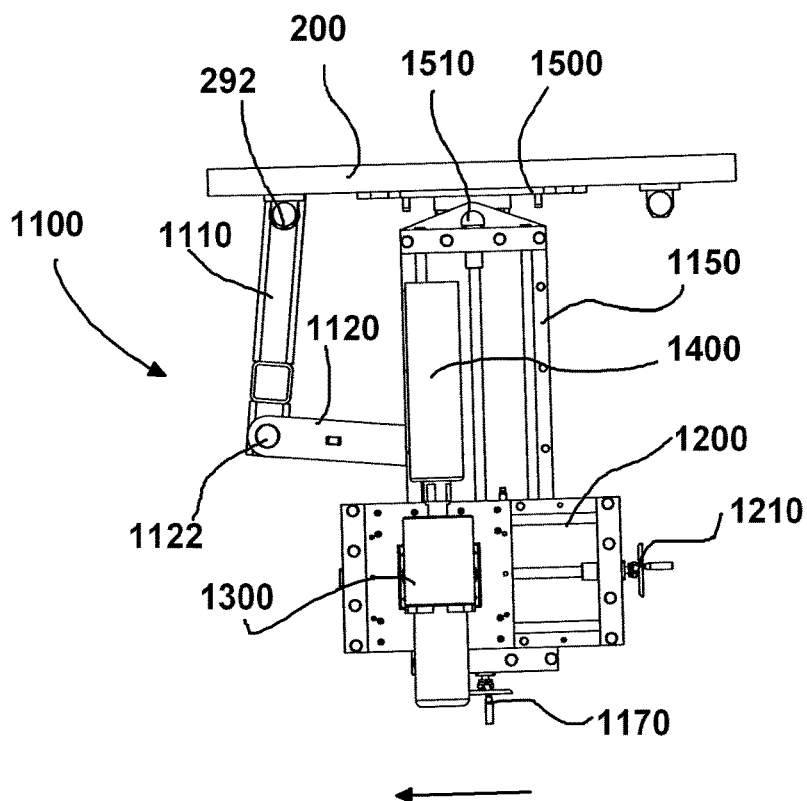


FIG. 42



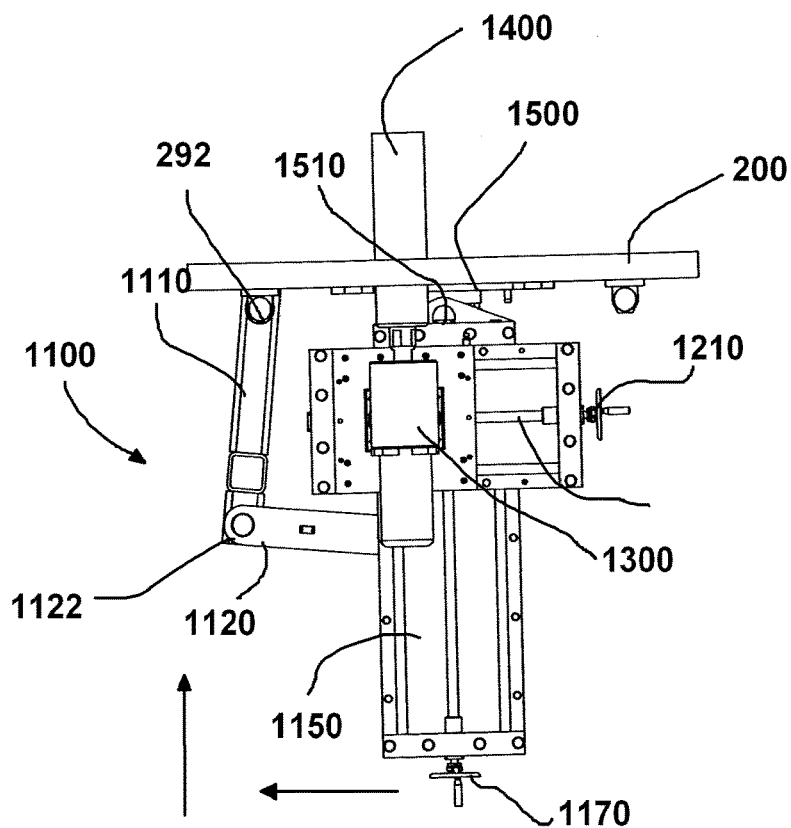


FIG. 45

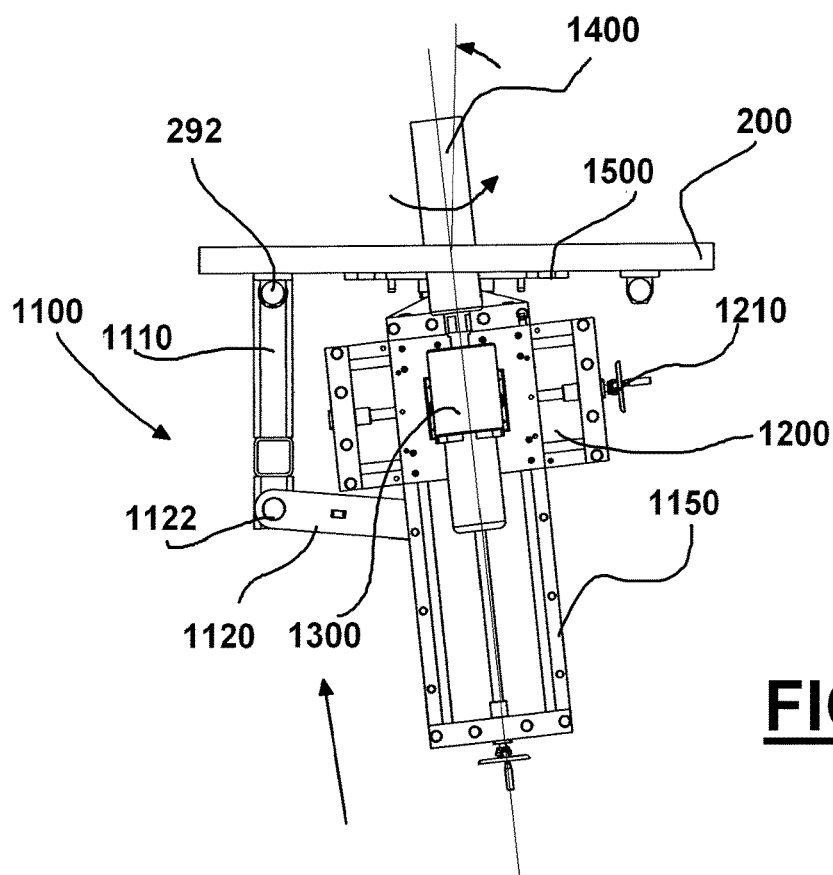


FIG. 46

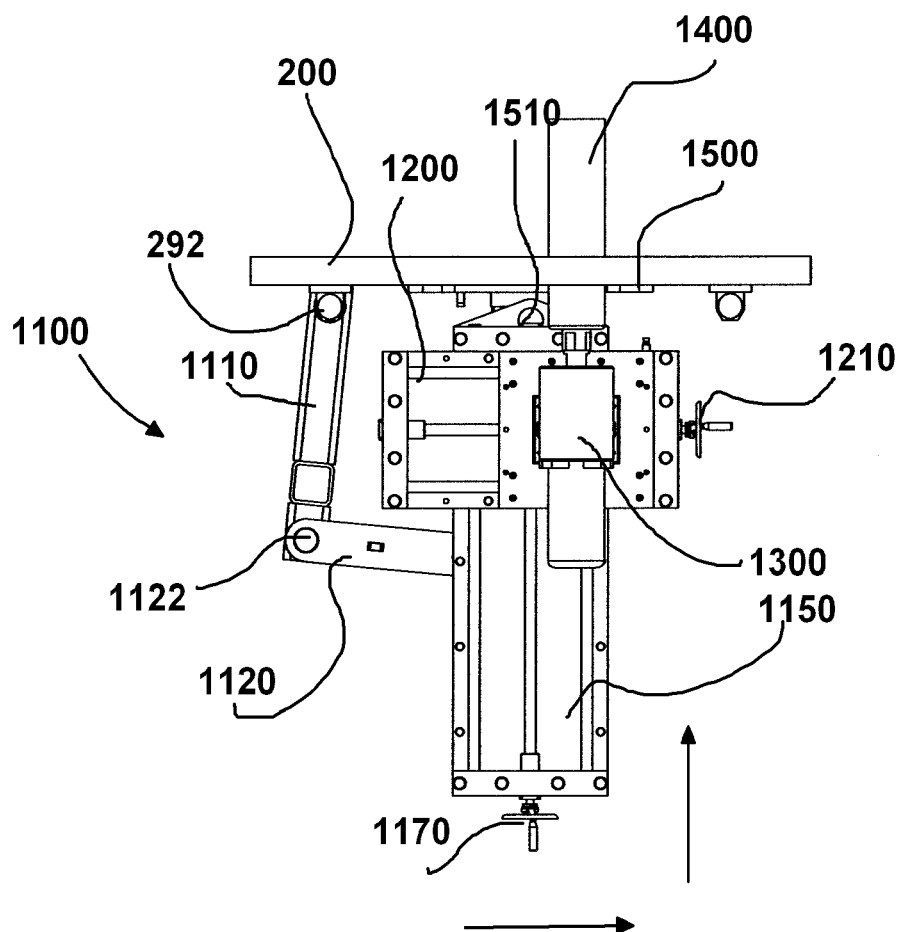


FIG. 47

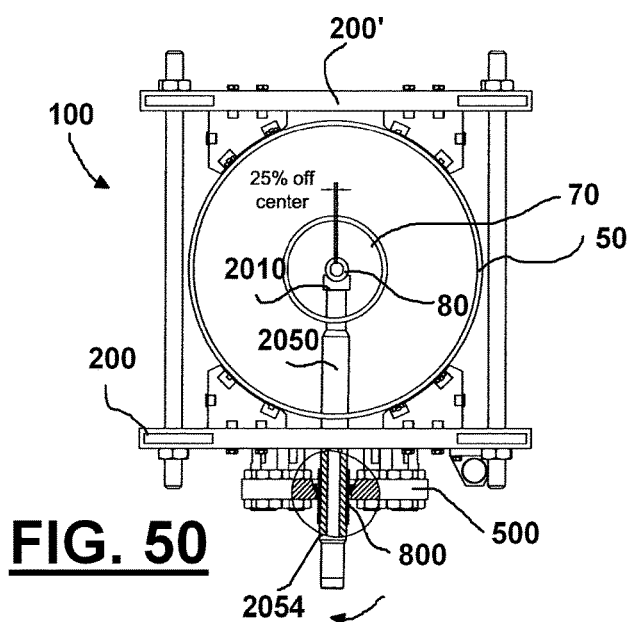


FIG. 50

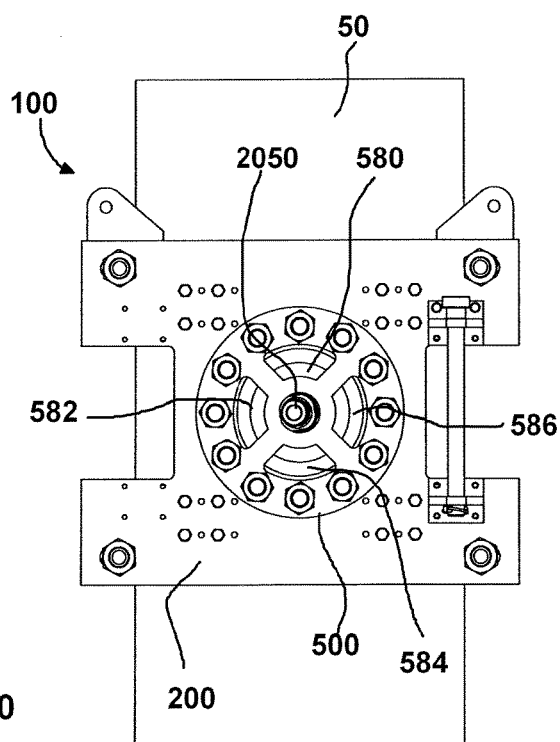


FIG. 49

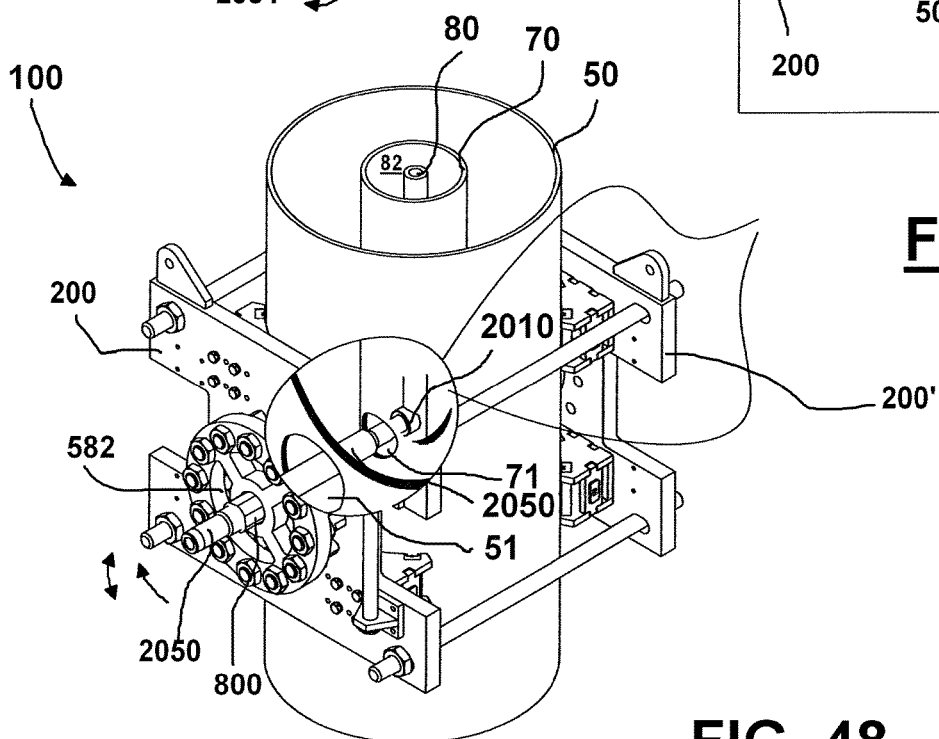


FIG. 48

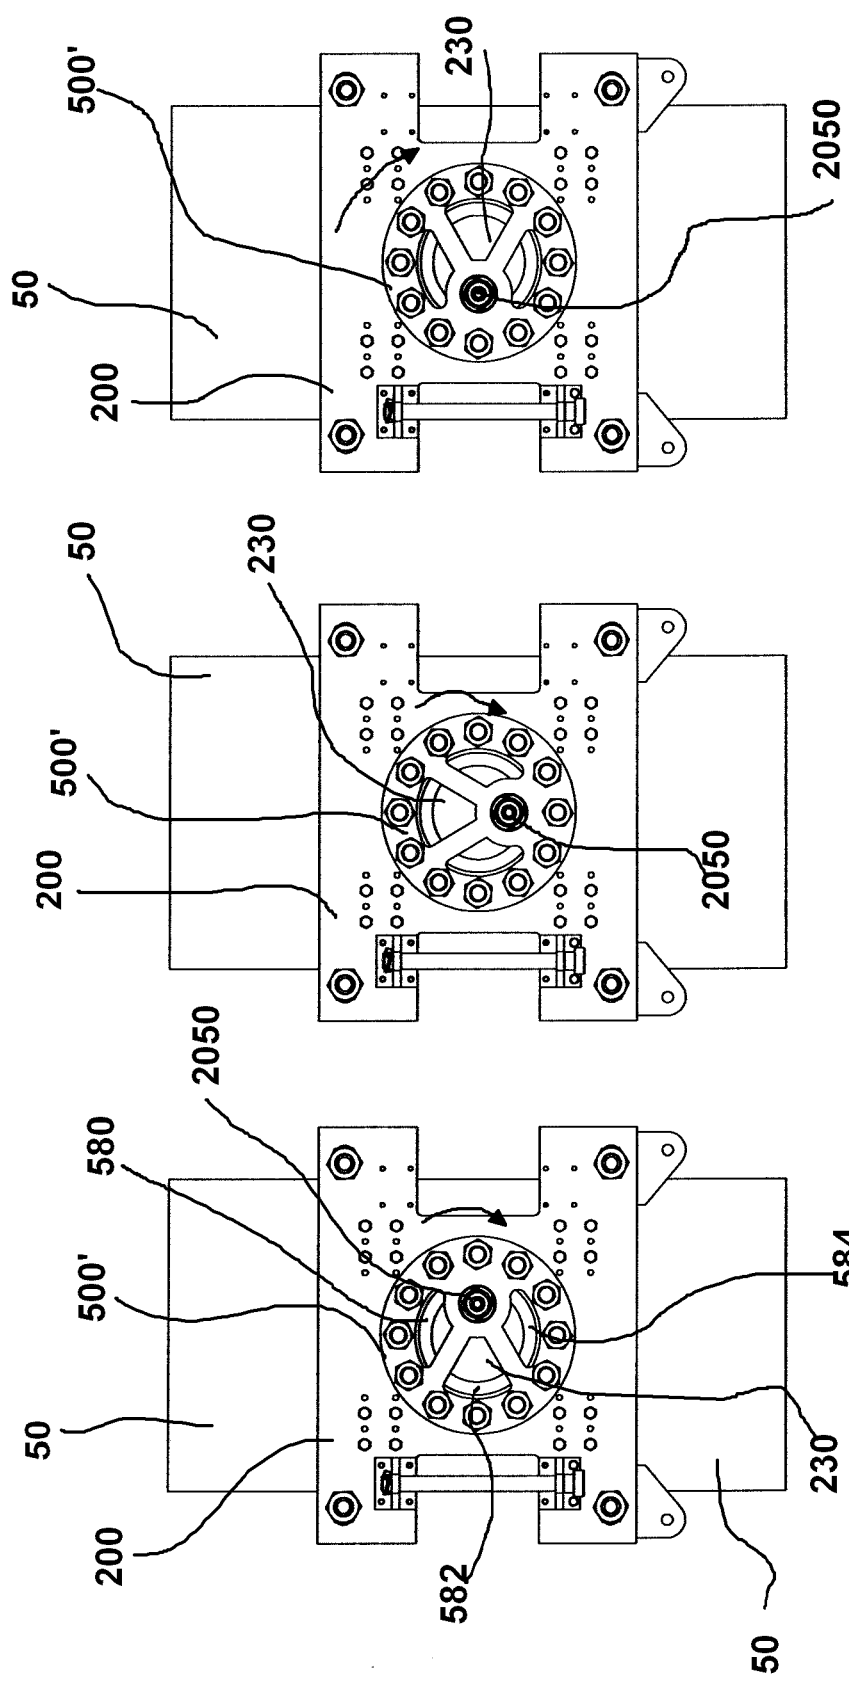


FIG. 53

FIG. 52

FIG. 51

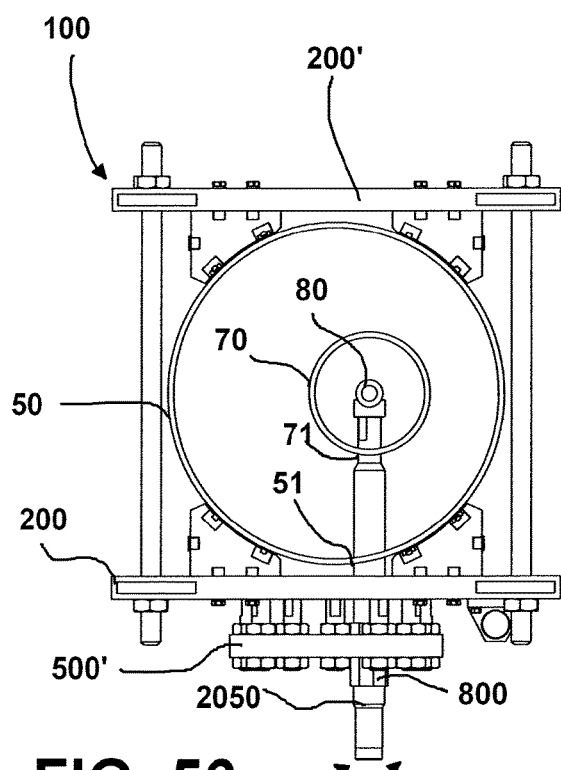


FIG. 56

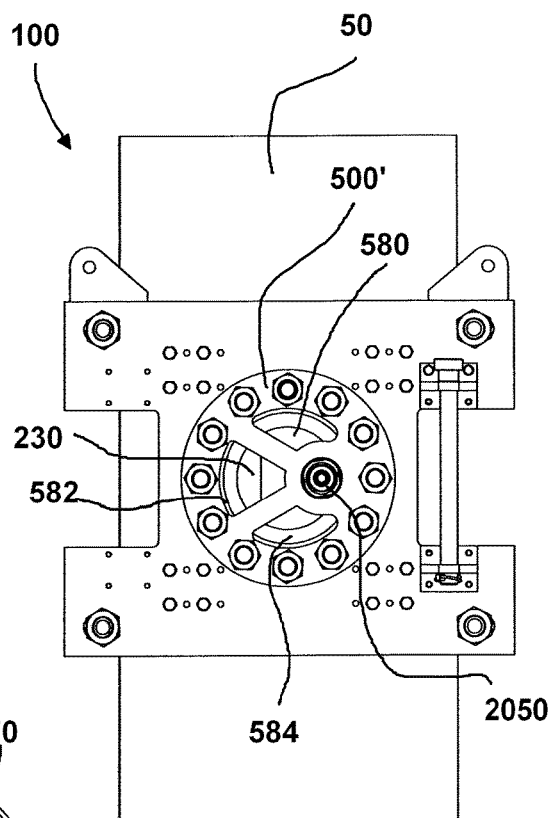


FIG. 55

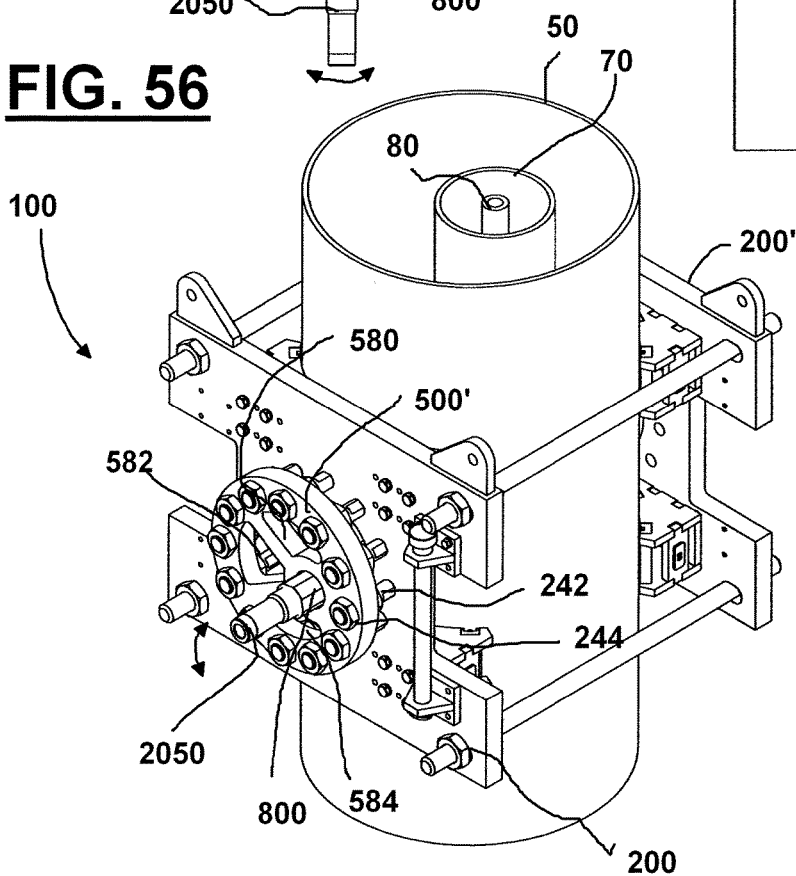
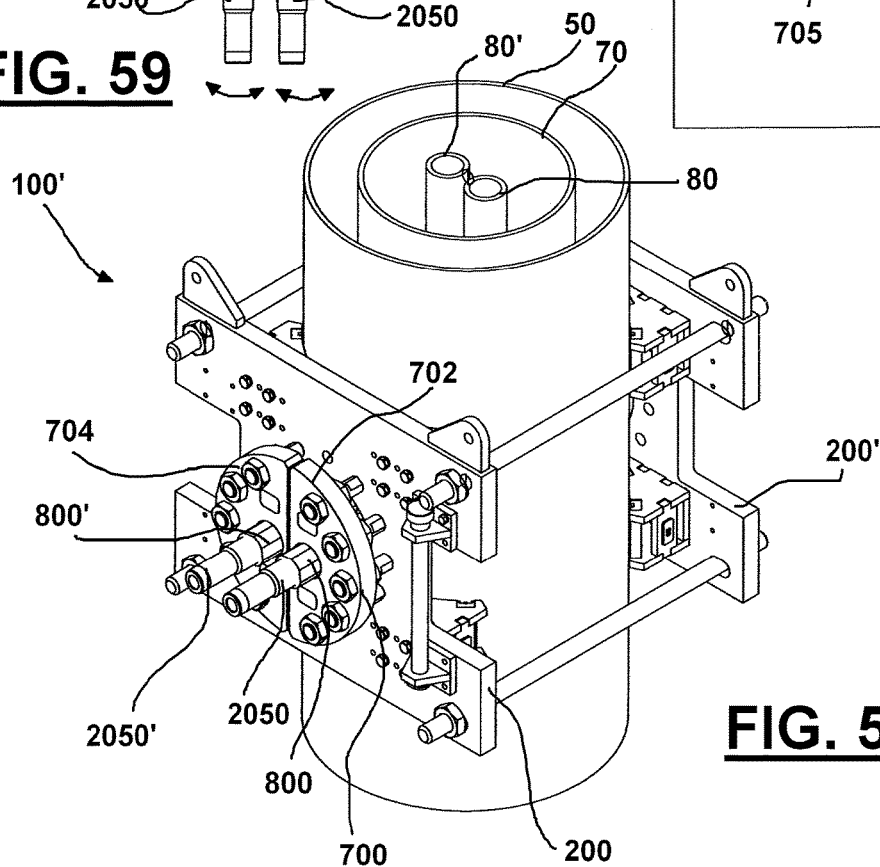
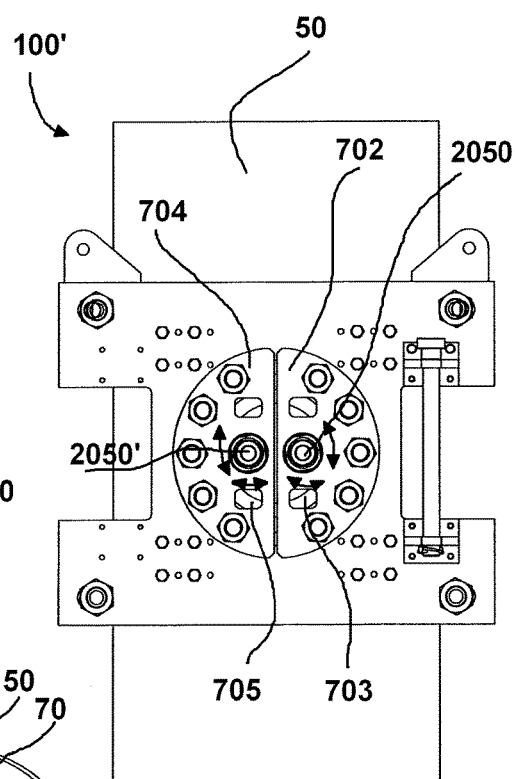
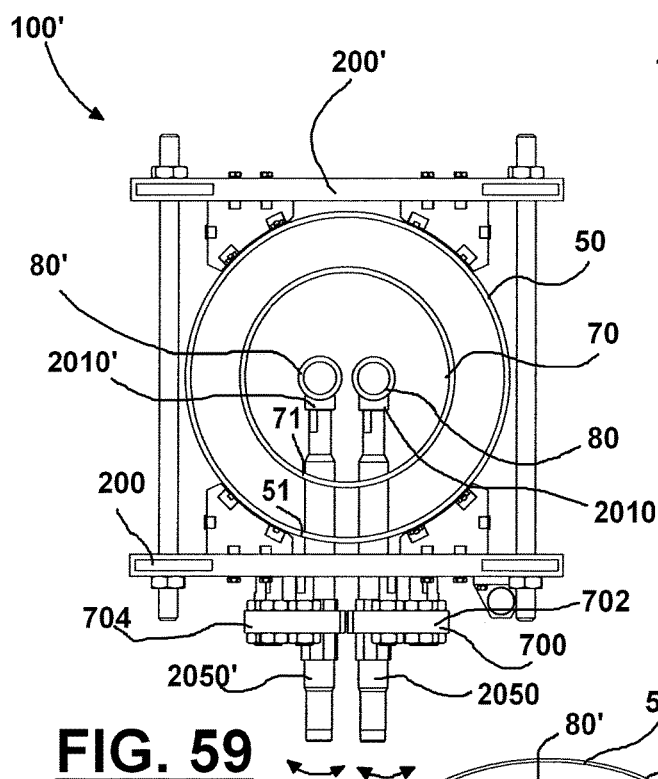


FIG. 54



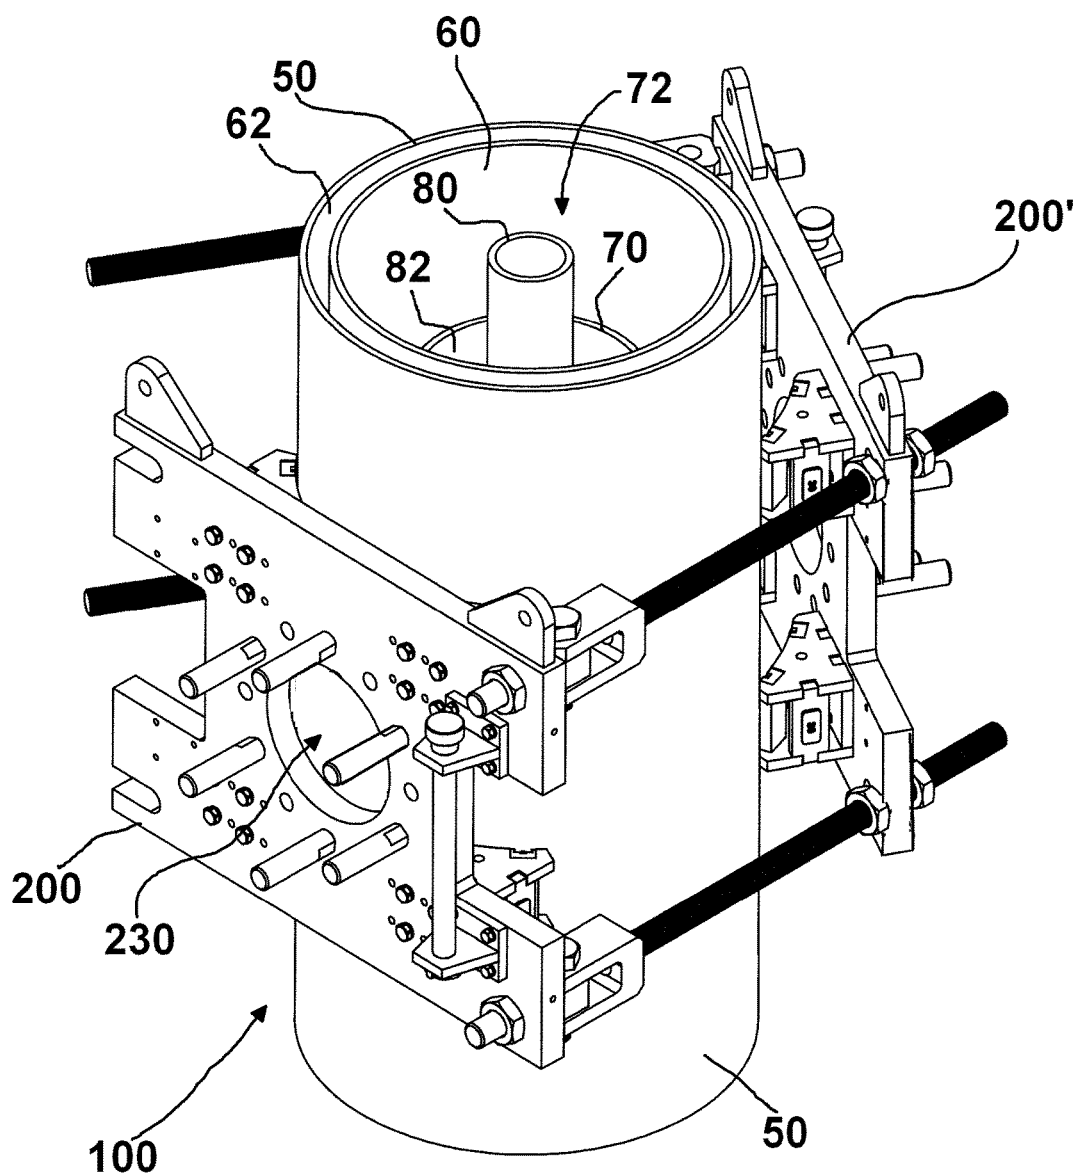


FIG. 60

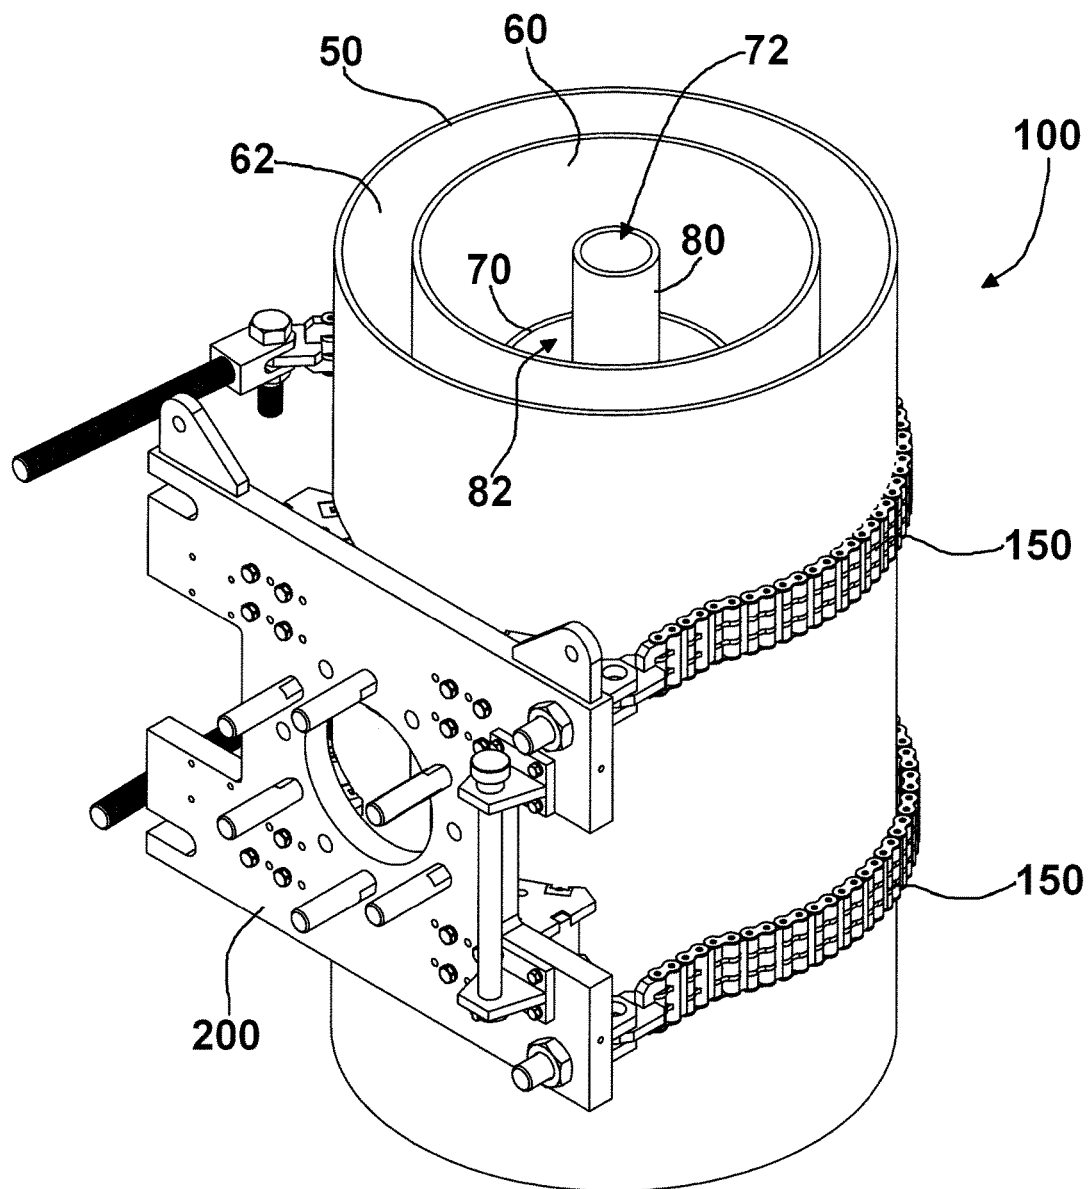


FIG. 61

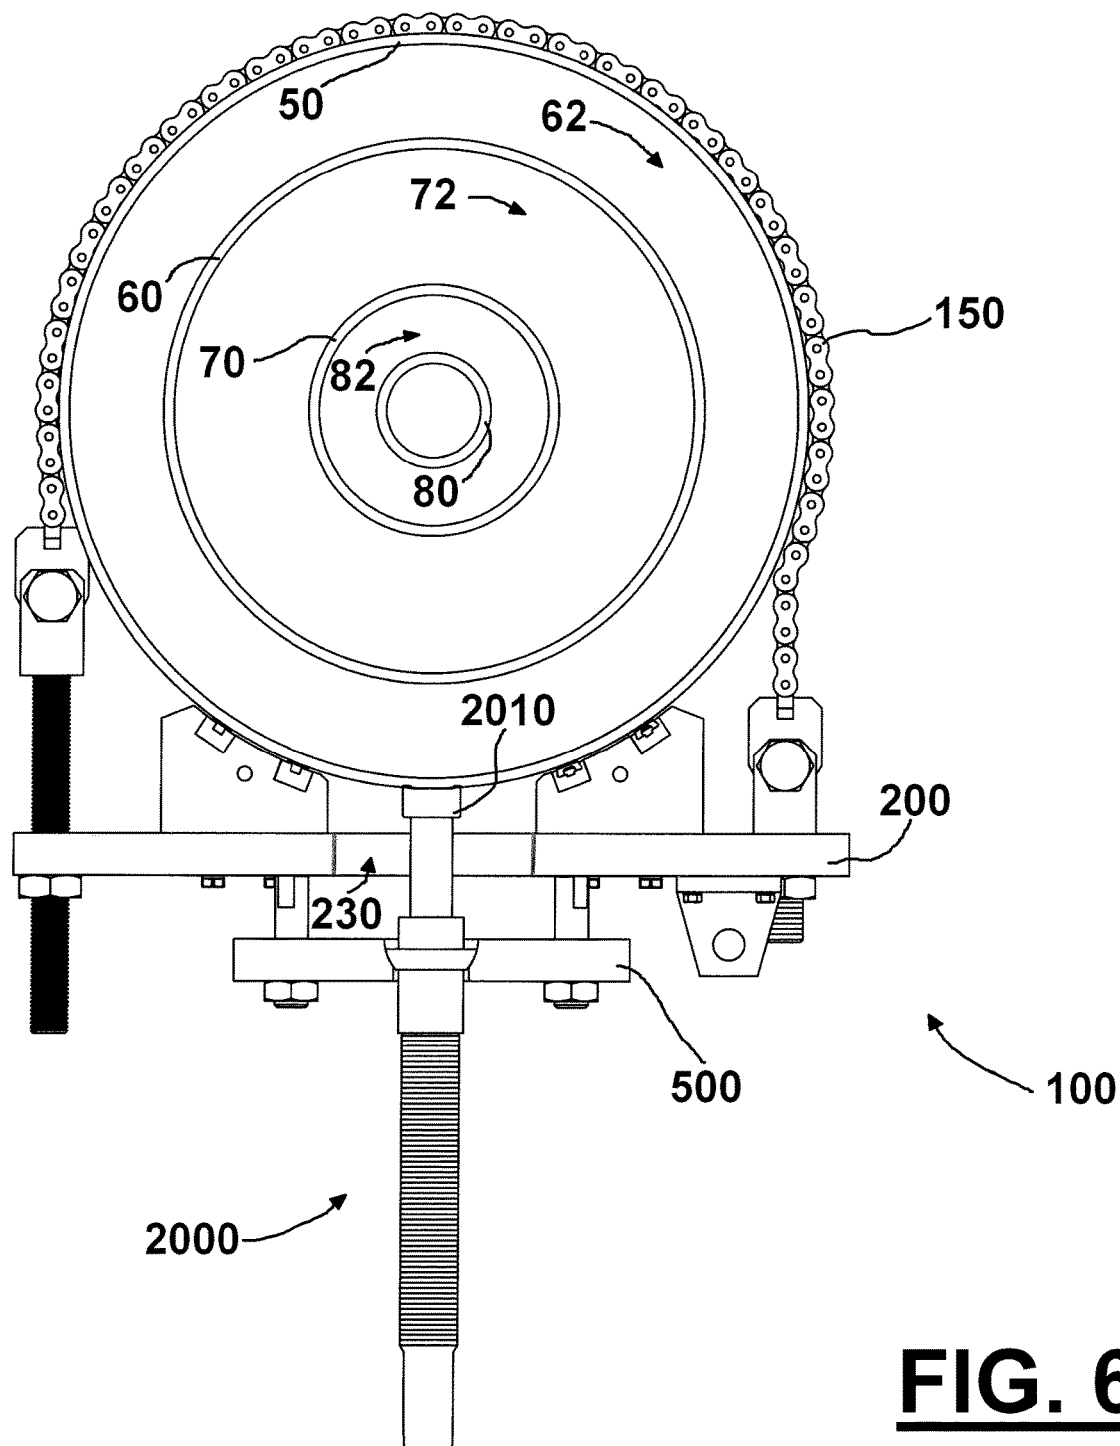


FIG. 62

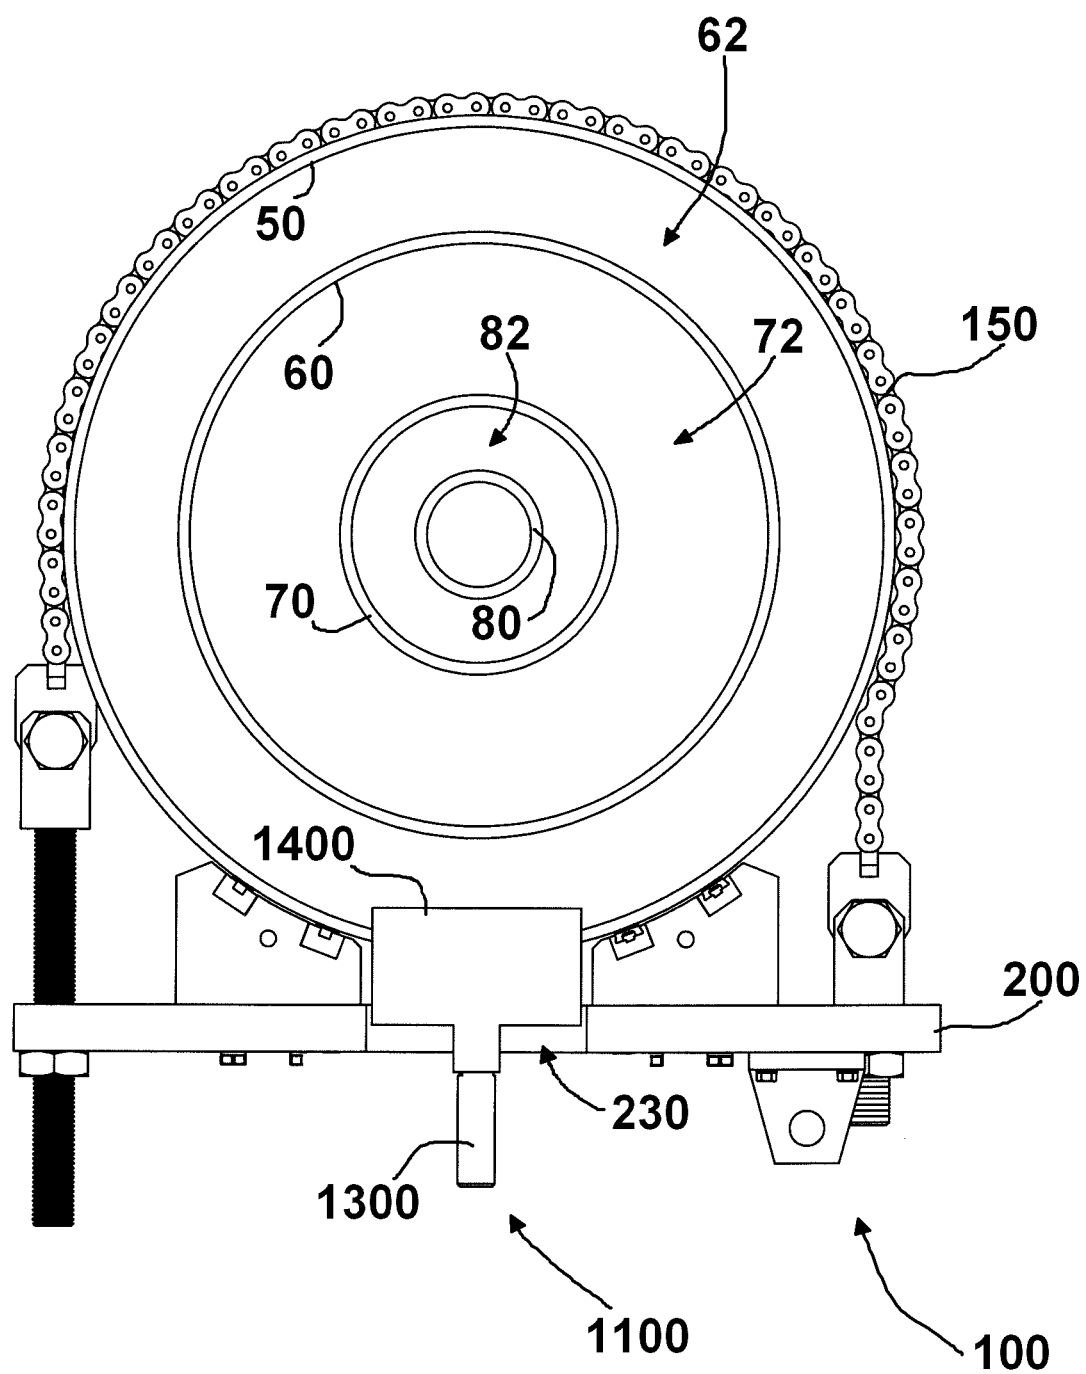


FIG. 63

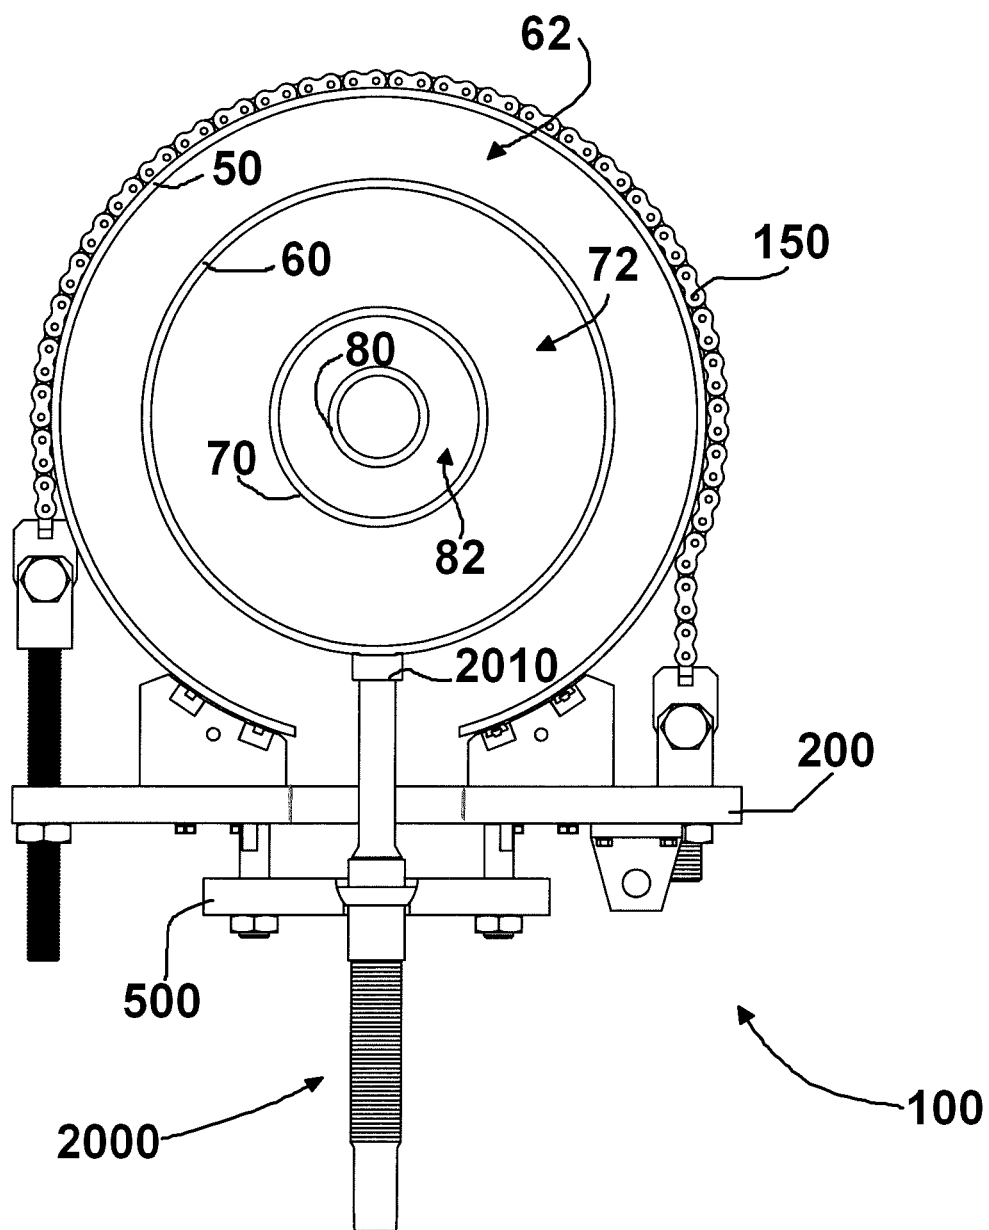


FIG. 64

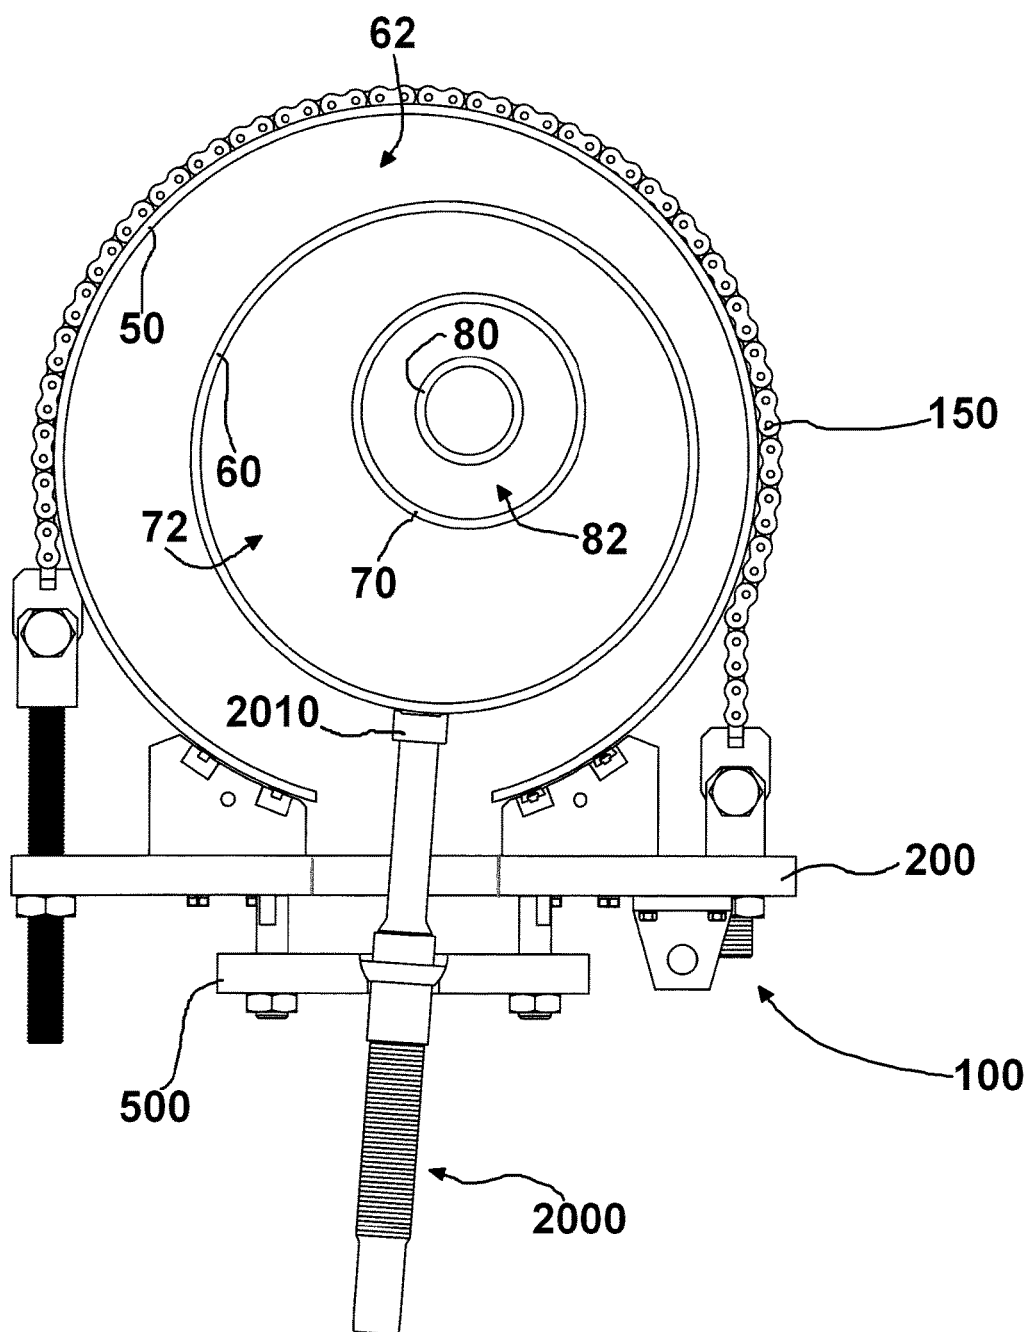


FIG. 65

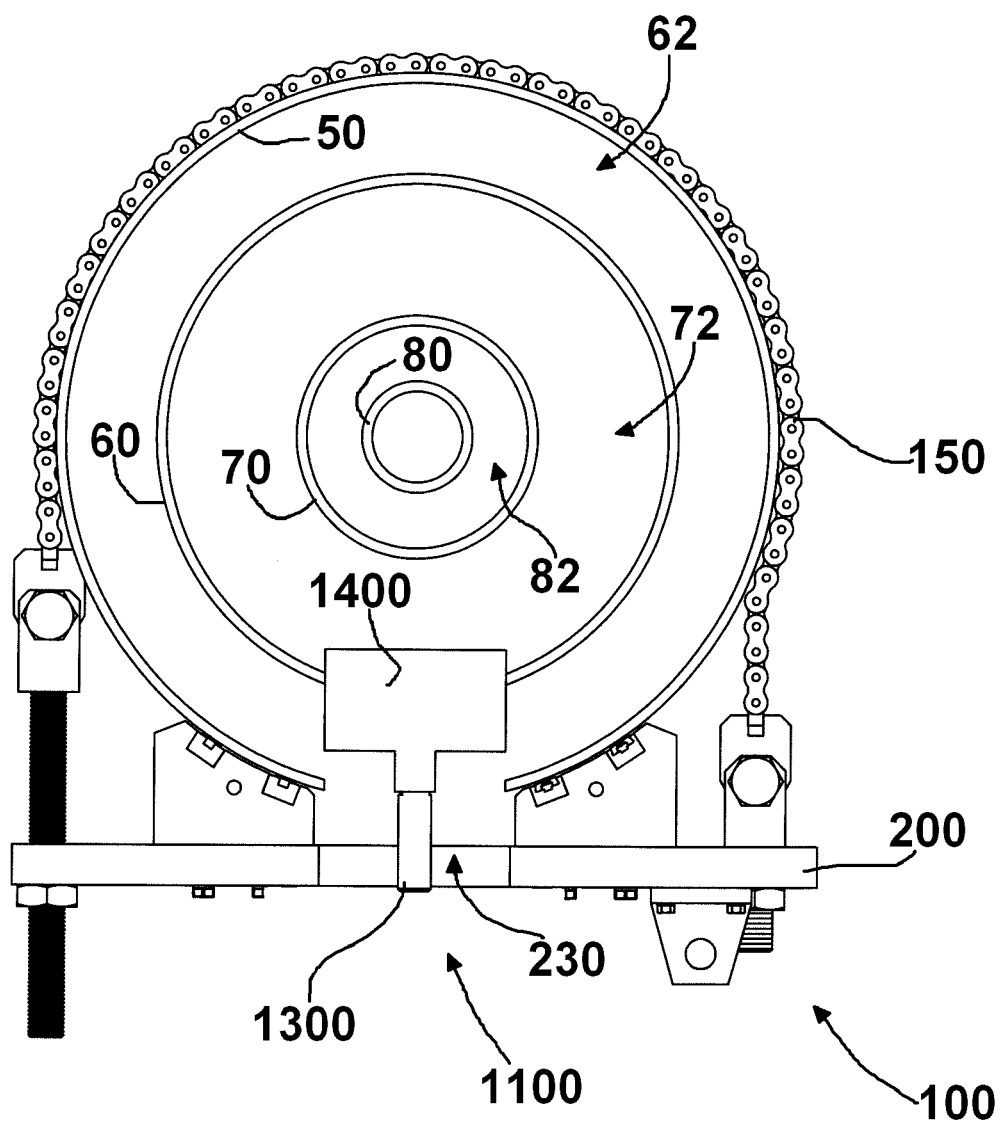


FIG. 66

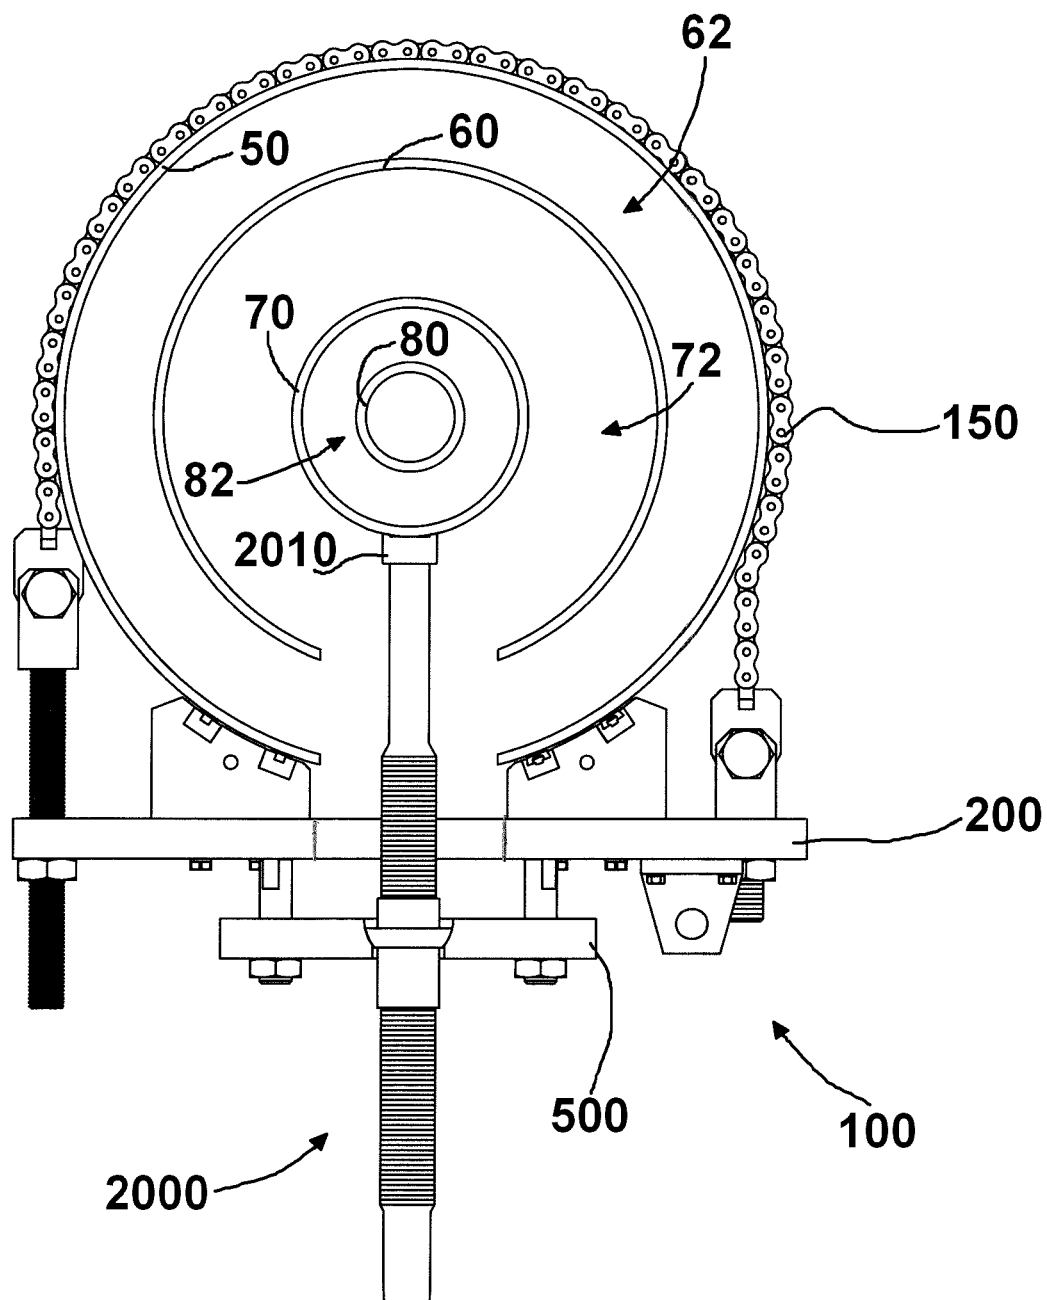


FIG. 67

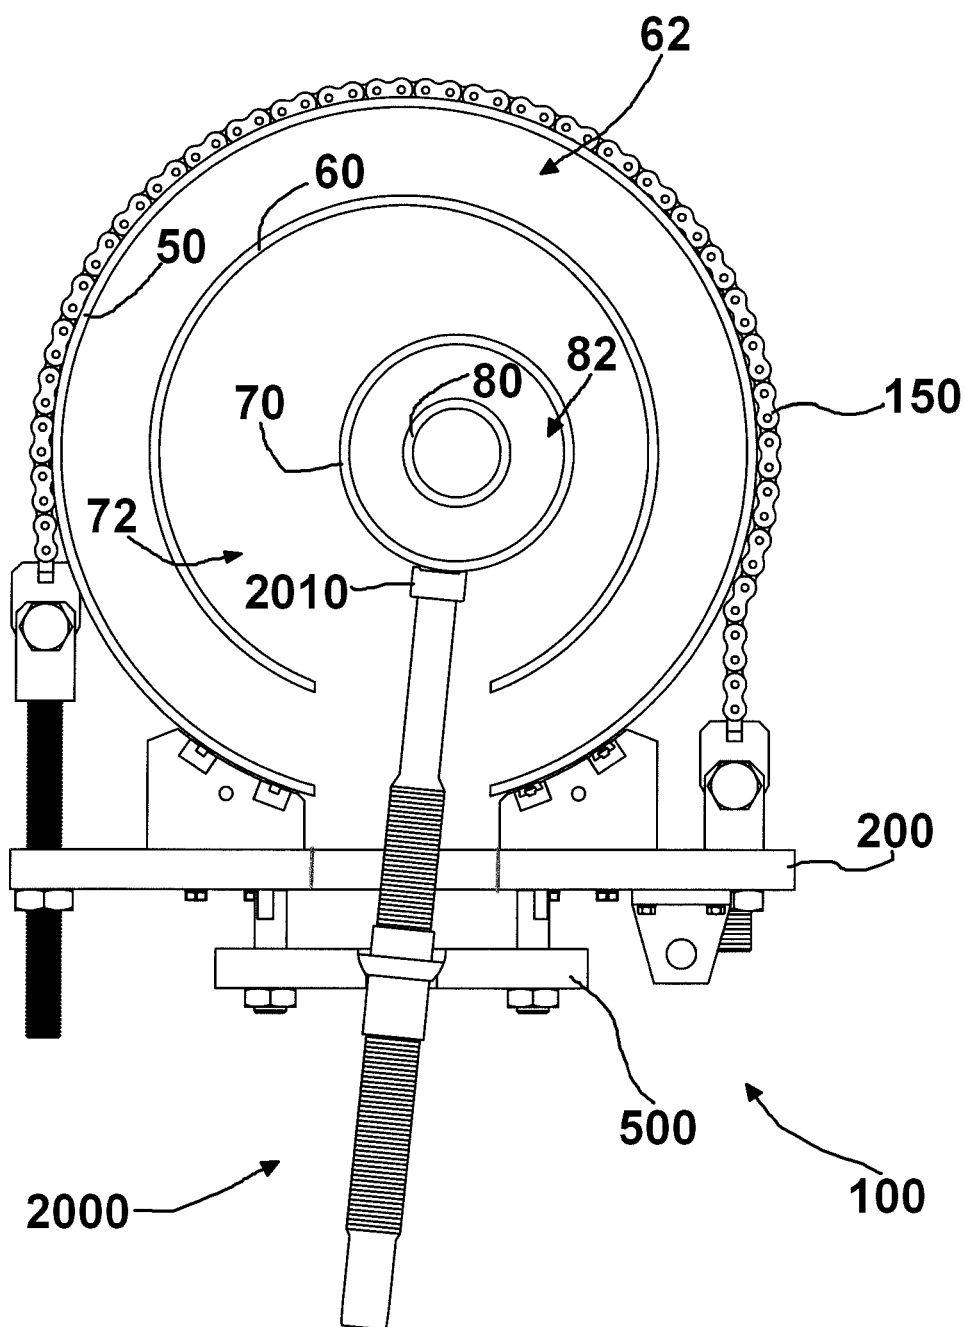


FIG. 68

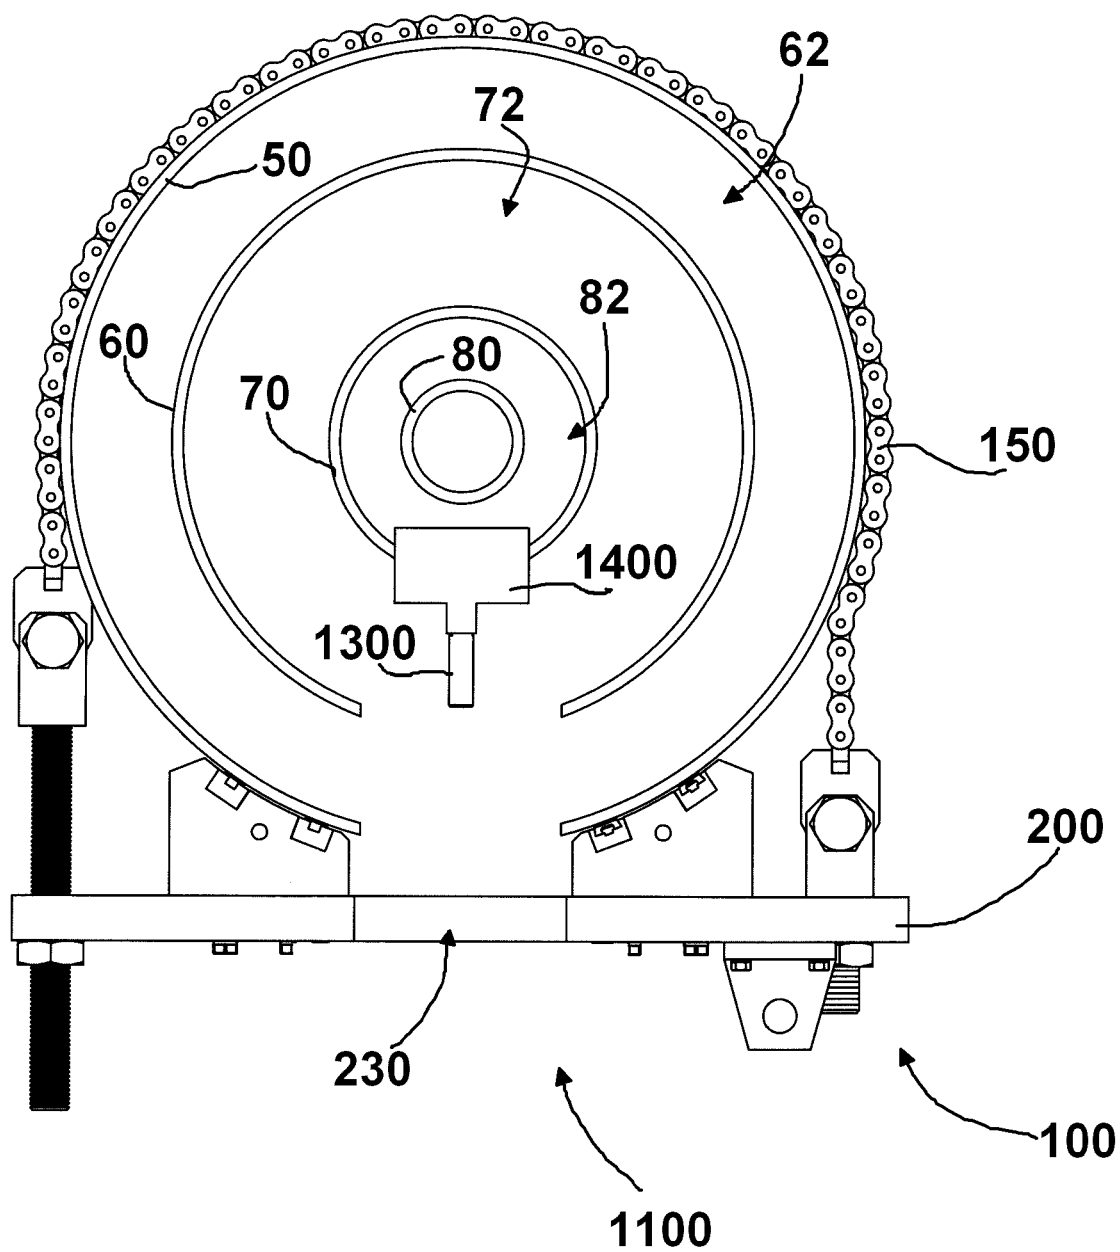


FIG. 69

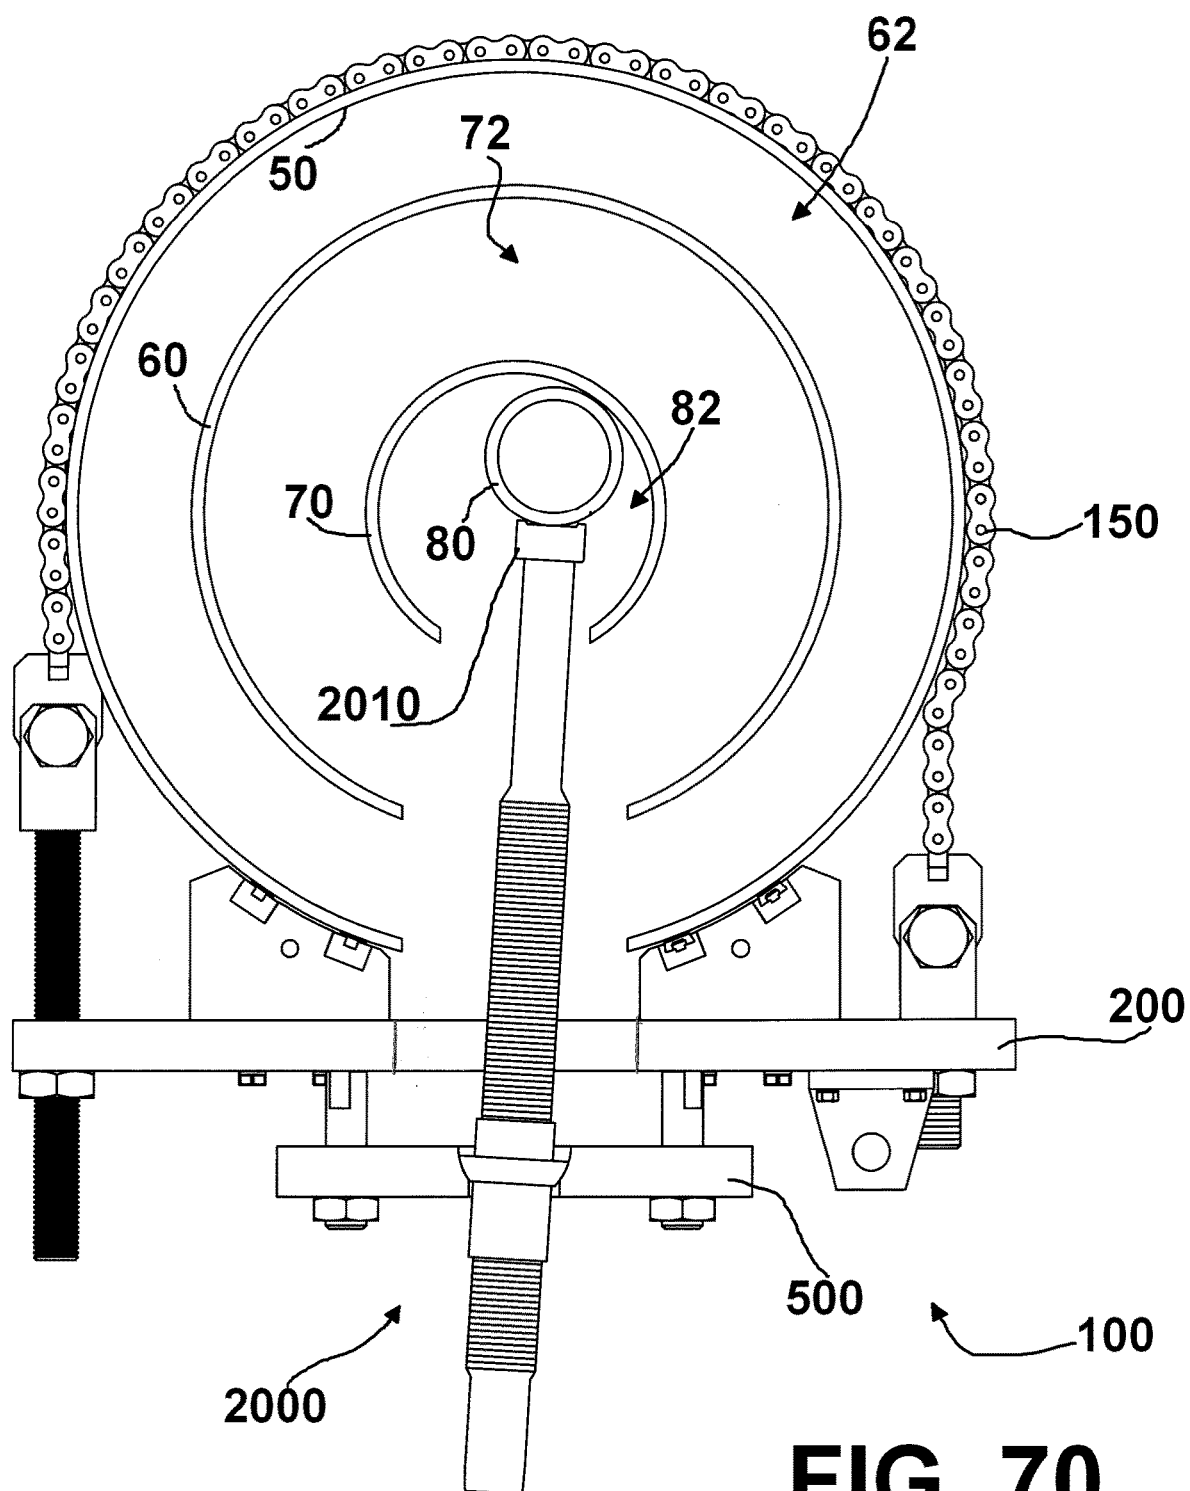


FIG. 70

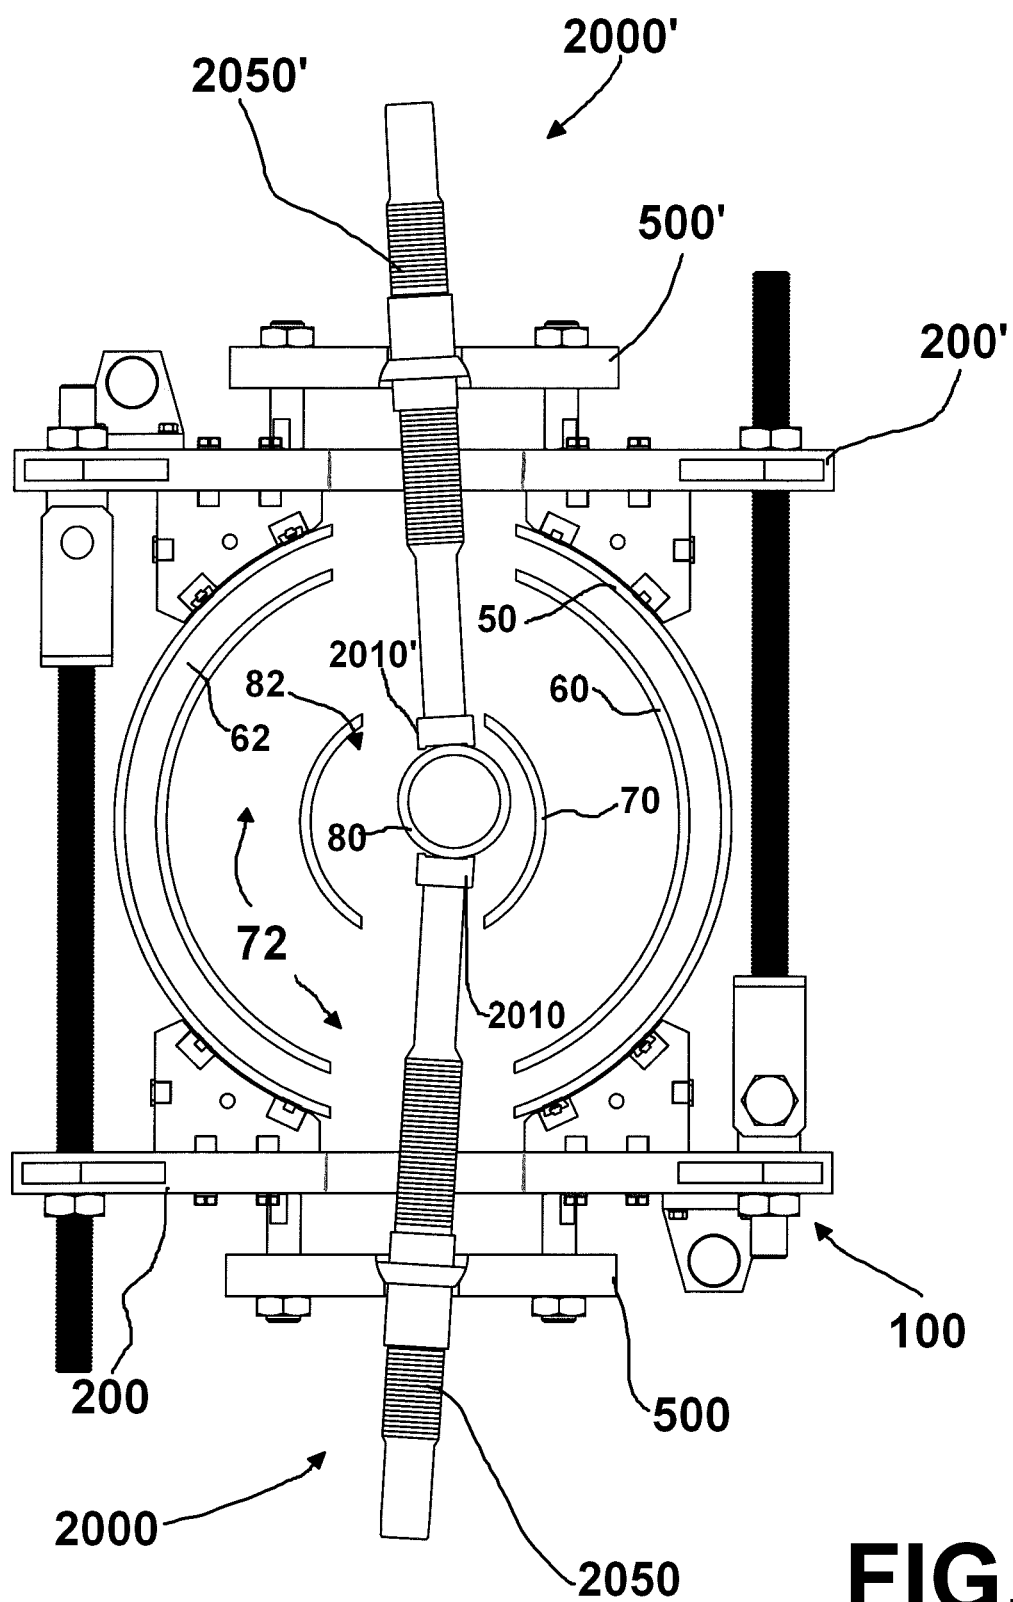


FIG. 71

**METHOD AND APPARATUS OF HOT
TAPPING MULTIPLE COAXIAL OR NESTED
STRINGS OF UNDERWATER PIPING
AND/OR TUBING FOR OVERTURNED
WELLS OR PLATFORMS**

CROSS-REFERENCE TO RELATED
APPLICATIONS

[0001] This application is a continuation of U.S. application Ser. No. 17/106,369, filed 30 Nov. 2020 (now U.S. Pat. No. 11,473,384 on 18 Oct. 2022), which is a continuation of U.S. application Ser. No. 16/377,431, filed 8 Apr. 2019 (now U.S. Pat. No. 10,851,605 on 1 Dec. 2020), which is a continuation of U.S. application Ser. No. 15/853,613, filed 22 Dec. 2017 (now U.S. Pat. No. 10,253,587 on 9 Apr. 2019), which is a continuation of U.S. application Ser. No. 14/950,908, filed 24 Nov. 2015 (now U.S. Pat. No. 9,851,038 on 26 Dec. 2017), which is a continuation of U.S. application Ser. No. 14/263,088, filed 28 Apr. 2014 (now U.S. Pat. No. 9,194,525 on 24 Nov. 2015), which is a continuation of U.S. application Ser. No. 13/717,890, filed 18 Dec. 2012 (now U.S. Pat. No. 8,707,979 on 29 Apr. 2014) which is a continuation of U.S. application Ser. No. 13/248,781, filed 29 Sep. 2011 (now U.S. Pat. No. 8,333,211 on 18 Dec. 2012) which is a continuation of PCT Patent Application serial number PCT/US2010/029389, with international filing date 31 Mar. 2010, which PCT application claimed priority of (and is a non-provisional of) U.S. Provisional patent application Ser. No. 61/165,475, filed 31 Mar. 2009. Priority of each of these applications is hereby claimed and each is expressly incorporated herein by reference.

STATEMENT REGARDING FEDERALLY
SPONSORED RESEARCH OR DEVELOPMENT

[0002] Not applicable

REFERENCE TO A "MICROFICHE APPENDIX"

[0003] Not applicable

BACKGROUND

[0004] Abandonment Procedure for wells on a platform that has fallen over. There are basically two ways to restore control of the wells on a platform that has fallen over. Abandon the wells completely in the order they are accessed, or remove the bent or broken portion of the well and install a subsea wellhead. However, when removing the bent or broken part of the pipe such piping may still be under pressure such pressure dealt with before removal. Otherwise, a blow out could occur.

[0005] The present invention relates to the hot tapping multiple coaxial strings of underwater piping and/or tubing for overturned wells and/or platforms.

[0006] Under pressure drilling or hot tapping is the process of drilling into a pressured pipe or vessel using special equipment and procedures to ensure that the pressure and fluids are safely contained when access is made. The most common example of a hot tap is into a pressured pipeline. A typical hot tap assembly consists of a saddle assembly with a doughnut-type elastomer pack off, two outboard full-bore flanged valves, a tee assembly and the hot tapping device.

[0007] A conventional hot tap device has a polished rod and pack-off assembly which allows movement in the longitudinal direction, as well as rotation while maintaining a

seal. A drill bit is installed on the end of the polished rod to drill into the vessel. The means to turn the polished rod may be manual, or by air or hydraulic-generated torque. A threaded sleeve feeds the polish rod assembly and provides the force to resist the pressure area effect that would tend to blow out the polished rod.

SUMMARY

[0008] In one embodiment is provided a hot tapping method and apparatus which can hot tap one or more multiple coaxial strings of underwater piping and/or tubing for overturned wells and/or platforms.

[0009] In one embodiment is provided a clamping system which has angular adjustment of tapping tool both up and down and side to side, in a spherical manner.

[0010] In one embodiment the adjustable angular offset of hot tapping tool in the compression plate (**500** and/or **600**) can be at least about 0, 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, and 45 degrees from a perpendicular to compression plate. In one embodiment the adjustable angular offset is between about any two of the above specified angles. In one embodiment the angular offset is changed while the tool is attached to the outermost pipe or tubular. In one embodiment the angular offset is changed while the tool is attached to the outermost pipe or tubular and the clamp housing of the tool is not moved during the rotational adjustment.

[0011] In one embodiment the clamping system for the hot tapping tool can have a rotationally adjustable compression opening which can be rotationally adjustable in at least 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, 45, 50, 55, 60, 65, 70, 75, 80, 85, and 90 degree increments. In one embodiment the rotational adjustability is between about any two of the above specified angular increments. In one embodiment the rotational adjustment occurs while the tool is attached to the outermost pipe or tubular. In one embodiment the rotational adjustment occurs while the tool is attached to the outermost pipe or tubular and the clamp housing of the tool is not moved during the rotational adjustment.

[0012] In one embodiment one or more openings provide visual access to pipes and the area of hot tapping seal even while hot tapping tool is mounted on the clamp.

[0013] In one embodiment hot tapping tool can have one or more viewing windows to optically view the tip of the hot tapping tool even when the clamping system is attached to the clamping system and inserted into one or more nested tubulars. In one embodiment the two, three and four viewing windows are provided on a compression plate.

[0014] In one embodiment the hot tapping tool can have a longitudinally adjustable compression plate in which the rotationally adjustable swivel nut is operably attached. In one embodiment the swivel nut can be threadably connected to a hot tapping mandrel or barrel thereby providing two manners of longitudinally applying compression on the hot tapping tip of the hot tap tool (the first being a plurality of bolts and nuts along the circumference of the compression plate and the second being the threaded connection between the swivel nut and the barrel or mandrel).

[0015] In one embodiment is provided a method and apparatus where two hot tapping tools **2000**, **2000'** are simultaneously connected to a single clamp and two coaxial

ally nested pipes or tubulars are simultaneously hot tapped. In one embodiment each of the hot tapping tools simultaneously tapping nested tubulars are each independently angular adjustable to effect a hot tapping seal.

[0016] In one hot tapping system is mounted on a pipe which is substantially out of round in a non-symmetrical manner. In one embodiment, after jetting, system 10 is mounted below the sea floor on a substantially out of round pipe. In one embodiment the sea floor is jetted clear of pipe 30 between 1 and 30, 1 and 25, 1 and 20, 1 and 15, 1 and 14, 1 and 13, 1 and 12, 1 and 11, 1 and 10, 1 and 9, 1 and 8, 1 and 7, 1 and 6, and 1 and 5 feet. In one embodiment the sea floor is jetted clear of pipe 30 between 2 and 30, 2 and 25, 2 and 20, 2 and 15, 2 and 14, 2 and 13, 2 and 12, 2 and 11, 2 and 10, 2 and 9, 2 and 8, 2 and 7, 2 and 6, and 2 and 5 feet.

BRIEF DESCRIPTION OF THE SEVERAL VIEWS OF THE DRAWINGS

[0017] For a further understanding of the nature, objects, and advantages of the present invention, reference should be had to the following detailed description, read in conjunction with the following drawings, wherein like reference numerals denote like elements and wherein:

[0018] FIG. 1 is an overall perspective view of a platform which has fallen over and needs to be plugged and abandoned (with two riser piping systems although up to 24 or more riser piping systems can be seen).

[0019] FIG. 2 is a perspective view illustrating the step of lowering one embodiment of hot tap housing (two plate embodiment) and attaching the housing to one of the riser piping systems below the bend in the riser.

[0020] FIG. 3 is a perspective view illustrating the step of tightening the hot tap housing (two plate embodiment) below the bend in the riser.

[0021] FIG. 4 is a perspective view illustrating the step of lowering the hot tap tool along with the circular thrust/articulating plate and hot tap tip and housing which will be attached to the hot tap housing for hot tapping one or more of the nested tubulars.

[0022] FIG. 5 is a perspective view illustrating the step of hot tapping one or more of the nested tubulars where the hot tap tool is rotatively connected to the circular thrust/articulating plate at a selected rotational position. The one or more windows in the thrust plate allow the user to see the tip of the hot tap tool to obtain a good position between the hot tap tip and the nested tubular being hot tapped.

[0023] FIG. 6 is a closeup perspective view of the circular thrust/articulating plate after being connected to the hot tap housing at a different rotational position compared to the connection shown in FIG. 5.

[0024] FIG. 7 is a perspective view illustrating the step of lowering a saw and attaching the saw to the hot tap housing (shown in FIG. 8). The saw can be pivotally attached to the hot tap housing via a pin on one side and a support plate on another side (the saw also has an articulating and sliding support join for the rotating saw shaft).

[0025] FIG. 8 shows the saw attached to the hot tap housing and positioned to make a cut in one of the nested tubulars.

[0026] FIG. 9 is a closeup perspective view of a diver using the hot tap tool.

[0027] FIG. 10 is a perspective view of a diver using the articulating saw.

[0028] FIG. 11 is an overall perspective view of one embodiment showing a double plate saddle assembly with a single main opening compression plate.

[0029] FIG. 12 is a top view of the embodiment shown in FIG. 11.

[0030] FIG. 13 is a side wire frame side view of an embodiment showing the hot tapping of an inner tubing.

[0031] FIG. 14 includes front and top views of the embodiment shown in FIG. 13.

[0032] FIG. 15 shows rear and bottom views of the embodiment shown in FIG. 13.

[0033] FIG. 16 is a schematic top view of the embodiment shown in FIG. 11 illustrating the step of hot tapping of a first exterior pipe.

[0034] FIG. 17 is a schematic top view of the embodiment shown in FIG. 11 schematically illustrating the step of making an opening in the first exterior pipe.

[0035] FIG. 18 is a schematic top view of the embodiment shown in FIG. 11 illustrating the step of hot tapping of a second interior pipe.

[0036] FIG. 19 is a schematic top view of the embodiment shown in FIG. 11 illustrating the step of hot tapping of a second interior pipe where the hot tapping tool is angularly offset from a perpendicular to assist in making the hot tapping seal between the tip and the pipe.

[0037] FIG. 20 is a schematic top view of the embodiment shown in FIG. 11 schematically illustrating the step of making an opening in the second pipe.

[0038] FIG. 21 is a schematic top view of the embodiment shown in FIG. 11 illustrating the step of hot tapping of a third interior pipe.

[0039] FIG. 22 is a schematic top view of the embodiment shown in FIG. 11 schematically illustrating the step of making an opening in the third pipe.

[0040] FIG. 23 is a schematic top view of the embodiment shown in FIG. 11 illustrating the step of hot tapping of a fourth pipe or tubing where the hot tapping tool is angularly offset from a perpendicular to assist in making the hot tapping seal between the tip and the pipe.

[0041] FIG. 24 is a schematic top view of the embodiment shown in FIG. 11 illustrating the step of hot tapping of a fourth pipe or tubing where the hot tapping tool is angularly offset from a perpendicular to assist in making the hot tapping seal between the tip and the pipe, along with the step of using a second tool to provide support for the tubing when making a seal between the hot tapping tool and the tubing.

[0042] FIG. 25 is a rear view of one embodiment of a compression plate where the main opening is offset from the center with the plate having multiple view openings.

[0043] FIG. 26 is a sectional view of the compression plate of FIG. 25 taken through the line A-A.

[0044] FIG. 27 is a rear view of one embodiment of a compression plate where the main opening is not offset from the center with the plate have multiple view openings.

[0045] FIG. 28 is a sectional view of the compression plate of FIG. 27 taken through the line A-A.

[0046] FIG. 29 is a front view of one embodiment of piece of a two piece compression plate where the two piece compression plate has two main openings both of which are offset from the center.

[0047] FIG. 30 is a sectional view of the compression plate of FIG. 19 taken through the line A-A.

[0048] FIG. 31 is a side view of the compression plate of FIG. 29.

[0049] FIG. 32 is a side view of one embodiment of a swivel nut.

[0050] FIG. 33 is a rear view of the swivel nut of FIG. 32.

[0051] FIG. 34 is a sectional view of the swivel nut of FIG. 32 taken through the line A-A.

[0052] FIG. 35 is a perspective view of one embodiment of a detachable support foot.

[0053] FIG. 36 is a perspective view of one embodiment of a tip for the hot tapping tool.

[0054] FIG. 37 is a perspective view of the articulating drill system of the present invention where the system is swung away from the plate.

[0055] FIG. 38 is a perspective view of the articulating drill system of FIG. 37 here the system is connected to the plate, perpendicular to same and in the center of main plate opening.

[0056] FIG. 39 is a top view of the articulating drill system of FIG. 37.

[0057] FIG. 40 is a top view of the articulating drill system of FIG. 37 where the system is connected to the plate, perpendicular to same and in the center of main plate opening with the drill tip having passed through main plate opening.

[0058] FIG. 41 is a top view of the articulating drill system of FIG. 37 where the system is connected to the plate, perpendicular to same and in the center of main plate opening with the double arrow schematically indicating that drill tip can move back and forth through main plate opening.

[0059] FIG. 42 is a top view of the articulating drill system of FIG. 37 where the system is connected to the plate, angled from same and in the center of main plate opening with the two sets of double arrows schematically indicating that drill tip can move back and forth through main plate opening along with rotating back and forth.

[0060] FIG. 43 is a top view of the articulating drill system of FIG. 39 where the system is connected to the plate, perpendicular to same and offset in the left direction of the arrow from the center of main plate opening.

[0061] FIG. 44 is a top view of the articulating drill system of FIG. 39 where the system is connected to the plate, perpendicular to same and offset in the right direction of the arrow from the center of main plate opening.

[0062] FIG. 45 is a top view of the articulating drill system of FIG. 39 where the system is connected to the plate, perpendicular to same and offset in the left direction of the arrow from the center of main plate opening and the drill tip is passed through the main opening.

[0063] FIG. 46 is a top view of the articulating drill system of FIG. 39 where the system is connected to the plate, angled from a perpendicular to same as indicated by the arrows, where and the drill tip is passed through the main opening.

[0064] FIG. 47 is a top view of the articulating drill system of FIG. 39 where the system is connected to the plate, perpendicular to same and offset in the right direction of the arrow from the center of main plate opening and the drill tip is passed through the main opening.

[0065] FIG. 48 is a perspective view of the embodiment shown in FIG. 1 with cut outs made in two of the pipes/tubular to hot tap the innermost tubular.

[0066] FIG. 49 is a front view of FIG. 48.

[0067] FIG. 50 is a top view of FIG. 48.

[0068] FIGS. 51 through 53 show the eccentric compression plate with the main opening respectively at the 3, 6, and

9 O'clock positions to illustrate various modes of rotation adjustment of eccentric main opening.

[0069] FIG. 54 is a perspective view of the embodiment shown in FIG. 1 but with eccentric compression plate of FIG. 15 with main opening at the 3 O'clock position, and with cut outs made in two of the pipes/tubular to hot tap the innermost tubular.

[0070] FIG. 55 is a front view of FIG. 54.

[0071] FIG. 56 is a top view of FIG. 54.

[0072] FIG. 57 is a perspective view of the preferred embodiment, but with double main opening compression plate schematically indicating the simultaneous hot tapping of two pipes or tubulars with the same clamp.

[0073] FIG. 58 is a front view of FIG. 57.

[0074] FIG. 59 is a top view of FIG. 57.

[0075] FIG. 60 is a perspective view showing the two plate embodiment being placed on the riser piping system.

[0076] FIG. 61 is a perspective view showing the one plate and chain embodiment being placed on the riser piping system.

[0077] FIG. 62 is a schematic top view of the embodiment shown in FIG. 61 illustrating the step of hot tapping of a first exterior pipe.

[0078] FIG. 63 is a schematic top view of the embodiment shown in FIG. 61 schematically illustrating the step of making an opening in the first exterior pipe.

[0079] FIG. 64 is a schematic top view of the embodiment shown in FIG. 61 illustrating the step of hot tapping of a second interior pipe wherein the second interior pipe is concentrically located within the first pipe.

[0080] FIG. 65 is a schematic top view of the embodiment shown in FIG. 61 illustrating the step of hot tapping of a second interior pipe wherein the second interior pipe is non-concentrically located (angularly offset from a perpendicular) within the first pipe.

[0081] FIG. 66 is a schematic top view of the embodiment shown in FIG. 61 schematically illustrating the step of making an opening in the second pipe.

[0082] FIG. 67 is a schematic top view of the embodiment shown in FIG. 61 illustrating the step of hot tapping of a third interior pipe wherein the third interior pipe is concentrically located within the first pipe.

[0083] FIG. 68 is a schematic top view of the embodiment shown in FIG. 61 illustrating the step of hot tapping of a third interior pipe wherein the third interior pipe is non-concentrically located (angularly offset from a perpendicular) within the first pipe.

[0084] FIG. 69 is a schematic top view of the embodiment shown in FIG. 61 schematically illustrating the step of making an opening in the third pipe.

[0085] FIG. 70 is a schematic top view of the embodiment shown in FIG. 61 illustrating the step of hot tapping of a fourth pipe or tubing where the hot tapping tool is angularly offset from a perpendicular to assist in making the hot tapping seal between the tip and the pipe along with pushing the fourth pipe or tubing back, and to a location where it contacts the third interior pipe and enough backward resistance by the fourth pipe or tubing to maintain a good seal between the tip of the hot tap tool and the surface of the fourth pipe or tubing.

[0086] FIG. 71 is a schematic top view illustrating the step of hot tapping of a fourth pipe or tubing where the hot tapping tool is angularly offset from a perpendicular to assist in making the hot tapping seal between the tip and the pipe,

along with the step of using a second tool to provide support for the tubing when making a seal between the hot tapping tool and the tubing.

DETAILED DESCRIPTION

[0087] FIG. 1 shows a damaged marine platform 1. The platform 1 can be any offshore or marine platform such as a drilling platform, production platform or the like. such a platform is normally supported by an underwater jacket 4 that is anchored to seabed 2. When a fierce storm such as a hurricane strikes, the upper 5 can be separated from jacket 4 by wind and wave action at water surface area 3. Upper 5 can be any known above water upper such as drilling (e.g. derrick 7) or production structures having one or more decks 6.

[0088] When a hurricane separates upper 5 from jacket 4, tubulars 50 can remain under pressure though bent at bends 8 as shown. Often, multiple nested tubulars are present (see FIGS. 11-24 and 60-71).

[0089] One embodiment includes a method and apparatus 10 for hot tapping a string of a plurality of coaxially pipes or tubing systems. The plurality of pipes can include first pipe 50, second pipe 60, third pipe 70, and fourth pipe or tubing 80. Between first and second pipes is annular space 62. Between second and third pipes is annular space 72. Between third and fourth pipes is annular space 82 (see FIGS. 16 and 60-71).

[0090] In one embodiment system 10 can include adjustable clamp 100 (see FIGS. 2-24). In one embodiment adjustable clamp 100 can include first and second plates 200, 200' and are threadably connected to each other and can be frictionally connected to a pipe. In one embodiment first and second plates 200, 200' are structurally identical to each other and only one will be described below.

[0091] FIG. 2 is a perspective view illustrating the step of lowering one embodiment of hot tap housing 100 (two plate embodiment) and a diver 9 attaching the housing to one of the riser piping systems (e.g. nested tubulars 50, 60, 70, 80) below the bend 8 in the riser 50, 60, 70, 80. FIG. 3 is a perspective view illustrating the step of the diver 9 tightening the hot tap housing 100 (two plate embodiment) below the bend in the riser. FIG. 4 is a perspective view illustrating the step of lowering to a diver 9 (from a surface vessel, not shown) the hot tap tool 2000 along with the circular thrust/articulating plate and hot tap tip and housing which will be attached to the hot tap housing 100 for hot tapping one or more of the nested tubulars 50, 60, 70, 80.

[0092] FIG. 5 is a perspective view illustrating the step of a diver 9 hot tapping one or more of the nested tubulars 50, 60, 70, 80 where the hot tap tool is rotatively connected to the circular thrust/articulating plate at a selected rotational position. The one or more windows in the thrust plate allow the user (e.g. diver 9) to see the tip of the hot tap tool 2000 to obtain a good position between the hot tap tip and the nested tubular 50 or 60 or 70 or 80 being hot tapped.

[0093] FIG. 6 is a closeup perspective view of the circular thrust/articulating plate after being connected to the hot tap housing 100 at a different rotational position compared to the connection shown in FIG. 5. FIG. 7 is a perspective view illustrating the step of lowering a saw 1100 to a diver 9.

[0094] One embodiment includes a method and apparatus for hot tapping a string of a plurality of coaxially pipes or tubing systems.

[0095] The plurality of pipes can include first pipe 50, second pipe 60, third pipe 70, and fourth pipe or tubing 80. Between first and second pipes is annular space 62. Between second and third pipes is annular space 72. Between third and fourth pipes is annular space 82.

[0096] In one embodiment system 10 can include adjustable clamp 100. In one embodiment adjustable clamp 100 can include first and second plates 200, 200' and are threadably connected to each other and can be frictionally connected to a pipe. In one embodiment first and second plates 200, 200' are structurally identical to each other and only one will be described below.

[0097] In one embodiment first plate 200 can comprise first side 210, second side 220, a main opening 230, and a plurality of openings 240 for supporting a compression plate. Main opening 230 is designed to allow access through first plate 200 (from first side 210 and through second side 220).

[0098] Detachably connectable to first plate 200 can be a plurality (and preferably four (4)) support feet 350, 360, 370, 380 (see FIGS. 11-24 and 35). Each support foot can be structurally the same and only one will be described below. In one embodiment each support foot can include a base 390 and a curved surface 392. Preferably the curved surface will have substantially the same radius of curvature of the pipe to which surface 392 will contact. In one embodiment a traction system is included on curved surface 392, and can include traction bar 394 and traction bar 396. In one embodiment one or more of the traction bars can be detachable connected to curved surface 392.

[0099] In one embodiment one or more of the support feet can be detachably connectable to first plate 200. In one embodiment such detachable connection can be by means of a plurality of fasteners. In one embodiment support feet 350, 360, 370, 380 can respectively be detachably attached to sets of foot support openings 250, 260, 270, 280. In one embodiment support plate 200 includes at least one additional set of support openings 252, 262, 272, 282 to provide adjustability of position of attachment of the particular support feet. In one embodiment two or more additional sets of support openings are provided. In one embodiment a plurality of different sized support feet with differing radii of curvature are also provided. By providing different sized support feet with differing radii of curvature along with provided multiple positioned support openings, attachment of a large range of pipes can be made with first and second plates 200, 200'. In one embodiment the same support plates 200, 200' can be used with multiple sized piping systems.

[0100] In one embodiment support feet 350, 360, 370, 380 can be slidably connected to support plate 200. Although not shown in the drawings, sliding connection can be by means of attachment slots instead of support openings 250, 260, 270, 280 with fasteners being used to lock in place the desired location.

[0101] In one embodiment clamp 100 with support feet 350, 360, 370, 380 and support feet 350', 360', 370', 380' can be used to attach clamp to a first pipe 50 that is substantially non-symmetrically out of round. In one embodiment the system will be used on pipes 50 that are part of a well or platform that has collapsed or fallen over. Because it has collapsed or fallen over such first or outer pipe can be substantially misshapen. In the prior art system a substantially smooth curved support plate is used which has difficulty attaching to out of round piping systems—especially

those that are not symmetrical. However, it is believed that a substantially stable connection can be made when any three of the four support feet **350, 360, 370, 380** contact the outer surface of first pipe **50**. In this manner one embodiment of clamp **100** can be used to attach to non-symmetrically out of round piping. In another embodiment support feet **350, 360, 370, 380** can be placed in non-symmetrical positions **250, 262** (instead of **260**), **270, 280**. In another embodiment support feet **350, 360, 370, 380** can be of differing sizes (e.g., radii of curvature) to accommodate the non-symmetrical out of roundness of first pipe **50**.

[0102] In one embodiment one or more of the annular spaces **62, 72**, and/or **82** can be monitored by the divers operating the system **10**. In one embodiment a video of the hot tapping, drilling, and/or cutting operations can be taken including viewing the annular spaces **62, 72**, and/or **82** during such hot tapping, drilling, and/or cutting operations thereby allowing remote monitoring of such operations by operators on the surface of the water.

Compression Plate Embodiments

[0103] In one embodiment compression plate **500** can be detachably connected to first plate **200** (see FIGS. **4-6, 9**, and **11-28**). In one embodiment compression plate can comprise first and second sides **510, 520** along with a main opening **550**. In one embodiment main opening **550** can include a tapered area **560**. In one embodiment main opening **550** can be offset **552** from center point of compression plate **500**. In one embodiment compression plate **500** can include a plurality of viewing openings **580, 582, 584**. In one embodiment a fourth viewing area **586** can be provided such as when main opening does not have an offset **552**.

[0104] In one embodiment one or more openings provide visual access to pipes and the area of hot tapping seal even while hot tapping tool is mounted on the clamp. In one embodiment hot tapping tool can have one or more viewing windows to optically view the tip of the hot tapping tool even when the clamping system is attached to the clamping system **100** and inserted into one or more nested tubulars (e.g., **50, 60**, and/or **70**). In one embodiment two, three, and/or four viewing windows are provided on a compression plate **500**.

[0105] During drilling, cutting, and tapping operations viewing areas **580, 582, 584**, and **586** can provide visual access to the space between second side **220** of first plate **200** and exterior of first pipe **50**. Additionally, when an opening is made in first pipe **50** visual access can be provided to annular space **62** along with second pipe **60** during drilling, cutting, and tapping operations (without the need to remove/reposition clamp **100**). When an opening is made in second pipe **60** visual access can be provided to annular space **72** along with third pipe **70** during drilling, cutting, and tapping operations (without the need to remove/reposition clamp **100**). When an opening is made in third pipe **70** visual access can be provided to annular space **82** along with fourth pipe or tubing **80** during drilling, cutting, and tapping operations (without the need to remove/reposition clamp **100**). Such visual access can be greatly beneficial during drilling, cutting, and tapping operations.

[0106] In one embodiment the hot tapping tool can have a longitudinally adjustable compression plate in which the rotationally adjustable swivel nut is operably attached. In one embodiment the swivel nut can be threadably connected to a hot tapping mandrel or barrel thereby providing two

manners of longitudinally applying compression on the hot tapping tip of the hot tap tool (the first being a plurality of bolts and nuts along the circumference of the compression plate and the second being the threaded connection between the swivel nut and the barrel or mandrel).

[0107] In one embodiment support plate **200** can include a plurality of threaded fasteners **242** attached to the plurality of openings **240**. In one embodiment compression plate **500** can also include a plurality of support openings **530** which are symmetrically radially spaced to fit plurality of threaded fasteners **242**. In one embodiment a plurality of nuts can be used to slidably affix compression plate **500** to support plate **200**. Additionally, symmetrically spacing fasteners **242** about a circle allows for rotational/radial adjustment of compression plate **500** relative to support plate **200** (and relative to first pipe **50** when clamp **100** is attached). Such rotational/radial adjustment allows for positional adjustment of main opening **550** where such opening has an offset **552**.

[0108] In one embodiment (see FIGS. **29-31**) compression plate **700** can be detachably connected to first plate **200**. In one embodiment compression plate can comprise first and second sides **710, 720** along with two main openings **650** and **654** which are offset from a center point. In one embodiment main openings **750** and **760** can include a tapered areas **752** and **762**. In one embodiment compression plate **700** can include a plurality of viewing openings **780, 782, 784**. In one embodiment compression plate **700** can be comprised of two sections **702** and **704**. Two main openings **750** and **760** allow for simultaneous operations of two hot tapping tools **2000, 2000'** in a single location.

[0109] In one embodiment the adjustable angular offset of hot tapping tool in the compression plate (**500** and/or **600**) can be at least about 0, 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, and 45 degrees from a perpendicular to compression plate. In one embodiment the adjustable angular offset is between about any two of the above specified angles. In one embodiment the angular offset is changed while the tool is attached to the outermost pipe or tubular. In one embodiment the angular offset is changed while the tool is attached to the outermost pipe or tubular and the clamp housing of the tool is not moved during the rotational adjustment.

[0110] In one embodiment the clamping system for the hot tapping tool can have a rotationally adjustable compression opening which can be rotationally adjustable in at least 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, 45, 50, 55, 60, 65, 70, 75, 80, 85, and 90 degree increments. In one embodiment the rotational adjustability is between about any two of the above specified angular increments. In one embodiment the rotational adjustment occurs while the tool is attached to the outermost pipe or tubular. In one embodiment the rotational adjustment occurs while the tool is attached to the outermost pipe or tubular and the clamp housing of the tool is not moved during the rotational adjustment.

[0111] In one embodiment is provided a method and apparatus where two hot tapping tools **2000, 2000'** are simultaneously connected to a single clamp and two coaxially nested pipes or tubulars are simultaneously hot tapped. In one embodiment each of the hot tapping tools simultaneously tapping nested tubulars are each independently angular adjustable to effect a hot tapping seal.

[0112] FIG. 11 is an overall perspective view of one embodiment showing a double plate saddle clamp system 10 with a single main opening 550 compression plate 500. FIGS. 25-26 are top and sectional views of plate 500.

[0113] FIG. 13 is a side view of an embodiment showing the hot tapping of an inner tubing 80. FIG. 14 includes front and top views of the embodiment shown in FIG. 13. FIG. 15 shows rear and bottom views of the embodiment shown in FIG. 13.

[0114] FIGS. 16 through 24 will schematically illustrate various steps in hot tapping multiple pipes 50, 60, 70, and 80 which may be coaxially nested within one another either symmetrically and/or in an offset condition.

[0115] FIG. 16 is a schematic top view of hot tapping system 10 illustrating the step of hot tapping a first exterior pipe 50.

[0116] FIG. 17 is a schematic top view schematically illustrating the step of making an opening 51 in the first exterior pipe 50.

[0117] FIG. 18 is a schematic top view of hot tapping system 10 illustrating the step of hot tapping a second interior pipe 60.

[0118] FIG. 19 is a schematic top view of hot tapping system 10 illustrating the step of hot tapping a second interior pipe 60 where the hot tapping tool 2000 is angularly offset (by angle theta) from a perpendicular to assist in making the hot tapping seal between the tip 2010 and the pipe 60.

[0119] FIG. 20 is a schematic top view schematically illustrating the step of making an opening 61 in the second pipe 60.

[0120] FIG. 21 is a schematic top view of hot tapping system 10 illustrating the step of hot tapping a third interior pipe 70.

[0121] FIG. 22 is a schematic top view of hot tapping system 10 schematically illustrating the step of making an opening 71 in the third pipe 70.

[0122] FIG. 23 is a schematic top view of hot tapping system 10 illustrating the step of hot tapping a fourth pipe or tubing 80 where the hot tapping tool 2000 is angularly offset (by angle theta) from a perpendicular to assist in making the hot tapping seal between the tip 2010 and the pipe 80.

[0123] FIG. 24 is a schematic top view of system 10 illustrating the step of hot tapping a fourth pipe or tubing 80 where the hot tapping tool 2000 is angularly offset (by angle theta) from a perpendicular to assist in making the hot tapping seal between the tip 2010 and the pipe 80, along with the step of using a second tool 3000 to provide support for the tubing 80 when making a seal between the hot tapping tool tip 2010 and the tubing 80.

[0124] FIG. 25 is a view of one embodiment of a compression plate where the main opening 550 being offset from the center and plate 500 having multiple view openings 580, 582, 584 positioned about main opening 550. FIG. 26 is a sectional view of compression plate 500 taken through the line A-A.

[0125] FIG. 27 is a rear view of one embodiment of a compression plate 600 where the main opening 650 is not offset from the center and with plate 600 having multiple view openings 680, 682, 684, 686. FIG. 28 is a sectional view of the compression plate 600 taken through the line A-A.

[0126] FIG. 29 is a front view of one embodiment of one piece 710 of a two piece compression plate 700 where the

two piece compression plate 700 has two main openings 750 and 760 both of which are offset from the center. FIG. 30 is a sectional view of compression plate 700 taken through the line A-A. FIG. 31 is a side view of the compression plate 700.

[0127] FIG. 32 is a side view of one embodiment of a swivel nut 800. FIG. 33 is a rear view of swivel nut 800. FIG. 34 is a sectional view of swivel nut 800 taken through the line A-A.

[0128] FIG. 35 is a perspective view of one embodiment of a detachable support foot 350.

[0129] FIG. 36 is a perspective view of one embodiment of a tip 2010 for the hot tapping tool 2000.

[0130] In one embodiment a drill system can be used to cut enlarged openings the tubulars in between hot tapping each tubular. For example, an articulating drill system 1100 (see FIGS. 7-8, 10 and 37-47) can be used. In FIG. 8, the diver 9 is shown attaching the articulating saw 1100 to the hot tap housing 100. FIG. 10 is a perspective view of a diver using saw 1100. The saw 1100 can be pivotally attached to the hot tap housing 100 via a pin on one side and a support plate on another side. The saw 1100 also has an articulating and sliding support joint for the rotating saw shaft. FIG. 8 shows the saw 1100 attached to the hot tap housing 100 and positioned to make a cut in one of the nested tubulars 50, 60, 70, 80.

[0131] Drill system 1100 and can include first arm 1110, second arm 1120, base 1150, and connection plate 1500. First arm 1110 can be pivotally connected to second arm 1120. Second arm 1120 can be pivotally connected to base 1150. Base 1150 can be pivotally connected to connection plate 1500. Drill 1300 can be attached to base 1150. Drill 1300 can comprise motor 1320 and cutting tip 1400 which is rotationally connected to motor 1320. Longitudinal track system 1160 can allow controlled longitudinal movement (e.g., along the longitudinal direction of base 1150) of drill 1300 such as by a screw and thread system. Track system 1160 can include a quick release/quick lock system which longitudinally locks the position of drill 1300 relative to base 1150. Perpendicular track system 1200 can allow controlled perpendicular movement (e.g., perpendicular to the longitudinal direction of base 1150) of drill 1300 such as by a screw and thread system. Track system 1200 can include a quick release/quick lock system which perpendicularly locks the position of drill 1300 relative to base 1150. Longitudinal and perpendicular track systems 1160 and 1200 can respectively longitudinally and perpendicularly adjust the position of drill 1300. Drill system 1100 can be pivotally connected to first plate 200, such as by pin 294. Connection plate 1500 can be used to partially positionally lock drill system 100 relative to first plate 200. Even when partially locked, drill 1300 can be pivoted relative to first plate 200 through pivoting joint 1510. Quick release/quick lock 1550 when unlocked allows for pivoting. However, locking quick release/quick lock 1550 prevents further pivoting movement of drill 1300.

[0132] In FIG. 8, the diver 9 is shown attaching the articulating saw 1100 to the hot tap housing 100. The saw 1100 can be pivotally attached to the hot tap housing 100 via a pin on one side and a support plate on another side. The saw 1100 also has an articulating and sliding support joint for the rotating saw shaft. FIG. 8 shows the saw 1100 attached to the hot tap housing 100 and positioned to make a cut in one of the nested tubulars 50, 60, 70, 80.

[0133] FIGS. 37 and 38 are perspective views of one embodiment of an articulating drill system 1100 for making enlarged openings through the different pipes with drill system 1100 shown swivelled out of the way of the clamp 100. Different drilling FIG. 39 is a top view of the articulating drill system 1100 shown in the same position as FIG. 37.

[0134] FIG. 40 is a perspective view of articulating drill system 1100 shown in position to make a cut through one of the pipes. FIG. 41 is a top view of the articulating drill system 1100 where the system is connected to the plate 200, perpendicular to same and in the center of main plate opening 230 with the double arrow schematically indicating that drill tip 1400 can move back and forth through main plate opening 230. FIG. 42 is a top view of the articulating drill system 1100 where the system is connected to the plate 200, angled from same and in the center of main plate opening 230 with the two sets of double arrows schematically indicating that drill tip 1400 can move back and forth through main plate opening 230 along with rotating back and forth. FIG. 44 is a top view of the articulating drill system 1100 where the system is connected to the plate 200, perpendicular to same and offset in the right direction of the arrow from the center of main plate opening 230. FIG. 43 is a top view of the articulating drill system 1100 where the system is connected to the plate 200, perpendicular to same and offset in the left direction of the arrow from the center of main plate opening 230. FIG. 44 is a perspective view of the articulating drill system 1100 where the system is connected to the plate 200, perpendicular to same and in the center of main plate opening 230. FIG. 45 is a top view of the articulating drill system 1100 where the system is connected to the plate, perpendicular to same and offset in the left direction of the arrow from the center of main plate opening 230 and the drill tip 1400 is passed through the main opening 230. FIG. 46 is a top view of the articulating drill system 1100 where the system is connected to the plate 200, angled from a perpendicular to same as indicated by the arrows, where and the drill tip 1400 is passed through the main opening 230. FIG. 47 is a top view of the articulating drill system 1100 where the system is connected to the plate 200, perpendicular to same and offset in the right direction of the arrow from the center of main plate opening 230 and the drill tip 1400 is passed through the main opening 230. Drill system 1100 can include an articulating stabilizer 110, which itself can include a plate 111 having central slot 114 and plate openings 112, 113. The plate 111 is clamped or sandwiched in between housing sections 117, 125 with bearing 115 in between. Bearing 115 is an annular bearing that is sized and shaped to fit cavity 118 of housing section 117 while enabling bearing 115 to pivot with hot tapping tool that passes through opening 116. Clamps or bolts 121, 122 can be loosened to allow bearing 115 (and a hot tapping tool) to pivot while being supported by the bearing 115 and the housing sections and plate 111, 117, 125. Each clamp or bolt can have a lever or handle 123 or 124 for enabling a user (e.g. diver 9) to tighten the bolts or clamps 121, 122 once a selected angular position of the hot tapping tool is selected. Housing section 125 has surface 130 which slides upon surface 134 of plate 111. Housing section 125 has surface 131 which slides upon surface 135 of plate 111. Housing section 132 slides upon rear surface 136 of plate 111. In this fashion, a user such as diver 9 can loosen bolts or clamps 121, 122 and slide the housing sections 117, 125 laterally

relative to plate 111. The plate 111 can be bolted to a selected part of clamp 100 using bolted connections at plate openings 112, 113. The housing section 125 has internally threaded openings 126, 127 that accept threaded portions 138 or 139 of bolts 121 or 122.

[0135] FIG. 48 is a perspective view of clamp 100 with cut outs 51 and 71 made in two of the pipes/tubulars (50,70) to hot tap the innermost tubular 80. Pipe 60 shown in other Figures has been omitted for clarity. FIG. 49 is a front view of FIG. 48. FIG. 50 is a top view of FIG. 48 showing that innermost nested tubular 80 is offset and swivel nut 800 (and mandrel 2050) allows direct connection of hot tap tip 2010 to tubular 80 without repositioning clamp 100.

[0136] FIGS. 51 through 53 show the eccentric compression plate 500' with the main opening 550 respectively at the 3, 6, and 9 O'clock positions to illustrate various modes of rotation adjustment of eccentric main opening 550. Pipe 60 has been omitted for clarity.

[0137] FIG. 54 is a perspective view of clamp 100 but with eccentric compression plate 500' with main opening 550 at the 3 O'clock position, and with cut outs 51 and 71 made in two of the pipes/tubulars (50 and 70) to hot tap the innermost tubular. FIG. 55 is a front view of clamp 100. FIG. 56 is a top view of clamp 100.

[0138] FIG. 57 is a perspective view of clamp 100' with double main opening compression plate 700 and schematically indicating the simultaneous hot tapping of two pipes or tubulars 80 and 80' with the same clamp 100'. FIG. 58 is a front view of clamp 100' with the arrows schematically indicating angular adjustability of mandrels 2050 and 2050'. FIG. 59 is a top view of claim 100'.

[0139] In one embodiment an angular adjustment of tapping tool 2000 both up and down and side to side can be made while attached to clamp 100 to effect a hot tapping seal. Such angular adjustment helps contact tip 2010 of hot tapping tool 2000 and making a seal with hot tapping tool.

[0140] In one embodiment the adjustable angular offset of hot tapping tool 2000 in the compression plate (500 and/or 600) can be at least about 0, 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, and 45 degrees from a perpendicular to compression plate. In one embodiment the adjustable angular offset is between about any two of the above specified angles.

[0141] In one embodiment compression plate (500 and/or 600) can be rotationally adjustable in at least 1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15, 16, 17, 18, 19, 20, 21, 22, 23, 24, 25, 26, 27, 28, 29, 30, 31, 32, 33, 34, 35, 36, 37, 38, 39, 40, 41, 42, 43, 44, 45, 50, 55, 60, 65, 70, 75, 80, 85, and 90 degree increments. In one embodiment the rotational adjustability is between about any two of the above specified angular increments.

[0142] In one embodiment two hot tapping tools 2000, 2000' are simultaneously connected to compression plate 600. In one embodiment each of the hot tapping tools 2000, 2000' are angularly adjustable as specified with compression plate 500.

Visually Locating Tip of Hot Tap Tool

[0143] In one embodiment one or more openings provide visual access to pipe 50, 60, 70, and/or 80 is provided through compression plate 500 even while hot tapping tool 2000 is mounted in main opening 550.

[0144] FIG. 9 is a closeup perspective view of a diver 9 using the hot tap tool 2000. FIG. 10 is a perspective view of a diver 9 using the articulating saw 1100. This figure illustrates the ability of diver 9 to locate by eyesight the tip 2010 of hot tap tool 2000 when hot tapping a pipe located inside of nested tubulars (e.g., pipe 80 located inside of tubulars 50, 60, and 70 (although tubular 70 is omitted for clarity). Here diver 9 can see through one of compression plate 500's viewing windows (e.g., 580, 582, and/or 584) to see hot tapping tip 2010 and by locate the position of tip 2010 relative to the nested tubular to be hot tapped. In FIG. 9, diver 9 would see through view window 582, main opening 230 (of plate 200), opening 51 (of pipe 50), opening 61 (of pipe 60), and opening 71 (of pipe 70 although not shown), to finally see tip 2010 and locate it properly on nested pipe 80 for hot tapping pipe 80.

[0145] In one embodiment, after jetting, system 10 is mounted on pipe 50 which is substantially out of round in a non-symmetrical manner. In one embodiment system 10 is mounted below the sea floor on a substantially out of round pipe. In one embodiment the sea floor is jetted clear of pipe 50 between 1 and 30, 1 and 25, 1 and 20, 1 and 15, 1 and 14, 1 and 13, 1 and 12, 1 and 11, 1 and 10, 1 and 9, 1 and 8, 1 and 7, 1 and 6, and 1 and 5 feet. In one embodiment the sea floor is jetted clear of pipe 50 between 2 and 30, 2 and 25, 2 and 20, 2 and 15, 2 and 14, 2 and 13, 2 and 12, 2 and 11, 2 and 10, 2 and 9, 2 and 8, 2 and 7, 2 and 6, and 2 and 5 feet.

Hot Tap Procedures

[0146] Below an abbreviated procedure for hot tapping is provided in one embodiment.

[0147] Abandonment Procedure for Wells on a Platform That Has Fallen over. There are basically two ways to restore control of the wells on a platform that has fallen over. Abandon the wells completely in the order they are accessed. Or remove the bent or broken portion of the well and install a subsea wellhead.

Preliminary Work

- [0148] (1) Move on location and set up as needed.
- [0149] (2) Make a review of the platform. Determine at what depths the wells are broken over. Determine whether cutting into the wells conductor pipe will cause the platform to move. Are the wells holding up any weight besides their own? When performing multi string hot tapping, operations go much more efficiently when larger diameter access holes can be taken out of the drive pipe.
- [0150] (3) Verify that the pipelines have been removed and have no pressure on same.
- [0151] (4) Mark the well number clearly at several points along their length.
- [0152] (5) Remove Debris as needed to give divers access to the wells where they are as close to vertical as possible or below where they are broken over. This may entail going below the mud line. Quite often the inner wells are broken over at a lower depth than the outer wells. Make a diagram showing the depth that all the wells are broken over in relation to each other.

[0153] (6) Visually attempt to determine if any of the drive pipes 50, 50', 50", etc. have failed or are broken open. If so are any of the inner casing strings broken open.

[0154] (7) The personnel in the field must be cognizant of what the operator wishes to accomplish in order to determine at what depth the outer wells will need to be cut off and or tapped into.

[0155] (8) Determine a game plan as to what order the wells will be accessed and how the operator wishes to regain control of the wells. This will determine at what depth the wells will need to be hot tapped.

Hot Tap Procedure

[0156] (1) Divers have previously gained access to the well and have prepared for themselves a work area.

[0157] (2) Determine the depth where the hot tap will be done. Install ropes around the Drive pipe 50 where the pipe is vertical—if there is plenty of room for working—Install the soft line around the pipe approximately 3 feet apart. Take a 2 inch flat chisel and remove all the barnacles from the work area between the ropes.

[0158] (3) Once the pipe is clean for work. Measure the pipe 50 with a tape to verify the diameter of same. Use the tape to make a line around the pipe in the middle between the two ropes as straight as possible. Using an imaginary plane cutting the pipe perpendicular to its longitudinal axis, draw four (4) vertical marking lines extending from the top rope to the bottom rope which are radially spaced apart (e.g., preferably 90-degrees radially spaced from each other). In one embodiment these vertical lines will be at: (a) 0 degrees; (b) 90 degrees, (c) 180 degrees; and (d) 240 degrees going in a clockwise manner around the pipe. In this manner the space between the 0 degree and 240 degree lines will provide the most area work.

[0159] (4) Verify that the outer drive pipe 50 has no pressure—i.e., it is been broken open, or if not broken has no interior annular pressure. If it can be verified as not being pressurized, use a drill (which can be hydraulically powered and magnetically attached) to drill holes at the radial locations of 0, 90 and 240 degrees. The size of the holes to be drilled will be determined by the drive pipe 50 and the inner casing string (e.g., 60, 70, and/or 80). Once the holes 52 are drilled, remove any annular cement as needed to measure the distance from the outer drive pipe 50 to the inner casing string 60. Once the interior location of the inner casing string 60 is determined relative to the drive pipe 50, the location of tool attachment can be decided upon. When the outer drive pipe cannot be verified to have no pressure inside of it. The outer drive pipe will have to be hot tapped, as is done in this procedure.

[0160] (5) Install the saddle clamp tool 100 with the center of the openings 230, 230' set at the 0 and 180 degree positions as indicated by the 0 and 180 degree vertical lines. The saddle clamp tool 100 can be installed by closing the two bolts on the open side and snugging them down, then backing off the holding nut on the opposite bolts then tightening the tighten nuts on the other two bolts. Finally, going back and tightening the two original nuts.

[0161] (6) Install a hot tap barrel 2000 on the saddle clamp tool 100 by sliding it over the top slick bolt, and then lining up the barrel against the drive pipe. Preferably, the barrel includes a properly size tapping tip 2010 which has a curved flexible (e.g., Teflon) seal installed to sealing fit against the

drive pipe **50**. Tighten the sealing nuts **244** to create a seal between the drive pipe **50** and the hot tap tip **2010**. Test the seal against drive pipe **50** to 250 pounds per square inch pressure. Note: the end of the barrel **2050** has a 2 inch **1502** weco connection. The seal test can be done by installing a ¼ inch (or 1½ inch hose) to the back of the barrel **2050** and pressuring up the connection. If pressure is maintained then a seal has been formed.

[0162] (7) Remove the pressure test hose and install the Hot Tap Tool to the end of the barrel **2050** using a 2 inch **1502** weco quick connection (by hammering up the quick connect). Run in the hot tap tool **2000** till the ¾" flat drill **2100** of the hot tap tool **2000** touches the drive pipe **50**. Pressure up the barrel **2050** between the 1 inch polished rod and chevron packing on the hot tap tool **2000** and the Teflon seal **2010** against the outer casing to 250 pounds per square inch pressure. Double check the stop setting on the hot tap tool **2000**—should be set for the thickness of the diameter size of the outer casing **50** (e.g., the drive pipe **50** diameter=¾ inch+¼ inch extra). Install the drill **2100** on the end of the hot tap tool **2000** and rotate the polished rod to rotate the ¾ inch bit on the end. Advance the polished rod with the wheel with about ¼ inch linear advancement per turn as the diver is drilling the ¾ inch hole. This linear advancement of the drill bit **2110** should be continued until either: (a) pressure change is seen and/or (b) break thru of the drill bit is felt (e.g., the metal/drilling gets easier or the diver hits the stop/makes enough turns on the wheel to have advanced same the proper distance).

[0163] (8) Once the hot tap tool **2000** has drilled thru the outer drive pipe **50**, the drill **2100** should be removed from the hot tap tool **2000** and the hydraulic hoses disconnected with the hot tap tool **2000** positioned in a nearby location until needed again. Back out the polished rod till it clears the ball valve on the end of the barrel **2050** and close the ball valve. Bleed off any remaining pressure on the hot tap tool **2000** and remove same from the barrel **2050**-2 inch **1502** weco hammer union connection. Send the hot tap tool **2000** back to surface until needed again.

[0164] (9) If there is any pressure behind the drive pipe **50** (i.e., in the annular space **62** between the interior of the drive pipe **50** and the first inner casing **60**), install a 1½ inch pump in line to the end of the barrel **2050**-2 inch **1502** weco hammer union connection. Test the line against the ball valve. Open the ball valve opening the annular space **62** to the surface. Perform the necessary actions to remove any pressure and or hydrocarbons from this annular space **62**.

[0165] (10) Once all pressures and hydrocarbons have been removed from the annular space **62**, remove the barrel **2050** and send back to the surface to be redressed for the next casing string **70** by changing the hot tap sealing tip **2010**'. In one embodiment the hot tap tool **2000** can be connected to the hot tap clamp **100**.

[0166] (11) Once the barrel **2050** is removed, measure the linear distance to the exterior of the next interior casing, pipe, and/or tubing **60**. Such linear distance can be measured with a measuring probe. In one embodiment there are 20 inch, 30 inch, and 40 inch measuring probes included for such measurements. Cement in the annular space may need to be removed prior to being able to take this measurement. Brushes, chippers, grinders, etc. can be included to assist the divers in clearing it out the annular space **62** for making such measurement.

[0167] (12) Once this measurement is taken, a determination can be made regarding the maximum enlarged hole **52** that can be drilled in the exterior casing/pipe **50** to provide operating space and visual access to the next interior casing, pipe, and/or tubing **60**. Send the drill **1000** down to the diver. Remove the 1 inch holding pin—straight pick up—from the saddle clamp **100** and line up the drill **1000**—drop the pin in holding same. The initial drill **1000** will have the proper size bit **1400** already installed on the drill **1000**—on all subsequent drilling events the diver will have to change out the bit **1400**' to the proper size as needed. The drill **1000** sits on a multiple degree of freedom swivelling arm carriage that is held in place by the pin. Swivel the drill bit **1400** into place, lock it down solid by tightening the drill holding nuts. Advance the drill bit **1400** until it touches the drive pipe **50**.

Detailed Hot Tap Procedure

[0168] Below is a more detailed hot tap procedure which can be used for various embodiments.

[0169] Dual plates **200**, **200'** will be set up with 8-20 inch Jaws, 4-Pivot Pins (with 8-mount brackets and 4-1 inch pins to hold them in place), 4-Mount Brackets for Clevis's and 4-Clevis's with 1⅞ inch×36 inch Long Bolts & Nuts. The Long Bolts will have inner Nuts on the Closed Side of the DSC preset for 20 inch Drive Pipe.

[0170] Depending on how the Clevis Mount Brackets are installed the diver can install drill **1000** on either their right or left side if they have a preference of plate **200** or **200'**. Clevis Mount Brackets can be set to allow free movement when Drill Slide **1160** is installed on the Pivot Pin on the right and side of the either Plate **200** or **200'** can still be installed on the Left Pivot Pin.

[0171] Clamp **100** can be prepared to be installed on Drive Pipe **50** by first determining the size of drive pipe **50**. In one embodiment drive pipe **50** can be 20 inches in diameter. Plates **200** and **200'** can have bolt holes cut out (or open slots) on one side to allow the bolts to be swung into and out of position. Plates **200** and **200'** can also have ½ inch keys welded onto the end of the cut outs to keep the nut and washer from slipping out of position when they are loose. A set of 1 inch×10'—4 part Nylon Slings (length depends on the crane—the longer they are the more easily it will be for the diver to open and close clamp **100**).

[0172] Lower clamp **100** alongside drive pipe **50** to the desired attachment location. With the diver assisting pulling clamp **100** around pipe **50** via the open side of clamp **100**. Once clamp **100** it is in place, the diver will release the tension in the come along just enough to allow plates **200** and **200'** to close around pipe **50**. Close the two long clevis bolts on the open side by rotating them into the cut out bolt holes, over the ½ inch stop keys, and tightening down the nuts and washers. The nuts should be tightened hand tight with a hammer wrench.

[0173] At this time the diver should take a look at clamp **100** to determine that it is in place and fairly squared up. Look and see if the dies on the jaws **350**, **360**, **370**, and **380** are engaged and that the front and back plates **200**, **200'** are in their desired position relative to each other and drive pipe **50**. At this time, or at any later time, clamp **100** can be easily moved around drive pipe **50** simply by loosening the nuts on the open side and tightening up on the come along until the dies or jaws **350**, **360**, **370**, and **380** (and **350'**, **360'**, **370'**, and **380'**) on the open side become disengaged from pipe **50**,

then simply rotate clamp **100** to the desired position or have the crane operator lower or raise the clamp **100** as needed.

[0174] Once clamp **100** is in place and the open side has been hand tightened, slack off the remainder of the way on the come along making sure it has slack in it and is not holding a bind on clamp **100**. Diver should go around to the closed side and back off the two inside nuts, once they are free turn them at least three full rounds to make sure they do not interfere with the outside nuts being tightened. Tighten the two outside nuts on the closed side with the hammer wrench—hand tight.

[0175] Once again look at clamp **100** to verify it is in position and is level with drive pipe **50**. As long as at least three of the dies (from **350**, **360**, **350'**, and **360'**) on the top set of jaws (4 jaws on top with 2 dies each and 4 jaws on bottom with 2 dies each) are making contact with drill pipe **50**, clamp **100** will stay firmly in place. Have the crane operator slack off clamp **100** as it will hold its own weight with the outer nuts just snug. Tighten up the 4 outside nuts with a hammer wrench and a one handed sledge hammer until they are tight. There is no need to beat it with a **101b** or **121b** sledge, you can if you would like—the 2 inch thick plates with the 1 $\frac{7}{8}$ inch bolts will take whatever tightening you would care to give them but the 16-1 $\frac{1}{4}$ inch \times 5 $\frac{7}{8}$ inch Diamond Tooth Tong Dies that are in the jaws are made to hold in every direction.

[0176] Once clamp **100** is installed remove the 1 inch \times 10' 4 part sling from the top of clamp **100**. Prior to running down clamp **100** and installing a “Deer Stand” work platform on drive pipe **50** for the diver to work of, drive pipe **50** area should be cleaned. Run the end of the bundle of Hydraulic Hoses down to the diver and attach them out of the way but handy. The Hydraulic hose bundle consists of a set of 1 inch hoses (inlet and outlet) used to run drill **1000** and a set of $\frac{1}{2}$ inch hoses used to run all the hand tools. Quick connects are installed on all of the hoses with inlet and outlet having male and female respectively to make sure they cannot be put on backward. Run the $\frac{1}{2}$ inch 10,000 psi test hose down to the diver and have him secure it out of the way.

[0177] Tap the 20 inch Drive Pipe **50** to determine if it has pressure on the inside of same. Compression plate **500** can be used with a 20 inch Mandrel **2050**. The 20 inch Mandrel **2050** will have attached to it the Swivel Nut **800**, Backing Nut **802**, Seal Tip **2010** (with Teflon Seal Installed) on one end and the Ball Valve (with 2 inch **1502** Weco Connection) on the other. The Swivel Nut **800** is screwed onto the mandrel **2050** and allows the center flange **500** to transfer the load to the mandrel **2050**. This swivel nut **800** allows for up to 10 to 15 degrees of rotation of the mandrel **2050** thru the flange **500**. Backing Nuts for the Mandrel can be installed on its threads as needed if accessories are wanted. For example, there may be a desire to attach a video camera as a camera would allow personnel on the topside (e.g., Dive Supervisor), to be able to see the seal tip **2010** and assist the diver when installing the mandrel **2050**. Also, a video camera would allow the dive supervisor to observe the seal tip **2010** to make sure it is level with the pipe (**50**, **60**, **70**, and/or **80**) prior to energizing the seal or to see any die leaking out around the seal while testing. These backing nuts can be installed on the mandrel **2050** for any reason needed. The Seal Tip **2010** with Teflon Seal Inserted will be for 20 inch pipe **50**. The Seal Tip **2010** and seal are cut to the curvature of the pipe (**50**, **60**, **70**, and/or **80**) to be hot tapped. The Tip **2010** and the mandrel **2050** will have a line drawn on it to

show the diver how to line it up with the pipe. The Ball Valve (BV) can be a 2 inch 6,000 pounds per square inch heavy duty type with a 1 $\frac{1}{2}$ inch ID thru same. The Ball Valve has 2 inch Line Pipe connections on both sides and a 2 inch **1502** Weco Male Connection will be installed on the BV. The BV will be run down to the diver in the open position.

[0178] The diver will receive the Center Flange **500** with 20 inch mandrel **2050** on a center flange with a 20 inch tip **2010** on one end and ball valve open on the other. The diver will set the flange **500** on the 18 inch stud that is in the 12 O'clock position and remove the strap that holds it. The diver will slide the flange **500** forward on the 18 inch stud until the flange **500** is lined up on the 4-1 $\frac{5}{8}$ inch \times 12 inch studs in the 2/4/8/10 positions. The diver will install 4-1 $\frac{5}{8}$ inch nuts on the 2/4/8/10 studs until the nuts are completely on the studs but no further. The 20 inch mandrel **2050** and tip **2010** will have a top dead center line run down the length of it. The diver will advance the 20 inch mandrel **2050** by rotating the swivel nut **800** until the Teflon on the tip **2010** is engaged against the 20 inch pipe **50**. At that time the diver needs to verify that the mandrel **2050** is perpendicular to pipe **50** and that the line on the mandrel **2050** is on top (i.e., mandrel **2050** should be lined up properly with pipe **50**). In order to get a seal mandrel **2050** should be line up perpendicular to the particular pipe the diver is attempting to seal against.

[0179] Once mandrel **2050** is in the proper position, tighten the 4-1 $\frac{5}{8}$ inch nuts with a hammer wrench taking care to tighten one half of a turn at a time when turning by hand then one fourth of a turn at a time when using a hammer, going from nuts 2 to 8; to 4 to 10; then back to nut 2. Preferably nuts are tightened evenly. This tightening compresses the Teflon seal against pipe **50**. Once mandrel **2050** is tightened against pipe **50**, stop and look at the entire set up and verify that everything looks proper such as whether the line on mandrel **2050** is still top center and the mandrel **2050** is perpendicular to pipe **50** tip **2010** is sealing against.

[0180] Test the Teflon seal on the 20 inch drive pipe **50** to 250 pounds per square inch low/1,000 pounds per square inch high for 5 minutes each test. The testing will be done by installing a 2 inch **1502** Female Weco hammer up connection to the 2 inch **1502** male Weco connection on the end of the mandrel. When hammering on and off the 2 inch **1502** Weco connections it is not necessary to use a big hammer and lots of force, please use common sense and caution. Install the $\frac{1}{2}$ inch test hose, or whatever test hose the operator chooses to use to the $\frac{1}{2}$ inch outlet on the end of the mandrel **2050**. When testing, if the operator chooses to do so, Green Dye can be available to be mixed with seawater to assist in seeing any leaks.

[0181] Crane to send down the 30 inch stroke Hot Tap Tool **2000** with a 5 $\frac{7}{8}$ inch long \times $\frac{3}{4}$ inch Fluted Bit with insert tips **2010** installed on same. In this case we will be using a $\frac{3}{4}$ inch Flat Tipped Cutting Insert on the Bit. Make up the hot tap tool **2000** to Mandrel **2050** by making up a 2 inch **1502** Weco connection. Throughout the procedure we will be utilizing the 3 inch diameter \times 30 inch stroke 6,000 pounds per square inch working pressure Hot Tap Tool **2000**. In one embodiment both a 30 inch stroke Tool **2000** and a 54 inch Stroke tool **2000'** will be sent out. Both have been designed to be used with this system **10**. The 30 inch stroke tool **2000** works with the 20 inch Mandrel **2050**. The 54 inch stroke tool **2000'** works with the 30 inch and 40 inch

Mandrels (**2050'** and **2050"**) should an extended reach be needed. The 54 inch stroke tool **2000'** can also be used in conjunction with the 20 inch Mandrel **2050** should something happen to the 30 inch tool **2050'**. Along with two Hot Tap Tools spare parts will be sent with each tool including an extra Lower Drilling Rod Assembly for both tools so they can be rebuilt in the field if needed. The Hot Tap Tool **2000** has a 1 inch Drilling Rod that is sealed off against Chevron packing (6 part). The packing retainer on the tools is made in such a way that it can be tightened if the packing starts leaking while drilling or anytime that the hot tap tool **2000** is installed on the well. The diver will be supplied with a special wrench to be able to tighten the packing retainer nut if needed. The 1 inch Rod is attached to the bit with a standard #2 Morris Taper (1¼ inch OD). The Mandrel **2050** has a 1.30 inch ID. The Seal Tip **2010** has a ¾ inch ID that helps to align the ¾ inch bit.

[0182] Make up the hot tap tool **2000** on the mandrel **2050**. Leave the hot tap tool **2000** hanging from the crane while it is in the water. The hot tap tool **2000** is fairly light+/-150 lb of weight and when using same on a real well it could be hung off from an air bag if it is necessary to remove it from the crane. Test the Teflon seal on the 20 inch drive pipe **50**, the packing around the 1 inch rod and the **1502** connection to 250 pounds per square inch low/1,000 pounds per square inch high for 5 minutes each test. Bleed off the pressure. Run in the hot tap tool **2000** by turning the hand wheel. The Drive Rod on the hot tap tool **2000** is a 2 inch OD Course Acme Thread with 4 Turns to the inch or ¼ inch advancement per Revolution of the hand wheel. The 1 inch Drilling Rod runs thru the 2 inch Drive Rod. The hot tap tool **2000** has two stop subs. One on the outside of the Hot tap tool **2000** and another on the threads of the 2 inch Drive Rod. Prior to sending the Hot tap tool **2000** down the Stop Subs on the Hot tap tool **2000** will be preset to not allow the diver to drill more than ¼ inch past the thickness of the pipe that will be drilled. The hot tap tool **2000** was designed to work in conjunction with the mandrel **2050** to where when the 20 inch Mandrel **2050** is used with the 30 inch stroke Hot tap tool **2000** the 30 inch Hot tap tool **2000** can only drill out approximately 2 inch past the Seal Tip **2010**. This allows the diver to close up the Hot tap tool **2000** almost completely prior to starting to do any drilling with same, making it easier on the diver.

[0183] After testing. Bleed off the test pressure to Zero pounds per square inch, this allows the diver a better feel for what he is doing. Advance the bit in the Hot tap tool **2000**+/-27½ inch until it hits the Teflon seal. The Teflon seal when installed on the seal tip **2010** had a ¾ inch opening. Because the Teflon seal was compressed against the pipe to make a seal it has been compressed or flared on the inside as well as the outside. Once the diver advances the drill bit as far as possible rotate the drill on the Hot tap tool **2000** By hand to cut the Teflon away and advance the bit until the bit makes contact with the pipe. Sometimes the bit, because it is a flat tip, has trouble getting into the ¾ inch ID of the seal tip **2010** (the mandrel **2050** has a 1.30 inch ID). NOTE: It is easy to cut Teflon by hand, it is not as easy to drill metal and the diver can feel the difference. At this time the bit is against the Drive pipe **50**. Take the time to double check the Stop Subs by looking at them and verifying they are set for drilling only the thickness of the pipe, in this case 1 inch wall thickness Drive pipe **50**, +¼ inch only. Pressure up on the

Hot tap tool **2000** and seals to 500 pounds per square inch. Send down a hand drill and make it up on the hydraulic hoses.

[0184] Drill thru the 20 inchx1 inch Wall Drive Pipe **50** by drilling turning the bit **2110** with a hydraulic hand drill and advancing the bit **2110** with the wheel by hand. Keep track of the rounds turned on the wheel to verify the distance drilled. In this case 1 inch pipe will be 4 complete revolutions. Do not force the bit **2110**—when the bit **2110** drills thru the pipe **50** the diver can feel it and there will be a fluctuation in pressure.

[0185] Once the diver has drilled thru the pipe **50** stop drilling and check and record the pressure. Advance and retract the bit **2110** thru the hole to make sure it is completely cut out to a ¾ inch opening. Watch for metal shavings getting the bit **2110** in a bind. If that occurs it is often remedied by pumping water into the Hot tap tool **2000** to flush or move the cuttings.

[0186] Once you are sure that the hole has been cut in the pipe **50** and there is a full ¾ inch opening. Secure the hand drill. Back out the bit **2110** until it clears the Ball Valve. If the casing is not static, close the Ball valve.

[0187] If the Ball valve is closed, bleed off any remaining pressure on the Hot tap tool **2000** and hose.

[0188] Disconnect the Test Hose and secure same.

[0189] Open the needle valve on the Hot tap tool **2000** to double verify there is no pressure left on it. Remove the Hot tap tool **2000** and send same to surface.

[0190] If the casing **50** drilled has pressure on it. Install the 1½ inch Kill Line and test as needed against the ball valve. Open the Ball valve. Deal with the pressure by pumping in or bleeding off as needed until the casing **50** is static. If there was no pressure on the casing the Ball valve was left open.

[0191] With the Ball valve Open, remove the Flange Plate **500** by backing out the 4-1½ inch nuts and send the Flange Plate **50** and Mandrel **2050** assembly to the surface.

[0192] Once the mandrel **2050** assembly has been removed, measure the distance with the measuring probe thru the ¾ inch hole to the next casing string **60**. Hot tap tool **2000** has 20 inch, 30 inch and 40 inch measuring probes included in each box. Cement may need to be removed prior to being able to take this measurement. If needed send down a hand drill with a ⅝ inch masonry bit.

[0193] Normally the next casing string **60** size is known. In this case we have a string of 10¾ inch 45.5 #/ft J-55 casing. When taking the measurement it is never known for sure if you are on a collar or not.

[0194] Care should be taken here when getting these measurements and selecting the size of core bit **1400** to drill out of casing **50**. When drilling into any casing string a balance must be maintained between getting as big a hole as possible and not having the casing that is being drilled to fail or collapse. As a general rule the size of the hole being drilled should not exceed 50% of the casing **50** you are drilling. The Hot tap tool **2000** supervisor will be able to calculate that and look at the different size holes that can be drilled depending on outer casing size versus inner casing size and the distance between them. Calculate the maximum size hole that can be drilled without drilling into the next casing or tubing string. Prior to starting you also need to consider what size of hole you would like to have in the production casing. In this case the production casing is 7⅝ inch therefore the maximum hole size that can be drilled is +/-4 inch (+/-50% of 7⅝ inch), to be able to drill a 4 inch

hole on the 7 $\frac{3}{8}$ inch, you must drill at least a 4 $\frac{1}{2}$ inch hole ($\frac{1}{2}$ inch bigger minimum) on the 10 $\frac{3}{4}$ inch casing, which means we must have at least a 5 inch hole on the 20 inch. So 5 inch can be the minimum size you can start with on the 20 inch Drive pipe **50**. The Hot tap tool **2000** Saddle Clamp **100** has an 11 $\frac{1}{2}$ inch Opening but the biggest hole recommended to start with is 10 inch.

[0195] Have the diver remove the Cotter Pin from the bottom of the 1 $\frac{1}{2}$ inch Pivot Pin. Send down the articulating drill assembly **1000** attached on the crane. Line up the aluminum arm **1110** on same with the pivot pin on plate **200** and drop the Pivot Pin into place. Install the cotter pin on the pivot pin. Remove the crane straps or slings from drill assembly **1000**. Send slings to surface.

[0196] 20 inch Drive pipe **50**×10 $\frac{3}{4}$ inch inner casing string (centered)=10 inch bit. The initial 10 inch bit **1400** will have been already installed on drill **1000**—on all subsequent drilling events the diver will have to change out the bit **1400** to the proper size as needed. Rotate the DS into place in the front of clamp **100**, the bottom five bolts can be used for the DS. It has been our experience that only two 1 $\frac{1}{8}$ inch nuts will be needed to hold the Articulating drill **1000** in place on the Clamp **100** while drilling therefore on the bottom of the Clamp **100** two 1 $\frac{1}{8}$ inch×8 inch long studs were installed for the Articulating drill **1000** on at the #5 and #7 positions. Tighten up the 2×1 $\frac{1}{8}$ inch nuts installing the Articulating drill **1000** into place on the Clamp **100**. Install 1 inch Hydraulic Hoses to the Drill **1000**. Advance the drill until the bit **1400** touches the drive pipe **50**. Start the drill **1000** and make sure it is turning properly. Cut out the 10 inch coupon being careful not to cut into the 10 $\frac{3}{4}$ inch casing **60**.

[0197] Remove the 10 inch coupon.

[0198] Remove the 10 inch bit **1400** and send to the top.

[0199] Remove the two 1 $\frac{1}{8}$ inch nuts and rotate the Articulating drill **1000** back out of the way and secure same. If possible leave the Hydraulic Hoses mounted to the drill. If not remove and secure same.

[0200] Clean out any cement between the 20 inch×10 $\frac{3}{4}$ inch annulus. Verify that there is not a collar in the way. During this test we know there is no cement in this annulus or a collar, but the 10 $\frac{3}{4}$ inch casing will have to be cleaned off where we will be installing the seal tip **2010**. Send down tools as needed to clean off same.

[0201] If there is a collar on the inner casing string **60**, a decision will have to be made to either move the Clamp **100** up or down to get away from it and starting over. Or, the Hot tap tool **2000** system has not only Center Flanges **500** but offset flanges **500'** that allow movement of the Mandrel **2050** in a circle about inches in radius (up or down vertically from center), and to still be perpendicular to the inner casing string **60** for tapping purposes. Consideration should be given to whether this should be done on the basis of how many more inner strings will have to be dealt with and whether part of the collar can be cut out without sacrificing structural integrity of the pipe after it is tapped to gain access to the inner strings.

[0202] Next the diver needs to determine where the centerline of the inner casing string **60** lies in relation to the Clamp **100**. In order to get a seal—the seal tip **2010** is preferably set on the centerline of the pipe **60** and the mandrel **2050** lined up perpendicular to pipe **60** attempting to be sealed against. One advantage of the method and apparatus is the flexibility allowed when lining up on the

inner casing strings (**60**, **70**, and **80**). The hot tap tool **2000** swivel nut **800** is primarily used to allow the mandrel **2050** to be perpendicular to the inner casing string (**60**, **70**, or **80**) where there is a difference in angle from vertical between the Drive Pipe **50** and the inner casing strings (**60**, **70**, or **80**). This allows the new system some ability to get on Drive pipe **50** that is not only out of round but also still not vertical. The Offset Flange **500** with offset **552** allows the mandrel **2050** to be moved up and down as well as right and left (e.g., up to 4 inches). Extreme caution must be exercised when attempting to utilize the Swivel Nut **800** to make up for fact that the inner casing strings (**60**, **70**, or **80**) are more than 10 Degrees to the left or right of the centerline of the Clamp **100**. When the 1 $\frac{1}{8}$ inch nuts are tightened against the flange **500** to effect a seal, they move the flange **500** in the direction of the centerline of the Clamp **100** (and not in the direction mandrel **2050** is pointed when mandrel **2050** is offset). If the centerline of any subsequent inner string (**60**, **70**, or **80**) is encountered where it is more than 10 Degrees to the left or right of the Clamp **100** centerline then the Clamp **100** is preferably rotated on drive pipe **50** to line up Clamp **100** with the inner strings (**60**, **70**, or **80**).

[0203] Because casing **60** is found to be centered, 10 $\frac{3}{4}$ inch casing **60** will be tapped to determine if it has pressure on the inside of same, utilizing the Center Flange **500** with the 20 inch Mandrel **2050** assembly. The diver will receive the Center Flange **500** with 20 inch mandrel **2050** with a 10 $\frac{3}{4}$ inch tip **2010**. The diver will set the flange **500** on the 18 inch stud that is in the 12 O'clock position and remove the strap that holds it. The diver will slide the flange **500** forward on the 18 inch stud till the flange **500** is lined up on the 4-1 $\frac{1}{8}$ inch×12 inch studs in the 2/4/8/10 positions. The diver will install 4-1 $\frac{1}{8}$ inch nuts on the 2/4/8/10 studs till the nuts are completely on the studs but no further. The 20 inch mandrel **2050** and tip **2010** will have a top dead center line run down the length of it. The diver will advance the 20 inch mandrel **2050** by rotating the swivel nut **800** until the Teflon on the tip **2010** is engaged against the 10 $\frac{3}{4}$ inch pipe **60**. At that time the diver needs to verify that the Seal tip **2010** is on the centerline of the pipe and the mandrel **2050** is perpendicular to pipe **60** and that the line on the mandrel **2050** is on top (i.e., that the mandrel **2050** is lined up properly with the pipe **60**). In order to get a seal—seal tip **2010** should be set on the centerline of the pipe **60** and the mandrel **2050** lined up perpendicular to the pipe **60** attempted to be sealed against. Once the mandrel **2050** is in the proper position, tighten the 4-1 $\frac{1}{8}$ inch nuts with a hammer wrench taking care to tighten a $\frac{1}{2}$ turn at a time when turning by hand then a $\frac{1}{4}$ turn at a time when using a hammer, going from 2 to 8 to 4 to 10 then back to 2. It is preferable that they are tightened evenly. This tightening compresses the Teflon seal against the pipe **60**. Once the mandrel **2050** is tightened against the pipe **60** stop and look at the entire set up and verify that everything looks proper (i.e., the line on the mandrel **2050** is still top center and the mandrel **2050** is perpendicular to the pipe **60** it is sealing against).

[0204] Test the Teflon seal on the 10 $\frac{3}{4}$ inch casing **60** to 250 pounds per square inch low/1,500 pounds per square inch high for 5 minutes each test. The testing will be done by installing a on the end of the mandrel **2050**. Install the % inch test hose, pressure gauge and bleed off valve. After performing the test bleed off the pressures and remove the hose and connection.

[0205] Crane to send down the 30 inch stroke Hot tap tool 2000' with a 5 $\frac{7}{8}$ inch long \times $\frac{3}{4}$ inch Fluted Bit with a $\frac{3}{4}$ inch Flat Tipped Cutting Insert on the Bit. Make up the Hot tap tool 2000' on the mandrel 2050. Install the $\frac{1}{2}$ inch test hose to the $\frac{1}{2}$ inch Needle Valve with a pressure gauge and bleed off valve. Test the Hot tap tool 2000 against the Teflon seal on the 10 $\frac{3}{4}$ inch casing to 250 pounds per square inch low/1,500 pounds per square inch hi for 5 minutes each test. Bleed off the pressure.

[0206] Prior to sending the Hot tap tool 2000' down the Stop Subs on the Hot tap tool 2000' will be preset to not allow the diver to drill more than $\frac{1}{16}$ inch past the thickness of the pipe that will be drilled. In this case 10 $\frac{3}{4}$ inch 45.5 #/ft casing is 9.95 inch ID=0.4 inch thick. Please note: the drift=9.794 inch therefore the casing could be up to 9.95 inch-9.794 inch/2=2.5/64 inch extra thick therefore the $\frac{1}{16}$ inch extra will make up for it.

[0207] Advance the bit in the Hot tap tool 2000' +/-27 $\frac{1}{2}$ inch until it hits the Teflon seal. Once the diver advances the drill bit as far as possible rotate the drill on the Hot tap tool 2000' by hand to cut the Teflon away and advance the bit until the bit makes contact with the pipe 60. Double check the Stop Subs.

[0208] Pressure up on the Hot tap tool 2000' and 10 $\frac{3}{4}$ inch seal to 1,000 pounds per square inch. Send down a hand drill and make it up on the hydraulic hoses.

[0209] Drill thru the 10 $\frac{3}{4}$ inch \times 0.4 inch Wall Casing 60 by drilling turning the bit with a hydraulic hand drill and advancing the bit with the wheel by hand. Keep track of the rounds turned on the wheel to verify the distance drilled. In this case 0.4 inch pipe+ $\frac{1}{16}$ inch=0.0625 inch=0.4625 inch therefore it will be a little less than 2 complete revolutions. Do not force the bit. When the bit drills thru the pipe the diver can feel it and there will be a fluctuation in pressure.

[0210] Once the diver has drilled thru the pipe 60, stop drilling. Check and record the pressure and advance and retract the bit thru the hole to make sure it is completely cut out to a $\frac{3}{4}$ inch opening. Watch for metal shavings getting the bit in a bind. If that occurs it is often remedied by pumping water into the Hot tap tool 2000' to flush or move the cuttings.

[0211] Once you are sure that the hole has been cut in the pipe 60 and there is a full $\frac{3}{4}$ inch opening. Secure the hand drill. Back out the bit until it clears the Ball Valve. If the casing 60 is not static, close the Ball valve. If the Ball valve is closed, bleed off any remaining pressure on the Hot tap tool 2000' and hose. Disconnect the Test Hose and secure same.

[0212] Open the needle valve on the Hot tap tool 2000' to double verify there is no pressure left on it. Remove the Hot tap tool 2000' and send same to surface.

[0213] If the casing 60 drilled has pressure on it install the 1 $\frac{1}{2}$ inch Kill Line and test as needed against the ball valve. Open the Ball valve, deal with the pressure by pumping in or bleeding off as needed until the casing 60 is static. If there was no pressure on the casing the Ball valve was left open.

[0214] With the Ball valve Open, remove the Flange Plate 500 by backing out the 4-1 $\frac{5}{8}$ inch nuts and send the Flange Plate 500 and Mandrel 2050 assembly to the surface.

[0215] Once the mandrel 2050 assembly has been removed, measure the distance with the measuring probe thru the $\frac{3}{4}$ inch hole to the next casing string 70. Cement may need to be removed prior to being able to take this measurement. If needed send down a hand drill with a $\frac{5}{8}$

inch masonry bit. In this case there is no cement between the casing strings so we will not have any to drill out.

[0216] Normally the next casing string 70 size is known. In this case we have a string of 7 $\frac{5}{8}$ inch 33.7 #/ft N-80 Casing. When taking the measurement it is never known for sure if you are on a collar or not.

[0217] Care must be taken here when getting these measurements and selecting the size of core bit to drill out of the casing. The Hot tap tool 2000 supervisor will be able to calculate that and look at the different size holes that can be drilled depending on outer casing size versus inner casing size and the distance between them. Always calculate the maximum size hole that can be drilled without drilling into the next casing or tubing string.

[0218] 10 $\frac{3}{4}$ inch casing \times 7 $\frac{5}{8}$ inch inner casing string 70 is found to be centered. Rotate the Articulating drill 1000 into place in the front of the Clamp 100. Install two 1 $\frac{1}{2}$ inch nuts on the #5 and #7 position studs. Tighten up the 2 \times 1 $\frac{5}{8}$ inch nuts installing the Articulating drill 1000 into place on the Clamp 100. Hydraulic Hoses were previously installed to the Drill 1000. Advance the drill bit 1400 until the drill bit touches 10 $\frac{3}{4}$ inch casing/pipe 60. At this time the diver must make sure that the drill bit 1400 is lined up on the centerline of the inner string of casing 60. In one embodiment drill bit 1400 is adjustable in multiple directions (advanced in and out along with adjustment to be able to go right or left, along with the ability to pivot). Drill bit 1400 can be turned up to 5, 10, 15, 20, 25, and 30 degrees to the left or right of the centerline of the Clamp 100 in order to line up the drill bit 1400 on the centerline of any subsequent inner string (70 or 80) without having to rotate the complete Clamp 100 on the drive pipe 50 and starting over. However, should the diver be unable to line up the drill bit 1400 to the centerline of the inner casing strings 70 or 80 the diver should move the Clamp 100 and start over again.

[0219] Start the drill bit 1400 and make sure it is turning properly. Cut out and remove the coupon being careful not to cut into the 7 $\frac{5}{8}$ inch casing 70.

[0220] Remove drill bit 1400 and send to the top.

[0221] Remove the two 1 $\frac{1}{2}$ inch nuts and rotate the Articulating drill 1000 back out of the way and secure same. If possible leave the Hydraulic Hoses mounted to the drill 1000. If not remove and secure same.

[0222] Clean out any cement between the 10 $\frac{3}{4}$ inch \times 7 $\frac{5}{8}$ inch annulus 72. Verify that there is not a collar in the way.

[0223] Next, the 7 $\frac{5}{8}$ inch Production casing 70 will be tapped to determine if it has pressure on the inside of same. The Center Flange 500 will be used with a 20 inch Mandrel 2050 assembly.

[0224] Test the Teflon seal on the 7 $\frac{5}{8}$ inch casing to 250 pounds per square inch low/3,500 pounds per square inch high for 5 minutes each test. The testing will be done by installing a on the end of the mandrel 2050. Install the $\frac{1}{2}$ inch test hose, pressure gauge and bleed off valve. After performing the test to everyone's satisfaction bleed off the pressures and remove the hose and connection.

[0225] Crane to send down the 30 inch stroke Hot tap tool 2000' with a 5 $\frac{7}{8}$ inch long \times $\frac{3}{4}$ inch Fluted Bit with a $\frac{3}{4}$ inch Flat Tipped Cutting Insert on the Bit.

[0226] Make up the Hot tap tool 2000' on the mandrel 2050. Install the $\frac{1}{2}$ inch test hose to the $\frac{1}{2}$ inch Needle Valve with a pressure gauge and bleed off valve. Test the Hot tap tool 2000 against the Teflon seal on the 7 $\frac{5}{8}$ inch casing to 250 pounds per square inch low/3,500 pounds per square

inch hi for 5 minutes each test. Bleed off the pressure. Prior to sending the Hot tap tool **2000'** down the Stop Subs on the Hot tap tool **2000'** will be preset to not allow the diver to drill more than $\frac{3}{32}$ inch past the thickness of the pipe that will be drilled. In this case $7\frac{5}{8}$ inch 33.7 #/ft casing is 6.765 inch ID=0.43 inch thick. Please note: the drift=6.640 inch therefore the casing could be up to 6.765 inch-6.640 inch/2= $\frac{1}{16}$ inch extra thick therefore the $\frac{3}{32}$ inch extra will make up for it. NOTE: Normally we only use $\frac{1}{16}$ inch extra—in this case we used $\frac{3}{32}$ inch.

[0227] Common sense will have to be used at all times when working on these wells.

[0228] Advance the bit in the Hot tap tool **2000'** +/-27 $\frac{1}{2}$ inch until it hits the Teflon seal. Once the diver advances the drill bit as far as possible rotate the drill on the Hot tap tool **2000'** by hand to cut the Teflon away and advance the bit until the bit makes contact with the pipe **70**. Double check the Stop Subs.

[0229] Pressure up on the Hot tap tool **2000'** and $7\frac{5}{8}$ inch seal **2010** to 1,500 pounds per square inch. Send down a hand drill and make it up on the hydraulic hoses.

[0230] Drill thru the $7\frac{5}{8}$ inchx0.43 inch Wall Casing **70** by drilling turning the bit with a hydraulic hand drill and advancing the bit with the wheel by hand. Keep track of the rounds turned on the wheel to verify the distance drilled. In this case 0.43 inch pipe+ $\frac{3}{32}$ inch extra=0.09375 inch=0.52375 inch will be about 2 complete revolutions. Do not force the bit. When the bit drills thru the pipe the diver can feel it and there will be a fluctuation in pressure.

[0231] Once the diver has drilled thru the pipe **70** stop drilling. Check and record the pressure. Advance and retract the bit thru the hole to make sure it is completely cut out to a $\frac{3}{4}$ inch opening. Watch for metal shavings getting the bit in a bind. If that occurs it is often remedied by pumping water into the Hot tap tool **2000** to flush or move the cuttings.

[0232] Once you are sure that the hole has been cut in the pipe **70** and there is a full $\frac{3}{4}$ inch opening. Secure the hand drill. Back out the bit until it clears the Ball Valve. If the casing **70** is not static, close the Ball valve. If the Ball valve is closed, bleed off any remaining pressure on the Hot tap tool **2000** and hose. Disconnect the Test Hose and secure same.

[0233] Open the needle valve on the Hot tap tool **2000** to double verify there is no pressure left on it. Remove the Hot tap tool **2000'** and send same to surface.

[0234] If the casing **70** drilled has pressure on it. Install the 1 $\frac{1}{2}$ inch Kill Line and test as needed against the ball valve. Open the Ball valve. Deal with the pressure by pumping in or bleeding off as needed until the casing is static. If there was no pressure on the casing the Ball valve was left open.

[0235] With the Ball valve Open, remove the Flange Plate **500** by backing out the 4-1 $\frac{5}{8}$ inch nuts and send the Flange Plate **500** and Mandrel **2050** assembly to the surface.

[0236] Once the mandrel **2050** assembly has been removed, measure the distance with the measuring probe thru the $\frac{3}{4}$ inch hole to the tubing string **80**.

[0237] Normally the OD of the tubing string is known. In this case we have a $2\frac{3}{8}$ inch 4.7 #/ft N-80 tubing. When taking the measurement it is never known for sure if you are on a collar or not.

[0238] Care must be taken here when getting these measurements and selecting the size of core bit to drill out the tubing. The Hot Tap Tool **2000** Supervisor will be able to

calculate that and look at the different size holes that can be drilled depending on the inner versus outer size pipes and the distance between them. Always calculate the maximum size hole that can be drilled without drilling into the next casing or tubing string.

[0239] $7\frac{5}{8}$ inch casing **70**x $2\frac{3}{8}$ inch tubing **80** is found to be centered. Install the bit on the Articulating drill **1000**. Rotate the Articulating drill **1000** into place in the front of the Clamp **100**. Install two 1 $\frac{1}{2}$ inch nuts on the #5 and #7 position studs. Tighten up the $2\times 1\frac{1}{8}$ inch nuts installing the Articulating drill **1000** into place on the Clamp **100**. Hydraulic Hoses were previously installed to the Drill **1000**. Advance the drill bit **1400** until the bit touches the $7\frac{5}{8}$ inch casing **70**. At this time the diver must make sure that the drill bit **1400** is lined up on the centerline on the inner string **70** of casing. In one embodiment drill bit **1400** is adjustable in multiple directions (advanced in and out along with adjustment to be able to go right or left, along with the ability to pivot). Drill bit **1400** can be turned up to 5, 10, 15, 20, 25, and 30 degrees of centerline of clamp **100** in order to line up the drill bit **1400** on the centerline of any the tubing string **80** without having to rotate the complete clamp **100** on the drive pipe **50** and starting over. However, should the diver be unable to line up the drill bit **1400** to the centerline of the inner string **80** the diver should move the Clamp **100** and start over.

[0240] Start the drill bit **1400** and make sure it is turning properly. Cut out the coupon being careful not to cut into the $2\frac{3}{8}$ inch tubing **80**. At this time the well will look like FIG. 12. Remove the drill bit **1400** and send to the top. Remove the 2-1 $\frac{1}{8}$ inch nuts and rotate the Articulating drill **1000** back out of the way and secure same.

[0241] The $2\frac{3}{8}$ inch tubing **80** will have to be tapped to determine if it has any pressure inside of same. The center flange **500** will be used with a 20 inch mandrel assembly **2050**. When attempting to effect a seal against the tubing **80** it may be necessary to put a back up seal tip **2010'** against same to keep the tubing **80** from moving as in FIG. 14.

[0242] Test the Teflon seal on the $2\frac{3}{8}$ inch tubing to 250 pounds per square inch low/3,500 pounds per square inch High for 5 minutes each test. The testing will be done by installing a $\frac{1}{4}$ inch test hose on the end of mandrel **2050** with a pressure gauge and bleed off valve. After performing the test to everyone's satisfaction bleed off the pressures and remove the hose and connection.

[0243] Crane to send down the 30 inch stroke hot tap tool **2000'** with a $5\frac{7}{8}$ inchx $\frac{3}{4}$ inch Bit with a $\frac{3}{4}$ inch cutting insert in the bit.

[0244] Make up Hot Tap Tool **2000'** on the mandrel **2050**. Install the $\frac{1}{4}$ inch test hose to the $\frac{1}{2}$ inch needle valve with a pressure gauge and bleed off valve. Test the hot tap tool **2000** against the Teflon seal on the $2\frac{3}{8}$ inch tubing to pounds per square inch low/3,500 pounds per square inch High for 5 minutes each test. Bleed off the pressure.

[0245] Advance the bit in the hot tap tool **2000'** +/-27 $\frac{1}{2}$ inch until it hits the Teflon seal.

[0246] Drill out the seal by hand until it makes contact with the pipe **80**. Pressure up on the hot tap tool **2000'** and the $2\frac{3}{8}$ inch tubing seal **2010** to 1,500 pounds per square inch. Send down a hand drill and make up the hydraulic hoses to same.

[0247] Drill thru the $2\frac{3}{8}$ inch tubing **80**. When the drill bit goes thru the tubing the diver will feel it and there will be a fluctuation in the pressure.

[0248] Check and record pressure. Advance and retract the bit to make sure it is cut out clean. Secure the hand bit. Back

out the bit until it clears the Ball Valve. If the tubing **80** is not static close the ball valve. Bleed off any pressure.

[0249] Remove clamp **100** and the well is finished.

[0250] The following is a list of Reference numerals which are used in this application.

LIST OF REFERENCE NUMERALS	
Reference Number	Description
10	system
50	first pipe
51	opening
60	second pipe
61	opening
62	annular space between first and second pipes
70	third pipe
71	opening
72	annular space between second and third pipes
80	fourth pipe or tubing
82	annular space between third and fourth pipes
84	interior of fourth pipe or tubing
100	clamp
110	stabilizer system
111	plate
112	plate opening
113	plate opening
114	plate slot
115	annular bearing
116	central opening
117	first bearing housing section
118	cavity
119	opening
120	opening
121	bolt
122	bolt
123	lever/handle
124	lever/handle
125	second bearing housing section
126	internally threaded opening
127	internally threaded opening
128	upper part
129	lower part
130	upper flat surface
131	lower flat surface
132	middle flat surface
133	opening
134	upper flat plate surface
135	lower flat plate surface
136	rear flat plate surface
137	front flat plate surface
138	threaded portion
139	threaded portion
150	chain
200	first plate
210	first side
220	second side
230	main opening
240	plurality of openings for supporting compression plate
242	plurality of threaded fasteners
244	plurality of sealing nuts
246	arrow
250	set of foot support openings
252	second set of foot support openings
260	set of foot support openings
262	second set of foot support openings
270	set of foot support openings
272	second set of foot support openings
280	set of foot support openings
282	second set of foot support openings
290	plurality of openings for pivot support bracket
291	bracket
292	plurality of openings for pivot support bracket
293	bracket
294	pin

-continued

LIST OF REFERENCE NUMERALS	
Reference Number	Description
295	plurality of openings for pivot support bracket
296	bracket
297	plurality of openings for pivot support bracket
298	bracket
299	pin
300	support opening
302	support opening
304	support opening or slot
306	support opening or slot
350	foot
360	foot
370	foot
380	foot
390	base
392	curved surface
394	traction system
396	traction system
500	compression plate
510	first side
520	second side
530	plurality of support openings
550	main opening
551	offset from centerline
552	arrow
554	arrow
560	tapered area
580	view opening
582	view opening
584	view opening
586	view opening
600	compression plate
700	double main opening compression plate
702	first section
703	viewing window
704	second section
705	viewing window
710	first side
720	second side
730	plurality of support openings
750	first main opening
752	tapered area for first main opening
754	bore
760	second main opening
762	tapered area for second main opening
800	swivel nut
802	backing nut
810	first side
814	plurality of sides
820	second side
824	plurality of sides
830	tapered area
832	flat surface
840	interior
850	threaded area
854	exterior diameter
1100	articulating drill system
1110	first arm
1120	second arm
1122	pivot connection between first and second arms
1150	base
1152	pivot connection between second arm and base
1160	longitudinal track system
1170	handle for longitudinal track system
1200	perpendicular track system
1210	handle for perpendicular track system
1300	drill motor
1400	cutting tip
1410	arrow
1420	arrow
1500	connection plate
1502	plurality of openings
1510	pivoting joint between connection plate and base

-continued

LIST OF REFERENCE NUMERALS	
Reference Number	Description
1550	quick release/quick lock for pivoting joint
2000	hot tapping system
2010	tip
2011	sealing insert material
2012	curved surface of sealing insert material
2014	cup for sealing insert
2015	curved surface of tip
2016	first end
2017	second end
2018	peripheral recess
2020	O-ring seal
2050	barrel
2054	threading
2100	hot tap drill
2110	drill bit
2200	arrow
2210	arrow

[0251] All measurements disclosed herein are at standard temperature and pressure, at sea level on Earth, unless indicated otherwise. All materials used or intended to be used in a human being are biocompatible, unless indicated otherwise.

[0252] The foregoing embodiments are presented by way of example only; the scope of the present invention is to be limited only by the following claims.

1-23. (canceled)

24. A system for hot tapping a plurality of nested pipes including an exterior pipe having a bore and at least one interior pipe contained within the bore comprising:

- (a) a hot tap tool guide assembly supported by the exterior pipe, the assembly including at least one plate having a plate opening;
- (b) a hot tapping tool, the tool including a hot tapping tip;
- (c) a seal member on the hot tapping tool which creates a seal between the hot tapping tool and a selected one of the pipes; and
- (d) the hot tap tool guide assembly including a swiveling connection opening for supporting the hot tapping tip wherein the tip can be swiveled relative to the plate and wherein the tip is extendable through the plate opening.

25. The system of claim 24, wherein the tip is articulable in three hundred and sixty degrees about a generally circular path.

26. The system of claim 24, wherein the tip is connected to the assembly through the swiveling connection and the swiveling connection includes a ball and socket joint.

27. The system of claim 24, wherein the swiveling connection includes a swivel nut mounted on the plate which operatively connects the tip to the assembly and allows the angular articulation of the tip relative to the plate.

28. The system of claim 24, wherein the hot tap tool guide assembly includes a compression plate and swivel nut, the swivel nut being connected through a ball and socket joint to the compression plate, the swivel nut being threadably connected to a mandrel, and the tip being connected to the mandrel, so that rotation of the mandrel relative to the swivel nut in a first direction causes movement of the mandrel towards the interior of the hot tap tool guide assembly, and relative rotation of the mandrel relative to the swivel nut in a second direction causes movement of the mandrel away from the plate.

29. The system of claim 28, wherein the plate includes at least one viewing window.

30. The system of claim 28, wherein the swivel nut is eccentrically mounted on the plate so that rotation of the plate causes linear movement of the swivel nut relative to the hot tap tool guide assembly.

31. The system of claim 28, wherein the swivel nut is eccentrically mounted on the plate so that rotation of the plate causes a relative change in position of the swivel nut relative to the hot tap tool guide assembly.

32. The system of claim 24, wherein the hot tap tool guide assembly includes a clamp which detachably connects the hot tap tool guide assembly to the exterior of the pipe.

33. The system of claim 24, wherein there are straps attached to the plate that enable the plate to be secured to the pipe, wherein the straps hold the plate to the pipe.

34. A method of tapping hot tapping a plurality of nested pipes having an exterior pipe and at least one interior pipe comprising the steps of:

- (a) supporting a hot tapping tool with the exterior pipe;
- (b) articulating the hot tapping tool in relation to at least one of the plurality of nested pipes;
- (c) providing a seal member on the hot tapping tool that creates a sealing connection with an exterior surface of a selected one of the plurality of nested pipes; and
- (d) hot tapping to at least two selected pipes from the selected plurality of the nested pipes.

35. The method of claim 34, wherein in step “a”, the hot tapping tool includes a swiveling connection for a hot tapping tip wherein the hot tapping tip can be non-linearly articulated from a line that is generally perpendicular to an exterior surface of the exterior pipe.

36. The method of claim 34, wherein the tip is connected to hot tapping tool through a ball and socket joint.

37. The method of claim 34, wherein the tip includes a swivel nut which operatively connects the tip to the hot tapping tool and allows the angular articulation of the tip.

38. The method of claim 34, wherein the hot tapping tool includes a compression plate which provides a longitudinal force on the tip to compress the tip, and swivel nut, the swivel nut being connected through a ball and socket joint to the hot tapping tool, the swivel nut being threadably connected to a mandrel, and the tip being connected to the mandrel, such that rotation of the mandrel relative to the swivel nut in a first direction causes movement of the mandrel towards an interior of the hot tapping tool, and relative rotation of the mandrel relative to the swivel nut in a second direction causes movement of the mandrel away from the interior of the hot tapping tool.

39. The method of claim 38, wherein during step “d”, the hot tapping tool includes at least one viewing window which allows for viewing of the tip.

40. The method of claim 38, wherein during step “d” the hot tapping tool includes a plurality of viewing windows, each of which allows for viewing of the tip.

41. The method of claim 34, wherein multiple coaxial strings of underwater piping and/or tubing for overturned rigs or platforms are simultaneously hot tapped.

42. The method of claim 34, wherein during step “b” angular adjustment of the tip relative to the exterior piper includes adjustment both up and down and side to side, and in a spherical manner.

43. The method of claim **34**, wherein during step “d” one or more openings provide visual access to pipes and the area of hot tapping seal even while hot tapping tool is mounted on the clamp.

* * * * *